



MEMO

June 21, 2016

TO: Administrative File
From: Carolyn A. Nelson

District: Fort Worth
County: Parker
CSJ#: 0314-07-051, 052, 046
Highway: IH 20
Let Date: August 2016
Project Limits: 0.55 west of East Bankhead Highway to Lakeshore Drive

Project Description: Stipulation IX, Appendix 6. Interchange Improvements. 13.77 acres of new ROW. No adverse effects to historic property.

SUBJECT: Internal review under the Section 106 Programmatic Agreement (Section 106 PA) among the Texas Department of Transportation, Texas State Historic Preservation Officer, Advisory Council on Historic Preservation, and Federal Highway Administration; and the Memorandum of Understanding (MOU) between the Texas Historical Commission and the Texas Department of Transportation

The environmental review, consultation, and other actions required by applicable Federal environmental laws for this project are being, or have been, carried-out by TxDOT pursuant to 23 U.S.C. 327 and a Memorandum of Understanding dated December 16, 2014, and executed by FHWA and TxDOT.

Introduction

Parker County in collaboration with the Texas Department of Transportation – Fort Worth District proposes to make interchange improvements along the Interstate facility for approximately 3.44 miles in Parker County from 0.55 mile west of East Bankhead Highway to Lakeshore Drive.

Survey Methods

A review of the NRHP, the list of State Antiquities Landmarks (SAL), and the list of Recorded Texas Historic Landmarks (RTHL) indicated no historic properties documented within the area of potential effects (APE).

A variable APE for the proposed project was determined through consultation with the State Historic Preservation Officer (SHPO) as follows:

- In locations where the proposed improvements would occur within the existing right-of-way, the APE was the existing right-of-way.
- In sections where proposed improvements would occur within an existing transportation corridor but would require new right-of-way, the APE was 150 feet beyond the existing and proposed right-of-way.
- In the sections where new frontage road construction is proposed, the APE was 300 feet.

OUR GOALS

MAINTAIN A SAFE SYSTEM • ADDRESS CONGESTION • CONNECT TEXAS COMMUNITIES • BEST IN CLASS STATE AGENCY

An Equal Opportunity Employer

Determinations of NRHP Eligibility

Based on the June 2016 Reconnaissance level Historic Resources Survey Report (HRSR), 39 Resources at 18 locations (built prior to 1971) are located within the APE. One property is determined to be eligible for listing to the NRHP:

- Resource #3A – E. Bankhead Drive, is a segment of the Bankhead Highway constructed in 1921 that was determined eligible by the Texas Historical Commission (THC) for listing in the National Register of Historic Places (NRHP). However, the 1968 steel continuous I beam bridge that carries E.Bankhead Drive over IH 20 is a non-contributing resource to the NRHP-eligible roadway segment because it was not included on the Federal Highway Administration's (FHWA) Final List of Nationally and Exceptionally Significant Features of the Federal Interstate Highway System.

The remaining historic age resources were determined not eligible for the NRHP.

Resource #9 – a circa 1925 farmstead was evaluated as a historic farmstead and the domestic resource for individual eligibility and determined not eligible. Resource #9 no longer functions as a significant producer of a crop identified in the historic context that was important to the historic development of the region nor does it represent an intact agricultural complex (see page 13 of the survey for a more in depth evaluation). In addition the domestic resource is a modest example when compared to similar houses with this form in this area and Texas.

The APE was evaluated for the presence of historic districts and rural historic landscapes. The portions of the project area with historic-age resources were either characterized by relatively isolated residences or clusters of development. Within these areas of more-concentrated residential groupings, development patterns resulted in a patchwork of development. As a result of this pattern and the construction trends that were arranged or implemented for a particular purpose, including the loss of integrity for several of the surveyed resources, no cohesive districts or rural historic landscapes with a shared historic context were identified.

CHC Consultation

The Parker County Historical Commission (CHC) was consulted about the project and offered no concerns regarding the proposed project.

Determination of Effects:

Staff determined that the project poses no adverse effect to historic properties in the APE, given the following factors:

- There are no direct effects to the NRHP eligible Bankhead Highway (Resource 3A) that would diminish the Highway's ability to convey its historic significance. At the E. Bankhead Drive/IH 20 interchange the proposed project entails reconstruction of the frontage road system largely within the existing right-of-way (there would be small amounts of corner clips acquired as new right-of-way).
- There are no indirect adverse effects to historic properties. The eligible Highway will continue to convey its significance and its integrity of location, design, setting, materials and workmanship will not be affected.
- There are no reasonably foreseeable cumulative effects now or in the future given the roadway's current alignment and the area's already built up modern development.

CSJ: 0314-07-051,etc
FTW/Parker

Conclusion

At a future time and under a different project, the bridge that carries E. Bankhead Drive over IH 20 will be replaced and is not included in this current project.

Therefore, pursuant to Stipulation IX, Appendix 6 "Undertakings with the Potential to Cause Effects per 36 CFR 800.16(i)" of the Section 106 PA and the MOU, TxDOT historians determined that there are no adverse effects to historic, non-archeological properties in the APE. Individual project coordination with SHPO is not required.

Lead Reviewer RMDobrasko for TxDOT 6/24/2016
Rebekah Dobrasko Date

Approved by Bruce Jensen for TxDOT 6.24.16
Bruce Jensen Date



Report for Historical Studies Survey

Interstate Highway 20: from 0.55 mile west of East Bankhead Highway to Lakeshore Drive

Parker County, Fort Worth District

CSJ: 0314-07-051, 0314-07-052, and 0314-07-046

Principal Investigator: Heather Goodson, Cox|McLain
Environmental Consulting, Inc.

June 28, 2016

The environmental review, consultation, and other actions required by applicable Federal environmental laws for this project are being, or have been, carried out by TxDOT pursuant to 23 U.S.C. 327 and a Memorandum of Understanding dated December 16, 2014, and executed by FHWA and TxDOT.

This technical report is produced for the purposes of meeting requirements under Section 106 of the National Historic Preservation Act, the Antiquities Code of Texas, and other cultural resource legislation related to environmental clearance as applicable.

Abstract

Parker County, in collaboration with the Texas Department of Transportation (TxDOT), Fort Worth District, proposes improvements to the interchange between Interstate Highway (IH) 20 and Center Point Road in Parker County. The proposed improvements include reconstruction of the Center Point Road interchange and the addition of frontage roads along IH 20 between E. Bankhead Drive and Lakeshore Drive. The proposed project length is approximately 3.4 miles. A more detailed project description is provided below. See Figure 2 in Appendix C and project design schematics in Appendix D for details.

A reconnaissance survey was conducted of a variable area of potential effects (APE). The APE was defined as follows:

- In locations where the proposed improvements would occur within the existing right-of-way, the APE was the existing right-of-way.
- In sections where proposed improvements would occur within an existing transportation corridor but would require new right-of-way, the APE was 150 feet beyond the existing and proposed right-of-way.
- In the sections where new frontage road construction is proposed, the APE was 300 feet.

In all, 39 historic-age (constructed before 1971) resources located on 18 parcels were documented. Additionally, 10 non-historic-age resources associated with historic-age resources were also documented in the inventory, but are not described in this report.

The documented historic-age resources are categorized based on historic function/use as follows:

| | |
|------------------------------|----|
| Agriculture/Outbuilding | 3 |
| Domestic/Single Dwelling | 15 |
| Domestic/Secondary Structure | 17 |
| Religion/Religious Facility | 1 |
| Transportation/Road-Related | 3 |

One resource (Resource 3A), E. Bankhead Drive, is a segment of the Bankhead Highway constructed in 1921 that was determined eligible by the Texas Historical Commission (THC) for listing in the National Register of Historic Places (NRHP). However, the 1968 bridge that carries E. Bankhead Drive over IH 20 is a non-contributing resource to the NRHP-eligible roadway segment. In accordance with Section 6007 of the *Safe, Accountable, Flexible, Efficient Transportation Equity Act: A Legacy for Users* (SAFETEA-LU), this bridge within the right-of-way of the interstate system is not eligible for the National Register since it was not included on the Federal Highway Administration's (FHWA) Final List of Nationally and Exceptionally Significant Features of the Federal Interstate Highway System. None of the other documented resources are recommended eligible for the NRHP as a result of the survey.

The proposed project would not have an adverse effect on the NRHP-eligible segment of E. Bankhead Drive, formerly known as the Bankhead Highway.

Project Identification

- **Date:** 06/28/2016
- **Date(s) of Fieldwork:** 06/10/2016
- **Historical Studies Survey Type:** Constraints Analysis Reconnaissance
Intensive
- **Report Version:** Draft Final
- **Regulatory Jurisdiction:** Federal State
- **TxDOT Contract Number:** Unknown
- **District:** Fort Worth
- **County or Counties:** Parker
- **Highway:** Interstate Highway (IH) 20, from 0.55 mile west of East Bankhead Highway to Lakeshore Drive
- **Report Author(s):** Heather Goodson, Cox | McLain Environmental Consulting, Inc.
- **Principal Investigator:** Heather Goodson, Cox | McLain Environmental Consulting, Inc.

Project Description

- **Project Type:** Improvement of interchange at IH 20
- **Total Project Length:** Approximately 3.4 miles
- **New Right of Way (ROW) Acreage:** 13.77 acres
- **Easement Acreage:** 0.27 acres of temporary easements; 0.418 acres of permanent easements
- **Project Description and Impacts:** The proposed facility would include the following improvements:
 - Construct new divided Center Point Road bridge, with two through-lanes and two-left turn lanes
 - Convert existing Center Point Road bridge into WB to EB U-turn bridge
 - Construct EB to WB U-turn bridge adjacent to Center Point bridge
 - Construct WB IH 20 auxiliary lane from IH 20 Station 2489+57.50 to Station 2503+00.00
 - Construct WB IH 20 exit ramp from Station 2476.80.11 to Station 2489+57.50
 - Replace WB frontage road from Station 2501+82.68 to Center Point Road
 - Construct WB frontage road from Center Point Road bridge to Station 2465+00
 - Replace WB frontage road from Station 2465+00 to East Bankhead Drive
 - Construct new divided East Bankhead Bridge with two through-lanes and dedicated left turn lane (Note: this bridge will be constructed at a later date under a separate project; it is included in the scope of work for NEPA purposes)
 - Construct WB to EB U-turn bridge adjacent to East Bankhead bridge (Note: this bridge will be constructed at a later date under a separate project; it is included in the scope of work for NEPA purposes)
 - Construct WB frontage road from East Bankhead Drive to Station 2427+04.37
 - Replace WB IH-20 entrance ramp from Station 2427+04.37 to Station 2407+74.96
 - Construct EB frontage road from Station 2429+50.00 to East Bankhead Drive
 - Replace EB IH-20 exit ramp from Station 2419+49.02 to Station 2433+07.45
 - Construct EB frontage road from East Bankhead Drive to Center Point Road
 - Construct EB exit ramp from IH-20 Station 2440+17.46 to IH-20 Station 2457+86.78
 - Construct EB entrance ramp from IH-20 Station 2471+48.13 to Station 2482+83.44
 - Construct EB IH-20 Auxiliary Lane from IH-20 Station 2482+83.44 to Station 2504+71.73
 - Construct EB exit ramp from station 2504+71.73 to Station 2516+59.09
 - Construct EB frontage road from Center Point Road to existing frontage road at Station 2542+00

- Replace existing EB frontage road from IH-20 Station 2542+00.00 to Station 2587+26.18
- Construct EB entrance ramp from IH-20 Station 2534+62.87 to IH-20 Station 2548+21.30
- Construct EB Auxiliary Lane from IH-20 Station 2548+21.30 to Station 2564+30.45
- Construct EB exit ramp from IH-20 Station 2564+30.45 to Station 2576+36.89

The proposed Center Point Road bridge would consist of two 14-foot through lanes in each direction and a 12-foot left-turn lane in each direction with 2-foot outside offsets. There would be a dedicated left turn lane for each direction of travel and a 24-foot wide median. Seven-foot sidewalks would be constructed on both sides of the bridge for pedestrians. The access ramps would consist of one 14-foot wide travel lane with 9-foot wide outside shoulders and 4-foot wide inside shoulders. All newly constructed and reconstructed frontage roads would include one 14-foot-wide through lane and one 12-foot-wide through lane with 2-foot-wide inside and outside offsets. The adjacent areas would be graded for the future addition of sidewalks. The IH 20 travel lanes would not be widened with the proposed interchange project.

Utility adjustments would be needed for this project, which include telephone, electric, gas, and water lines. The adjustment and relocation of any utilities would be phased so that no substantial interruptions would take place while these adjustments are being made. The appropriate utility company would be responsible for the adjustments and relocations.

The proposed interchange would include expanding the total right-of-way (ROW) by 13.77 acres and permanent easement by 0.418 acre with 0.27 acre of temporary construction easement and 22.0 acres of vegetated land within the existing ROW would be paved, primarily due to the construction of new frontage roads. There would be approximately 18.6 acres of temporary impact within the existing ROW.

▪ **Area of Potential Effects (APE):**

The existing ROW

150 feet from proposed ROW and easements

300 feet from proposed ROW and easements

Custom:

The APE is defined as existing right-of-way in sections where work would be conducted within existing right-of-way; 150-feet-wide in sections where new right-of-way or easements would be required for work in an existing transportation corridor, and 300-feet-wide in sections of proposed new frontage road locations, in accordance with Stipulation I.B.2. of the *Programmatic Agreement Among the Federal Highway Administration, the Texas Department of Transportation, the Texas State Historic Preservation Officer, and the Advisory Council on Historic Preservation Regarding the Implementation of Transportation*

Undertakings, and in consultation with TxDOT Environmental Affairs Division, Historical Studies Branch. See **Figure 2** for illustration of the APE.

Project Setting

- **Study Area:** In accordance with standard TxDOT procedure for historic resources surveys, the proposed study area is defined as the APE plus the 0.25-mile-wide area around the APE. The study area is generally characterized by mid- to late-twentieth century residential and commercial development. Historically, the study area was characterized by large parcels in agricultural production with small communities located at the crossroads of major transportation corridors, such as the intersection of East Bankhead Drive and Center Point Road south of the project area and Center Point Road's intersection with US 80 northeast of the project area. Preliminary research indicated the general historical periods for the study area are early twentieth century agricultural and transportation development, and mid- to late-twentieth century suburbanization and expansion. These periods of significance were confirmed during fieldwork.

A review of the THC survey files and Historic Sites Atlas, the National Register of Historic Places (NRHP), the list of State Antiquities Landmarks (SAL), the list of Recorded Texas Historic Landmarks (RTHL), and Official State Historic Markers (OSHM) was completed. A review of the TxDOT GIS files for historic bridges and previously-surveyed historic properties and districts was also conducted. Based on review of the Bankhead Highway survey information available from the THC, the East Bankhead Drive segment within the project area was identified as an individually eligible segment of roadway. According to the inventory form, the segment was built ca. 1920, and begins just west of its intersection with IH 20 southeast of Hudson Oaks and extends 7.1 miles northwest to its intersection with US 180 on the east side of downtown Weatherford. East of the interstate, the roadway is 26 feet wide; it is 20-22 feet wide west of the interstate. The road widens at the IH 20 overpass. No other previously identified resources within the APE or within the 0.25-mile buffer of the APE were identified during the file search.

- **Historic Land Use:** Historically, the project area was primarily open land in agricultural production. There was minor residential development at the crossroads of the major early twentieth century roads through the general area, such as the development at Center Point where E. Bankhead Drive and Center Point Road intersect. After IH 20 was constructed in the 1960s, commercial and residential development began along the highway corridor, with concentrations at major intersections.
- **Current Land Use:** The proposed project extends along IH 20 east of Weatherford in an area that has seen substantial residential, commercial, and retail development since the 1960s, particularly at the eastern end of the project area in Hudson Oaks. Hudson Oaks has experienced substantial commercial and retail development along the IH 20 corridor since the late twentieth century. At the western end of the project area, a large Love's gas station/truck stop has been constructed at the southeast corner of the intersection of IH 20

and E. Bankhead Drive. The middle portion of the project area at Center Point Road is characterized by mid-twentieth century residential development with lands in agricultural production surrounding the residential areas.

- **Historic Period:** Based on the basic research to-date, the likely period of significance is 1920 to 1971. The period of significance begins with construction of the Bankhead Highway alignment that traverses the project area and the subsequent road-related development. It ends in 1971, which is the 45-year survey cut-off date. Development and growth that began in the 1960s, including the construction of IH 20, continued through the rest of the twentieth century. Preliminary research did not identify any particular event demarcating a transition between periods that could serve as the end date for the period of significance.

Comments on Project Setting: Existing impacts in the project area include non-historic-age residential and commercial development.

Consulting Partners

The implementing regulations for Section 106 define the parties entitled to participate in the Section 106 process as: the agency official, the Advisory Council on Historic Preservation (at its discretion), consulting parties, and the public. The following is a list of consulting parties for the proposed project:

Parker County Historical Commission
Janice Smith, Chair
704 West Lake Drive
Weatherford, TX 76087
817-269-4542
janicesmith98@gmail.com

The Parker County Historical Commission was contacted regarding this project. Chair Janice Smith indicated in an email dated May 25, 2016, that the Parker County Historical Commission reviewed the project area and did not find any sites that would be affected. She did make note of two cemeteries in the vicinity of the project area and provided comment regarding the possibility of discovering dinosaur bones or Spanish Conquistador artifacts during construction.

Survey Methods

- **Surveyors:** Heather Goodson, Cox|McLain Environmental Consulting, Inc.
- **Methodological Description:** A reconnaissance survey was conducted in order to identify properties in the APE that are 45 years old or older (constructed prior to 1971) and to determine whether any resources warrant further study. The reconnaissance survey involved developing a historic context for the study area, including relevant themes in historical development and identification of property types likely to be encountered in the APE.

Comments on Methods: This survey complies with TxDOT survey standards. Right-of-entry (ROE) was generally not an issue since most resources were visible from the public ROW. If resources were not fully visible from the public ROW, aerial photos (from 1995, 2004, 2008, 2010, and 2012) and topographic maps (from 1914, 1919, 1932, 1960, 1961, 1963, 1979, 1985, and 1991) were used to identify and evaluate the resources.

Survey Results

- **Project Area Description:** As described in the sections on Current Land Use and Project Setting, the project area is characterized by a mix of land uses, including some historic-age residential development, more recent residential development, a NRHP-eligible segment of Bankhead Highway, and two historic-age bridges. As a result of the survey, 39 historic-age properties were documented on 18 parcels.

- **Literature Review/Context:**

The proposed project area is located at the southeast edge of Weatherford, the county seat of Parker County. The City of Hudson Oaks is located just east of the project area.

Settlement of Weatherford dates to the mid-1800s, and it was the principal frontier settlement in North Texas for its first decade (Minor 2010). The Texas and Pacific Railway was built through Weatherford in 1880, and the city experienced steady growth in the late nineteenth century. By the turn of the twentieth century, there were approximately 5,000 residents, 100 businesses, 7 churches, and several schools in the town (Minor 2010).

Agricultural production was the mainstay of the region's economy from the beginning of Euro-American settlement. Corn and wheat production and livestock (cattle, milk cows, swine, and sheep) raising were the primary activities in the last several decades of the nineteenth century. Once the railroads arrived in the area, Weatherford served as the shipping point for the county's farmers and ranchers. In the first decade of the twentieth century, the agricultural base shifted to cotton and it quickly became the primary crop. Farmers also diversified into fruit, including peach trees and watermelons. However, farmers experienced an economic downturn between 1910 and 1920, and had barely recovered when the Great Depression hit the country in the 1930s, causing severe economic distress across all sectors of the nation's economy (Echeverria 2010/2016).

Following the Great Depression and World War II, the agricultural economy of the region rebounded somewhat, with hay and peanuts becoming major crops, and the population began increasing. Additionally, Parker County became one of the state's leading producers of livestock, vegetables, and fruits other than citrus, particularly watermelon, by the 1960s (Echeverria 2010/2016). The area's transportation network, which began developing in the late 1910s and early 1920s with the construction of the Bankhead Highway, continued to expand in the 1960s with the construction of IH 20. This facilitated the growth of related developments along the roadways (discussed in more detail below). In the post-World War II period, Weatherford's population increased from over 8,000 in 1950 to 14,804 in 1990

(Minor 2010). By 2000, Weatherford had over 19,000 residents, and the city limits had expanded far enough from the central core to encompass the project area.

Immediate Project Area

Historic topographic maps and aerial photos indicate the project area was sparsely populated prior to the mid-twentieth century. The small community of Center Point developed south of the project area where Center Point Road intersected with East Bankhead Drive, which was an early alignment of the Bankhead Highway. To the north of the project area, a small community called Punkin Center was established at Center Point Road's intersection with US 80, which was designated in the mid-1930s as the Bankhead Highway (discussed in more detail below). Preliminary research indicated that neither community was ever incorporated and never grew to be very large. Today, the Weatherford city limits terminate just short of each community.

As automobiles were becoming more commonplace, development of the state's transportation network began in earnest in 1917 with the founding of the Texas Highway Department. A series of named highways, including the Bankhead Highway, soon criss-crossed the United States. Designated as State Highway 1, the Bankhead Highway was the first all-weather transcontinental highway in the United States and encompassed over 850 miles of Texas between Texarkana and El Paso (HHM, Inc. 2016a). The segment of the Bankhead Highway that traverses the project area is an early alignment that was part of the 1921 Dunn Tourist Guide alignment and the ca. 1930-1934 alignment that followed historic US 67/80 (HHM, Inc. 2016b). In the mid-1930s, the Bankhead Highway was realigned through Weatherford to follow present-day US 80.

In the 1960s, IH 20 was constructed through Weatherford, including new interchanges with the 1921 segment of the Bankhead Highway and with Center Point Road; this new construction connected the communities of Center Point and Punkin Center. With construction of IH 20, the project area began seeing residential, commercial, and retail development along the corridor, particularly at the interchanges.

Following World War II, the Ranch style became popular nationwide for new residential construction. It was developed in Southern California in the mid-1930s and was one of the small house types built under Federal Housing Authority (FHA) financing guidelines in the 1940s (McAlester 2013). As FHA guidelines became more flexible after World War II, the Ranch style gained popularity. It is characterized by a horizontal one-story shape and low-pitch roof, with the front entry typically off-center. A garage is often attached to the main elevation. According to McAlester, side-gabled roofs are more common in rural areas, which is consistent with the Ranch-style houses documented in the project area. Many different types and sizes of windows are found on Ranch houses, including windows manufactured in standard sizes using production methods developed during World War II. Entries are almost always recessed, either into the front elevation or under a porch. Porch supports are often simple wood posts or fabricated metal supports. Early small examples of the Ranch style

may be referred to as Minimal Ranch or Minimal Traditional and generally lack a broad overhanging roof and other elaborations (McAlester 2013; Jakle 1989).

- **APE Integrity:** In general, historic-age properties within the APE have been modified over time. Factors compromising the integrity of the historic-age properties are primarily related to replacement of materials such as siding and windows, as well as additions to properties.

Recommendations

- **Historic Property Evaluations:**

- **Properties Not Eligible for the NRHP:**

- Domestic Properties*

- Constructed between 1949 and 1965, Resources 5, 7A, 8A, 12A and 16A are houses with the bungalow form with no distinguishing characteristics. Each resource is a very modest example when compared to similar houses with this form in the area and in Texas. No associations were identified linking these resources to persons or events of historic importance. Furthermore, the resources do not embody distinctive characteristics of a type, period, or method of construction when compared with other nearby houses. They do not represent the work of a master or possess high artistic value. As a result, they are recommended not eligible for inclusion in the NRHP under Criteria A, B, or C.
 - Resources 6, 14A, 15A, and 18A are Minimal Traditional houses constructed between ca. 1955 and ca. 1965. Each resource is a modest vernacular example similar to other houses with these forms in the area and in Texas. The resources have no distinguishing characteristics. No associations were identified linking these resources to persons or events of historic importance. Furthermore, the resources do not embody distinctive characteristics of a type, period, or method of construction when compared with other nearby houses. They do not represent the work of a master or possess high artistic value. As a result, they are recommended not eligible for inclusion in the NRHP under Criteria A, B, or C.
 - Resources 2A, 4A, 10A, 11A, and 17A are Ranch houses constructed between ca. 1960 and ca. 1970. Each resource is a relatively modest example of a house with the Ranch form when compared to similar houses with this form in the area and in Texas. No associations were identified linking these resources to persons or events of historic importance. Furthermore, the resources do not embody distinctive characteristics of a type, period, or method of construction when compared with other nearby houses. They do not represent the work of a master or possess high artistic value. As a result, they are recommended not eligible for inclusion in the NRHP under Criteria A, B, or C.
 - Resources 2B, 4B, 7B, 8D, 8E, 12B, 12C, 14B, 14D, 15B, 17B, 17C, 17D, 18B, and 18C are secondary structures associated with residences. Constructed between

1925 and ca. 1970, these are utilitarian resources used as workshops, garages, equipment storage buildings, or well houses. All of these resources lack distinctive characteristics. No associations were identified linking these resources to persons or events of historic importance. Furthermore, the resources do not embody distinctive characteristics of a type, period, or method of construction when compared with other nearby houses. They do not represent the work of a master or possess high artistic value. As a result, they are recommended not eligible for inclusion in the NRHP under Criteria A, B, or C.

- Resource 9 is a ca. 1925 farmstead comprised of the primary residence (Resource 9A), several secondary structures and buildings related to the domestic operations of the property, and a number of barns and other agricultural outbuildings. Constructed ca. 1925, Resource 9A is a one-story, cross gable house in the bungalow form. It is clad in replacement vinyl siding and has a corrugated metal roof. The partial width, front gable porch wraps around the projecting entrance to the north. The windows are covered with storm windows and appear to be two-over-two aluminium sash windows. An addition extends the house to the north. Resource 9B is a wood-clad well house and windmill standing at the northeast edge of the house's front yard. Resource 9C is a ca. 1960 single-car garage with a workshop addition. Resources 9D-9H are various barns and other agricultural-related outbuildings that were constructed between ca. 1925 and ca. 2000 to support the farm's operations. Based on the types of buildings, the small farm's operations have included crop production and small-scale livestock raising. At the time of the recent fieldwork, there was no evidence of livestock at the farm, and the fields were being harvested for hay.

To evaluate Resource 9, two key questions were assessed: 1) does research indicate the potential for this area, including the Resource 9 farmstead, to be a significant producer of a particular crop or livestock and 2) does the farmstead represent an intact agricultural complex that may have significance under Criterion C. Research indicates the area around the community of Center Point has had a history of producing various crops, including cotton, peanuts, and hay ("Center Point News," *The Daily Herald*, October 14 and 20, 1920) . However, there was no indication this area was a significant producer of a particular crop for the region. Weatherford became a significant producer of watermelons but research did not indicate farmers near Center Point were raising watermelons. As such, no important associations under Criterion A in the area of Agriculture or other events and persons of historic importance were identified.

With construction in the mid-1920s, Resource 9 does not represent a particularly early example of an agricultural complex. While the farmstead retains original barns, other agricultural-related buildings have been added to the complex over time. As such, the farmstead does not embody distinctive characteristics of a type, period, or method of construction when compared to other farmsteads in the region. The resource does not represent the work of a master or possess high artistic value. As a

result, Resource 9 is recommended not eligible for inclusion in the NRHP under Criteria A, B, or C.

Transportation/Road-related Resources

- Resource 3B is a steel continuous I beam bridge that carries E. Bankhead Drive over IH 20. Resource 13 is a prestressed concrete I beam bridge that carries Center Point Road over IH 20. In accordance with Section 6007 of SAFETEA-LU, these bridges within the right-of-way of the interstate system are not eligible for the National Register since they were not included on FHWA's Final List of Nationally and Exceptionally Significant Features of the Federal Interstate Highway System.

Religious Property

Constructed ca. 1970, Resource 1 is the Bankhead Church of Christ. It is a brick, front gable building with entrance doors centered on the primary (east) elevation and protected by a partial width, front gable porch. The church has minimal stylistic influence and no distinguishing characteristics.

In evaluating the Bankhead Church of Christ, Criterion Consideration A is applied. For eligibility, it must be significant for its architectural or artistic merit or based on its role in historical events. During development of the historic context and field survey, no evidence was found to indicate the church had been the location of important historical events. Furthermore, it is a relatively modest example of its type and does not have architectural or artistic merit that rises to the level of significance necessary for NRHP eligibility. As such, the Bankhead Church of Christ does not meet Criterion Consideration A and is recommended not eligible for listing under Criteria A, B, or C.

Districts and Historic Landscapes

- The APE was evaluated for the presence of historic districts and rural historic landscapes. The portions of the project area with historic-age resources were either characterized by relatively isolated residences or clusters of development. Within these areas of more-concentrated residential groupings, development patterns have resulted in a temporal patchwork of development. As a result of this pattern and the ad hoc nature of construction trends, including the loss of integrity for several of the surveyed resources, no cohesive districts or rural historic landscapes with a shared historic context were identified.
- **Properties Eligible for the NRHP:**

Transportation-related Resources

- Resource 3A, currently designated as E. Bankhead Drive, is a segment of the former Bankhead Highway that was determined eligible for NRHP listing in 2014. Constructed ca. 1920, the eligible segment is 7.1 miles in length and extends from IH 20 on the east end to US 180 on the west end. The roadway is 20-22 feet wide

west of IH 20 and 26 feet wide east of IH 20. It was determined eligible under Criterion A.

Resource 3B, the 1968 bridge that carries E. Bankhead Highway over IH 20, is a non-contributing feature of the eligible resource. When the bridge was constructed, the roadway was widened at the interchange. The interchange has also been modified over time to improve turning movements for large trucks. Furthermore, the bridge was determined not eligible as a bridge located within the right-of-way of the interstate highway system. The segment of roadway associated with the interchange, which is considered non-contributing to the NRHP-eligible road corridor, extends from the driveways for the office building at 2614/2618 E. Bankhead Drive and the residence at 3009 E. Bankhead Drive on the southeast end to approximately 300 feet northwest of the IH 20 westbound frontage road. These limits are indicated by the transitions in the roadway pavement due to previous modifications and widening of the IH 20 interchange.

- **Comments on Evaluations:** Evaluations were completed in accordance with the National Park Service's National Register Bulletin *How to Apply the National Register Criteria for Evaluation*.
- **Effects:** In accordance with 36 CFR 60 and 36 CFR 800.11, the criteria of effect were applied to Resource 3A, the NRHP-eligible segment of the Bankhead Highway. The proposed project would have **No Adverse Effect** on the characteristics of the property that qualify it for inclusion in the NRHP. At the E. Bankhead Drive/IH 20 interchange the proposed project entails reconstruction of the frontage road system largely within the existing right-of-way (there would be small amounts of corner clips acquired as new right-of-way). At a future time and under a different project, the bridge that carries E. Bankhead Drive over IH 20 will be replaced. Since the work in the immediate area of the interchange would occur within the boundaries of the roadway segment that is considered as non-contributing to the NRHP-eligible Bankhead Highway corridor, there would be no direct effects. There would be no indirect effects from the proposed project on the NRHP-eligible corridor because the proposed project is essentially replacing existing infrastructure and is not introducing any significant new features to the landscape.
- **Further Work:** No further work is recommended at this time for the current project. When the future project to replace the E. Bankhead Drive bridge is planned, potential indirect effects of the bridge replacement project on the NRHP-eligible road corridor should be assessed when details of the future project are available.
- **Justification:** The bridge replacement project for the E. Bankhead Drive/IH 20 interchange is not included in the current project. More complete details of the proposed project are needed before indirect effects can be assessed. Depending on how far the approach roadway work would extend north and south of the interchange

(i.e. if the work extends beyond the boundaries of the non-contributing roadway segment), a direct effects assessment may also be required.

References

Echeverria, Jeri

- 2010 "Parker County," *The Handbook of Texas Online*, (<http://www.tshaonline.org/handbook/online/articles/hcp03>), accessed June 8, 2016. Uploaded on June 15, 2010; Modified February 15, 2016. Published by the Texas State Historical Association.

HHM, Inc.

- 2016a *Bankhead Highway Map: Grand Prairie to Eastland Segment*. Available at the Texas Historical Commission website <http://www.thc.state.tx.us/preserve/projects-and-programs/historic-texas-highways/bankhead-highway/bankhead-highway-maps>

-
- 2016b *The Development of Highways in Texas: A Historic Context of the Bankhead Highway and Other Historic Named Highways*. Available at the Texas Historical Commission website <http://www.thc.state.tx.us/preserve/projects-and-programs/historic-texas-highways/bankhead-highway/bankhead-highway-history>

Jakle, John A., Robert W. Bastian, and Douglas K. Meyer

- 1989 *Common Houses in America's Small Towns: The Atlantic Seaboard to the Mississippi Valley*. Athens, Georgia: The University of Georgia Press.

McAlester, Virginia Savage

- 2013 *A Field Guide to American Houses*, Second Edition. New York: Alfred A. Knopf.

Minor, David

- 2010 "Weatherford, TX," *The Handbook of Texas Online*, (<http://www.tshaonline.org/handbook/online/articles/hew03>), accessed June 8, 2016. Uploaded on June 15, 2010. Published by the Texas State Historical Association.

Moore, David W., Martha Freeman, and Maryellen Russo

- 2013 *Agricultural Theme Study for Central Texas*. Historical Studies Report No. 2013-01. Produced for the Texas Department of Transportation Environmental Affairs Division Historical Studies Branch. Available at the Texas Department of Transportation website <http://www.txdot.gov/inside-txdot/division/environmental/compliance-toolkits/historic-resources.html>

Texas Department of Transportation

- 1990 General Highway Map, Parker County, Available at University of Texas Perry-Castañeda Library Map Collection website <http://www.lib.utexas.edu/maps/txdot/browse.html#h>

Texas State Highway Department

- 1936, 1958 General Highway Map, Parker County, Available at Texas State Library and Archives Commission website <https://www.tsl.texas.gov/apps/arc/maps/>

The Daily Herald

1920 "Center Point News," Vol. 21, No. 28, Ed. 1 Thursday, October 14, 1920, newspaper, October 14, 1920; Weatherford, Texas.
(texashistory.unt.edu/ark:/67531/metapth585949/m1/8/?q=%22center+point%22 : accessed June 16, 2016), University of North Texas Libraries, The Portal to Texas History, texashistory.unt.edu.

"Center Point News," Vol. 21, No. 249, Ed. 1 Wednesday, October 20, 1920, newspaper, October 20, 1920; Weatherford, Texas.
(texashistory.unt.edu/ark:/67531/metapth659948/m1/3/?q=%22center+point%22 : accessed June 15, 2016), University of North Texas Libraries, The Portal to Texas History, texashistory.unt.edu.

U.S. Geological Survey

1959, 1979 Weatherford North and Weatherford South quadrangles,
Available at University of Texas Perry-Castañeda Library Map Collection
website <http://www.lib.utexas.edu/maps/topo/texas/>

Vandergriff, Jon R.

2010 *The Story of Parker County, Texas: 1852 to 1956*. Virginia Beach, VA: Walsworth Publishing Company.

Appendix A
Tabular Inventory of Surveyed Properties

| Resource ID | Parcel ID | Name | Address | Longitude | Latitude | Year Built | Source | Style | Form | Type | Historic Function Subcategory | Current Function Subcategory | Individually NRHP Eligible? | Effect call | Contributing to District? | Integrity | | | | | | |
|-------------|-----------|---------------------------|--|------------|-----------|------------|---------------------------|-------|---------------------|-----------|-------------------------------|-------------------------------|-----------------------------|-------------------|---------------------------|-----------|--------|---------|-----------|-------------|---------|-------------|
| | | | | | | | | | | | | | | | | Location | Design | Setting | Materials | Workmanship | Feeling | Association |
| 1 | 36795 | Bankhead Church of Christ | 2610 E Bankhead Dr | -97.742463 | 32.741826 | ca. 1970 | Field survey | None | Rectangular | Building | Religion/ Religious Facility | Religion/ Religious Facility | No | N/A | N/A | X | X | X | X | X | X | X |
| 2A | 39922 | None | 3009 E Bankhead Dr | -97.741158 | 32.743154 | ca. 1970 | Field survey | None | Ranch | Building | Domestic/ Single Dwelling | Domestic/ Single Dwelling | No | N/A | N/A | X | X | X | X | X | X | X |
| 2B | 39922 | None | 3009 E Bankhead Dr | -97.741066 | 32.743339 | ca. 1970 | Field survey | None | Rectangular | Building | Domestic/ Secondary Structure | Domestic/ Secondary Structure | No | N/A | N/A | X | X | X | X | X | X | X |
| 3A | N/A | Bankhead Highway | at IH 20 | -97.743693 | 32.742559 | 1921 | Research | None | Linear | Structure | Transportation/ Road-related | Transportation/ Road-related | Yes | No Adverse Effect | No | X | | X | | | X | X |
| 3B | N/A | NBI 021840031407045 | E Bankhead Dr over IH 20 | -97.745855 | 32.743292 | 1968 | National Bridge Inventory | None | Bridge | Structure | Transportation/ Road-related | Transportation/ Road-related | No | N/A | No | X | X | X | X | X | X | X |
| 4A | Unknown | None | IH 20 Frontage Rd WB, East of Atwood Court | -97.740238 | 32.746271 | ca. 1970 | Field survey | None | Ranch | Building | Domestic/ Single Dwelling | Domestic/ Single Dwelling | No | N/A | N/A | X | X | X | X | X | X | X |
| 4B | Unknown | None | IH 20 Frontage Rd WB, East of Atwood Court | -97.740391 | 32.746362 | ca. 1970 | Field survey | None | Rectangular | Building | Domestic/ Secondary Structure | Domestic/ Secondary Structure | No | N/A | N/A | X | X | X | X | X | X | X |
| 5 | Unknown | None | IH 20 Frontage Rd WB, East of Atwood Court | -97.739791 | 32.746221 | ca. 1965 | Field survey | None | Bungalow | Building | Domestic/ Single Dwelling | Domestic/ Single Dwelling | No | N/A | N/A | X | | X | | | X | X |
| 6 | 98313 | None | 304 Center Point Rd | -97.729896 | 32.750338 | ca. 1955 | Field survey | None | Minimal Traditional | Building | Domestic/ Single Dwelling | Vacant/ Not in Use | No | N/A | N/A | X | | X | | | X | X |
| 7A | 50213 | None | 312 Center Point Rd | -97.729687 | 32.749705 | ca. 1955 | Field survey | None | Bungalow | Building | Domestic/ Single Dwelling | Vacant/ Not in Use | No | N/A | N/A | X | X | X | | | X | X |
| 7B | 50213 | None | 312 Center Point Rd | -97.729822 | 32.749524 | ca. 1990 | Field survey | None | Rectangular | Building | Domestic/ Secondary Structure | Domestic/ Secondary Structure | No | N/A | N/A | X | | | | | | |
| 8A | 101135 | None | 320 Center Point Rd | -97.729228 | 32.748803 | ca. 1960 | Field survey | None | Bungalow | Building | Domestic/ Single Dwelling | Vacant/ Not in Use | No | N/A | N/A | X | X | X | X | X | X | X |
| 8B | 101135 | None | 320 Center Point Rd | -97.729283 | 32.74866 | ca. 1995 | Aerial photos | None | Irregular | Building | Rec & Culture/Swimming Pool | Vacant/ Not in Use | No | N/A | N/A | X | X | X | X | X | X | X |
| 8C | 101135 | None | 320 Center Point Rd | -97.729462 | 32.749097 | ca. 1975 | Field survey | None | Rectangular | Building | Domestic/ Single Dwelling | Vacant/ Not in Use | No | N/A | N/A | X | X | X | X | X | X | X |
| 8D | 101135 | None | 320 Center Point Rd | -97.729593 | 32.749065 | ca. 1960 | Field survey | None | Rectangular | Building | Domestic/ Secondary Structure | Vacant/ Not in Use | No | N/A | N/A | X | X | X | X | X | X | X |
| 8E | 101135 | None | 320 Center Point Rd | -97.729741 | 32.748967 | ca. 1965 | Field survey | None | Rectangular | Building | Domestic/ Secondary Structure | Vacant/ Not in Use | No | N/A | N/A | X | X | X | X | X | X | X |
| 8F | 101135 | None | 320 Center Point Rd | -97.729501 | 32.748797 | ca. 1980 | Field survey | None | Rectangular | Building | Domestic/ Single Dwelling | Vacant/ Not in Use | No | N/A | N/A | X | X | X | X | X | X | X |
| 9A | 39915 | None | 3303 E Bankhead Dr | -97.729987 | 32.741116 | ca. 1925 | Field survey | None | Bungalow | Building | Domestic/ Single Dwelling | Domestic/ Single Dwelling | No | N/A | N/A | X | X | X | | | X | X |
| 9B | 39915 | None | 3303 E Bankhead Dr | -97.729912 | 32.741205 | ca. 1925 | Field survey | None | Irregular | Structure | Domestic/ Secondary Structure | Domestic/ Secondary Structure | No | N/A | N/A | X | X | X | X | X | X | X |
| 9C | 39915 | None | 3303 E Bankhead Dr | -97.729663 | 32.741309 | ca. 1960 | Field survey | None | Rectangular | Building | Domestic/ Secondary Structure | Domestic/ Secondary Structure | No | N/A | N/A | X | | X | | X | X | X |
| 9D | 39915 | None | 3303 E Bankhead Dr | -97.729423 | 32.741313 | ca. 1925 | Field survey | None | Rectangular | Building | Agriculture/ Outbuilding | Agriculture/ Outbuilding | No | N/A | N/A | X | X | X | X | X | X | X |
| 9E | 39915 | None | 3303 E Bankhead Dr | -97.729697 | 32.741517 | ca. 1925 | Field survey | None | Rectangular | Building | Agriculture/ Outbuilding | Agriculture/ Outbuilding | No | N/A | N/A | X | X | | X | X | X | X |

| Resource ID | Parcel ID | Name | Address | Longitude | Latitude | Year Built | Source | Style | Form | Type | Historic Function Subcategory | Current Function Subcategory | Individually NRHP Eligible? | Effect call | Contributing to District? | Integrity | | | | | | |
|-------------|-----------|----------------------|----------------------------|------------|-----------|------------|----------------------------|-------|---------------------|-----------|-------------------------------|-------------------------------|-----------------------------|-------------|---------------------------|-----------|--------|---------|-----------|-------------|---------|-------------|
| | | | | | | | | | | | | | | | | Location | Design | Setting | Materials | Workmanship | Feeling | Association |
| 9F | 39915 | None | 3303 E Bankhead Dr | -97.729688 | 32.741815 | ca. 2000 | Field survey/aerial photos | None | Rectangular | Building | Agriculture/ Outbuilding | Agriculture/ Outbuilding | No | N/A | N/A | X | X | X | X | X | X | X |
| 9G | 39915 | None | 3303 E Bankhead Dr | -97.730353 | 32.741704 | ca. 1950 | Field survey | None | Rectangular | Building | Agriculture/ Outbuilding | Agriculture/ Outbuilding | No | N/A | N/A | X | X | X | X | X | X | X |
| 9H | 39915 | None | 3303 E Bankhead Dr | -97.730159 | 32.741424 | ca. 2000 | Field survey/aerial photos | None | Rectangular | Building | Agriculture/ Outbuilding | Agriculture/ Outbuilding | No | N/A | N/A | X | X | X | | | X | X |
| 10A | 50209 | None | 301 Center Point Rd | -97.726985 | 32.745974 | ca. 1970 | Field survey | None | Ranch | Building | Domestic/ Single Dwelling | Domestic/ Single Dwelling | No | N/A | N/A | X | | X | | | X | X |
| 10B | 50209 | None | 301 Center Point Rd | -97.726904 | 32.746119 | ca. 1990 | Field survey | None | Rectangular | Building | Domestic/ Secondary Structure | Domestic/ Secondary Structure | No | N/A | N/A | X | X | X | X | X | X | X |
| 11A | 50196 | None | 505 Center Point Rd | -97.727432 | 32.746757 | 1966 | Parker CAD | None | Ranch | Building | Domestic/ Single Dwelling | Domestic/ Single Dwelling | No | N/A | N/A | X | | X | | | X | X |
| 11B | 50196 | None | 505 Center Point RD | -97.727442 | 32.746898 | ca. 1980 | Field survey | None | Rectangular | Building | Domestic/ Secondary Structure | Domestic/ Secondary Structure | No | N/A | N/A | X | X | X | X | X | X | X |
| 12A | 50196 | None | 501 Center Point RD | -97.727755 | 32.747621 | 1966 | Parker CAD | None | Bungalow | Building | Domestic/ Single Dwelling | Domestic/ Single Dwelling | No | N/A | N/A | X | | X | | | X | X |
| 12B | 50196 | None | 505 Center Point Rd | -97.727581 | 32.747481 | ca. 1970 | Field survey | None | Rectangular | Building | Domestic/ Secondary Structure | Domestic/ Secondary Structure | No | N/A | N/A | X | X | X | X | X | X | X |
| 12C | 50196 | None | 505 Center Point Rd | -97.727677 | 32.747844 | ca. 1970 | Field survey | None | Rectangular | Building | Domestic/ Secondary Structure | Domestic/ Secondary Structure | No | N/A | N/A | X | X | X | X | | X | X |
| 13 | N/A | NBI 02184003140 7042 | Center Point Rd over IH 20 | -97.728613 | 32.748246 | 1968 | National Bridge Inventory | None | Bridge | Structure | Transportation/ Road-related | Transportation/ Road-related | No | N/A | N/A | X | X | X | X | X | X | X |
| 14A | Unknown | None | 315 Center Point Rd | -97.728958 | 32.74951 | ca. 1965 | Field survey | None | Minimal Traditional | Building | Domestic/ Single Dwelling | Domestic/ Single Dwelling | No | N/A | N/A | X | | X | | | X | X |
| 14B | Unknown | None | 315 Center Point Rd | -97.728621 | 32.749346 | ca. 1965 | Field survey | None | Rectangular | Building | Domestic/ Secondary Structure | Domestic/ Secondary Structure | No | N/A | N/A | X | X | X | X | X | X | X |
| 14C | Unknown | None | 315 Center Point Rd | -97.728525 | 32.749141 | ca. 1980 | Field survey | None | Rectangular | Building | Domestic/ Secondary Structure | Domestic/ Secondary Structure | No | N/A | N/A | X | X | X | X | X | X | X |
| 14D | Unknown | None | 315 Center Point Rd | -97.728459 | 32.749169 | ca. 1965 | Field survey | None | Rectangular | Building | Domestic/ Secondary Structure | Domestic/ Secondary Structure | No | N/A | N/A | X | X | X | X | X | X | X |
| 15A | 50210 | None | 311 Center Point Rd | -97.729098 | 32.74979 | ca. 1960 | Field survey | None | Minimal Traditional | Building | Domestic/ Single Dwelling | Domestic/ Single Dwelling | No | N/A | N/A | X | | X | X | | | X |
| 15B | 50210 | None | 311 Center Point Rd | -97.729151 | 32.749885 | ca. 1960 | Field survey | None | Rectangular | Building | Domestic/ Secondary Structure | Domestic/ Secondary Structure | No | N/A | N/A | X | | X | X | | | X |
| 16A | 50211 | None | 309 Center Point Rd | -97.729213 | 32.750113 | 1949 | Owner | None | Bungalow | Building | Domestic/ Single Dwelling | Domestic/ Single Dwelling | No | N/A | N/A | X | | X | X | | | X |
| 16B | 50211 | None | 309 Center Point Rd | -97.728711 | 32.750104 | ca. 1990 | Field survey | None | Rectangular | Building | Domestic/ Secondary Structure | Domestic/ Secondary Structure | No | N/A | N/A | X | | X | X | | | X |
| 17A | 50209 | None | 301 Center Point Rd | -97.729445 | 32.750772 | ca. 1960 | Field survey | None | Ranch | Building | Domestic/ Single Dwelling | Domestic/ Single Dwelling | No | N/A | N/A | X | | X | X | | | X |
| 17B | 50209 | None | 301 Center Point Rd | -97.72948 | 32.750481 | ca. 1960 | Field survey | None | Rectangular | Building | Domestic/ Secondary Structure | Domestic/ Secondary Structure | No | N/A | N/A | X | X | X | X | X | X | X |
| 17C | 50209 | None | 301 Center Point Rd | -97.729129 | 32.750475 | ca. 1960 | Field survey | None | Rectangular | Building | Domestic/ Secondary Structure | Domestic/ Secondary Structure | No | N/A | N/A | X | X | X | X | X | X | X |

| Resource ID | Parcel ID | Name | Address | Longitude | Latitude | Year Built | Source | Style | Form | Type | Historic Function Subcategory | Current Function Subcategory | Individually NRHP Eligible? | Effect call | Contributing to District? | Integrity | | | | | | |
|-------------|-----------|------|---------------------|------------|-----------|------------|--------------|-------|---------------------|----------|-------------------------------|-------------------------------|-----------------------------|-------------|---------------------------|-----------|--------|---------|-----------|-------------|---------|-------------|
| | | | | | | | | | | | | | | | | Location | Design | Setting | Materials | Workmanship | Feeling | Association |
| 17D | 50209 | None | 301 Center Point Rd | -97.729377 | 32.750587 | ca. 1960 | Field survey | None | Rectangular | Building | Domestic/ Secondary Structure | Domestic/ Secondary Structure | No | N/A | N/A | X | X | X | X | X | X | X |
| 18A | 44000 | None | 229 Center Point Rd | -97.729622 | 32.75126 | ca. 1960 | Field survey | None | Minimal Traditional | Building | Domestic/ Single Dwelling | Domestic/ Single Dwelling | No | N/A | N/A | X | X | X | X | X | X | X |
| 18B | 44000 | None | 229 Center Point Rd | -97.729273 | 32.751377 | ca. 1960 | Field survey | None | Rectangular | Building | Domestic/ Secondary Structure | Domestic/ Secondary Structure | No | N/A | N/A | X | X | X | X | X | X | X |
| 18C | 44000 | None | 229 Center Point Rd | -97.729449 | 32.751162 | ca. 1960 | Field survey | None | Rectangular | Building | Domestic/ Secondary Structure | Domestic/ Secondary Structure | No | N/A | N/A | X | X | X | X | X | X | X |

Appendix B
Survey Forms for All Surveyed Properties

Resource ID: 1 **Name:** Bankhead Church of Christ **Year Built:** ca. 1970 **Source:** Field survey
Parcel ID: R000036795
Address: 2610 E BANKHEAD DR Weatherford Parker County Texas
Lat: 32.741826 **Long:** -97.742463
Type: Building **Style:** None **Form:** Rectangular
Historic Function/ Subcategory: Religion/ Religious Facility **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Religion/ Religious Facility **Contributing to District?** N/A



Primary (east) elevation; view facing west.

Photo 1 date taken: 6/10/16

Description: Resource 1 is a single-story, front-gabled church with small entry porch centered on the primary (east) elevation. The building is sheathed in brick, with vertical wood siding accents in the gable ends. There are two, narrow, fixed sash windows on the side elevations.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This is a modest example of a mid-20th century religious facility with no distinctive characteristics. During the historic context development, no associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction. Also, it does not represent the work of a master or possess high artistic value. It does not meet the requirements of Criterion Consideration A. As such, it is recommended not eligible for inclusion in the NRHP.

Resource ID: 1

Address: 2610 E BANKHEAD DR

Parcel ID: R000036795

Oblique of east and south elevations; view facing northwest.

Photo 2 date taken:
6/10/16



Resource ID: 2A **Name:** None **Year Built:** ca. 1970 **Source:** Field survey
Parcel ID: R000039922
Address: 3009 E BANKHEAD DR Weatherford Parker County Texas
Lat: 32.743154 **Long:** -97.741158
Type: Building **Style:** None **Form:** Ranch
Historic Function/ Subcategory: Domestic/ Single Dwelling **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Domestic/ Single Dwelling **Contributing to District?** N/A



Primary (west) elevation; view facing southeast.

Photo 1 date taken: 6/10/16

Description: This resource is a single-story, brick Ranch house with complex roof form and aluminum sash windows. Due to substantial set back from the public right-of-way and heavy vegetation surrounding the house, it was challenging to get photos that clearly show details about the house, despite using a zoom lense. The property appears to be abandoned.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This resource is a modest example of a Ranch house. No associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction, when compared to other nearby houses. Also, it does not represent the work of a master or possess high artistic value. As a result, it is recommended not eligible for inclusion in the NRHP.

Resource ID: 2A

Address: 3009 E BANKHEAD DR

Parcel ID: R000039922

Overview of house; view facing southeast. View of property very limited from public right-of-way due to substantial set back from road and heavy vegetation.

Photo 2 date taken:
6/10/16



Primary (west) elevation; view facing east/northeast.

Photo 3 date taken:
6/10/16



Resource ID: 2B **Name:** None **Year Built:** ca. 1970 **Source:** Field survey
Parcel ID: R000039922
Address: 3009 E BANKHEAD DR Weatherford Parker County Texas
Lat: 32.743339 **Long:** -97.741066
Type: Building **Style:** None **Form:** Rectangular
Historic Function/ Subcategory: Domestic/ Secondary Structure **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Domestic/ Secondary Structure **Contributing to District?** N/A



Oblique of west and south elevations; view facing northeast.

Photo 1 date taken: 6/10/16

Description: This resource is a small, rectangular brick building with hipped roof. The west elevation has an aluminum sash window. Due to the set back from the road and surrounding, heavy vegetation, it was difficult to determine the building's function. There is an open frame carport with corrugated metal roof located southeast of Resource 2B.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This is a utilitarian building with no distinctive characteristics. During the historic context development, no associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction. Also, it does not represent the work of a master or possess high artistic value. As such, it is recommended not eligible for inclusion in the NRHP.

THIS PAGE LEFT BLANK INTENTIONALLY

| | | | |
|--|-------------------------------|-------------------------------------|----------------------------------|
| Resource ID: 3A | Name: Bankhead Highway | Year Built: 1921 | Source: Research |
| Parcel ID: N/A | Address: AT IH 20 | Weatherford Parker County | Texas |
| | Lat: 32.742559 | Long: -97.743693 | |
| | Type: Structure | Style: None | Form: Linear |
| Historic Function/ Subcategory: | Transportation/ Road-related | Indiv. NRHP Eligible? Yes | Effect: No Adverse Effect |
| Current Function/Subcategory: | Transportation/ Road-related | Contributing to District? No | |



E. Bankhead Drive at IH 20 interchange; view facing northwest.

Photo 1 date taken: 6/10/16

Description: The interchange of E. Bankhead Drive and IH 20 was constructed in 1968 with the development of IH 20. It has been modified over time with minor widening of the approaches to the bridge to improve turning movements for the traffic, including large trucks, accessing the Love's gas station/truck stop at the southeast corner of the interchange.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This segment of the historic Bankhead Highway was determined eligible for NRHP listing in the Bankhead Highway survey conducted by the Texas Historical Commission and TxDOT. However, the bridge has been determined not eligible under the interstate highway exemption. Therefore, the interchange is a non-contributing feature of the NRHP-eligible Bankhead Highway segment.

Resource ID: 3A

Address: AT IH 20

Parcel ID: N/A

E. Bankhead Drive south of IH 20; view facing southeast.



Photo 2 date taken:
6/10/16

E. Bankhead Drive at IH 20 interchange; view facing southwest



Photo 3 date taken:
6/10/16

Resource ID: 3B **Name:** NBI 021840031407045 **Year Built:** 1968 **Source:** National Bridge Inventory
Parcel ID: N/A **Address:** E BANKHEAD DR OVER IH 20 Weatherford Parker County Texas
Lat: 32.743292 **Long:** -97.745855
Type: Structure **Style:** None **Form:** Bridge
Historic Function/ Subcategory: Transportation/ Road-related **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Transportation/ Road-related **Contributing to District?** No



East elevation and overview of relationship between E. Bankhead Drive and IH 20; view facing southwest.

Photo 1 date taken: 6/10/16

Description: The 1968 bridge that carries E. Bankhead Drive over IH 20 (NBI 021840031407045) is a steel continuous I-beam bridge with three spans. While there have been some modifications to the approaches to improve turning movements for large trucks, there do not appear to have been any alterations to the bridge, and it retains the original railing.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: In accordance with Section 6007 of the Safe, Accountable, Flexible, Efficient Transportation Equity Act: A Legacy for Users (SAFETEA-LU), this bridge within the right-of-way of the interstate system is not eligible for the National Register since it was not included on FHWA's Final List of Nationally and Exceptionally Significant Features of the Federal Interstate Highway System. This resource is also a non-contributing component of the NRHP-eligible Bankhead Highway.

Resource ID: 3B

Address: E BANKHEAD DR OVER IH 20

Parcel ID: N/A

Northwest limit of Resource 3B;
view facing southeast toward
interchange.


Photo 2 date taken:
6/10/16



Southeast limit of Resource 3B;
view facing southeast.

Photo 3 date taken:
6/10/16



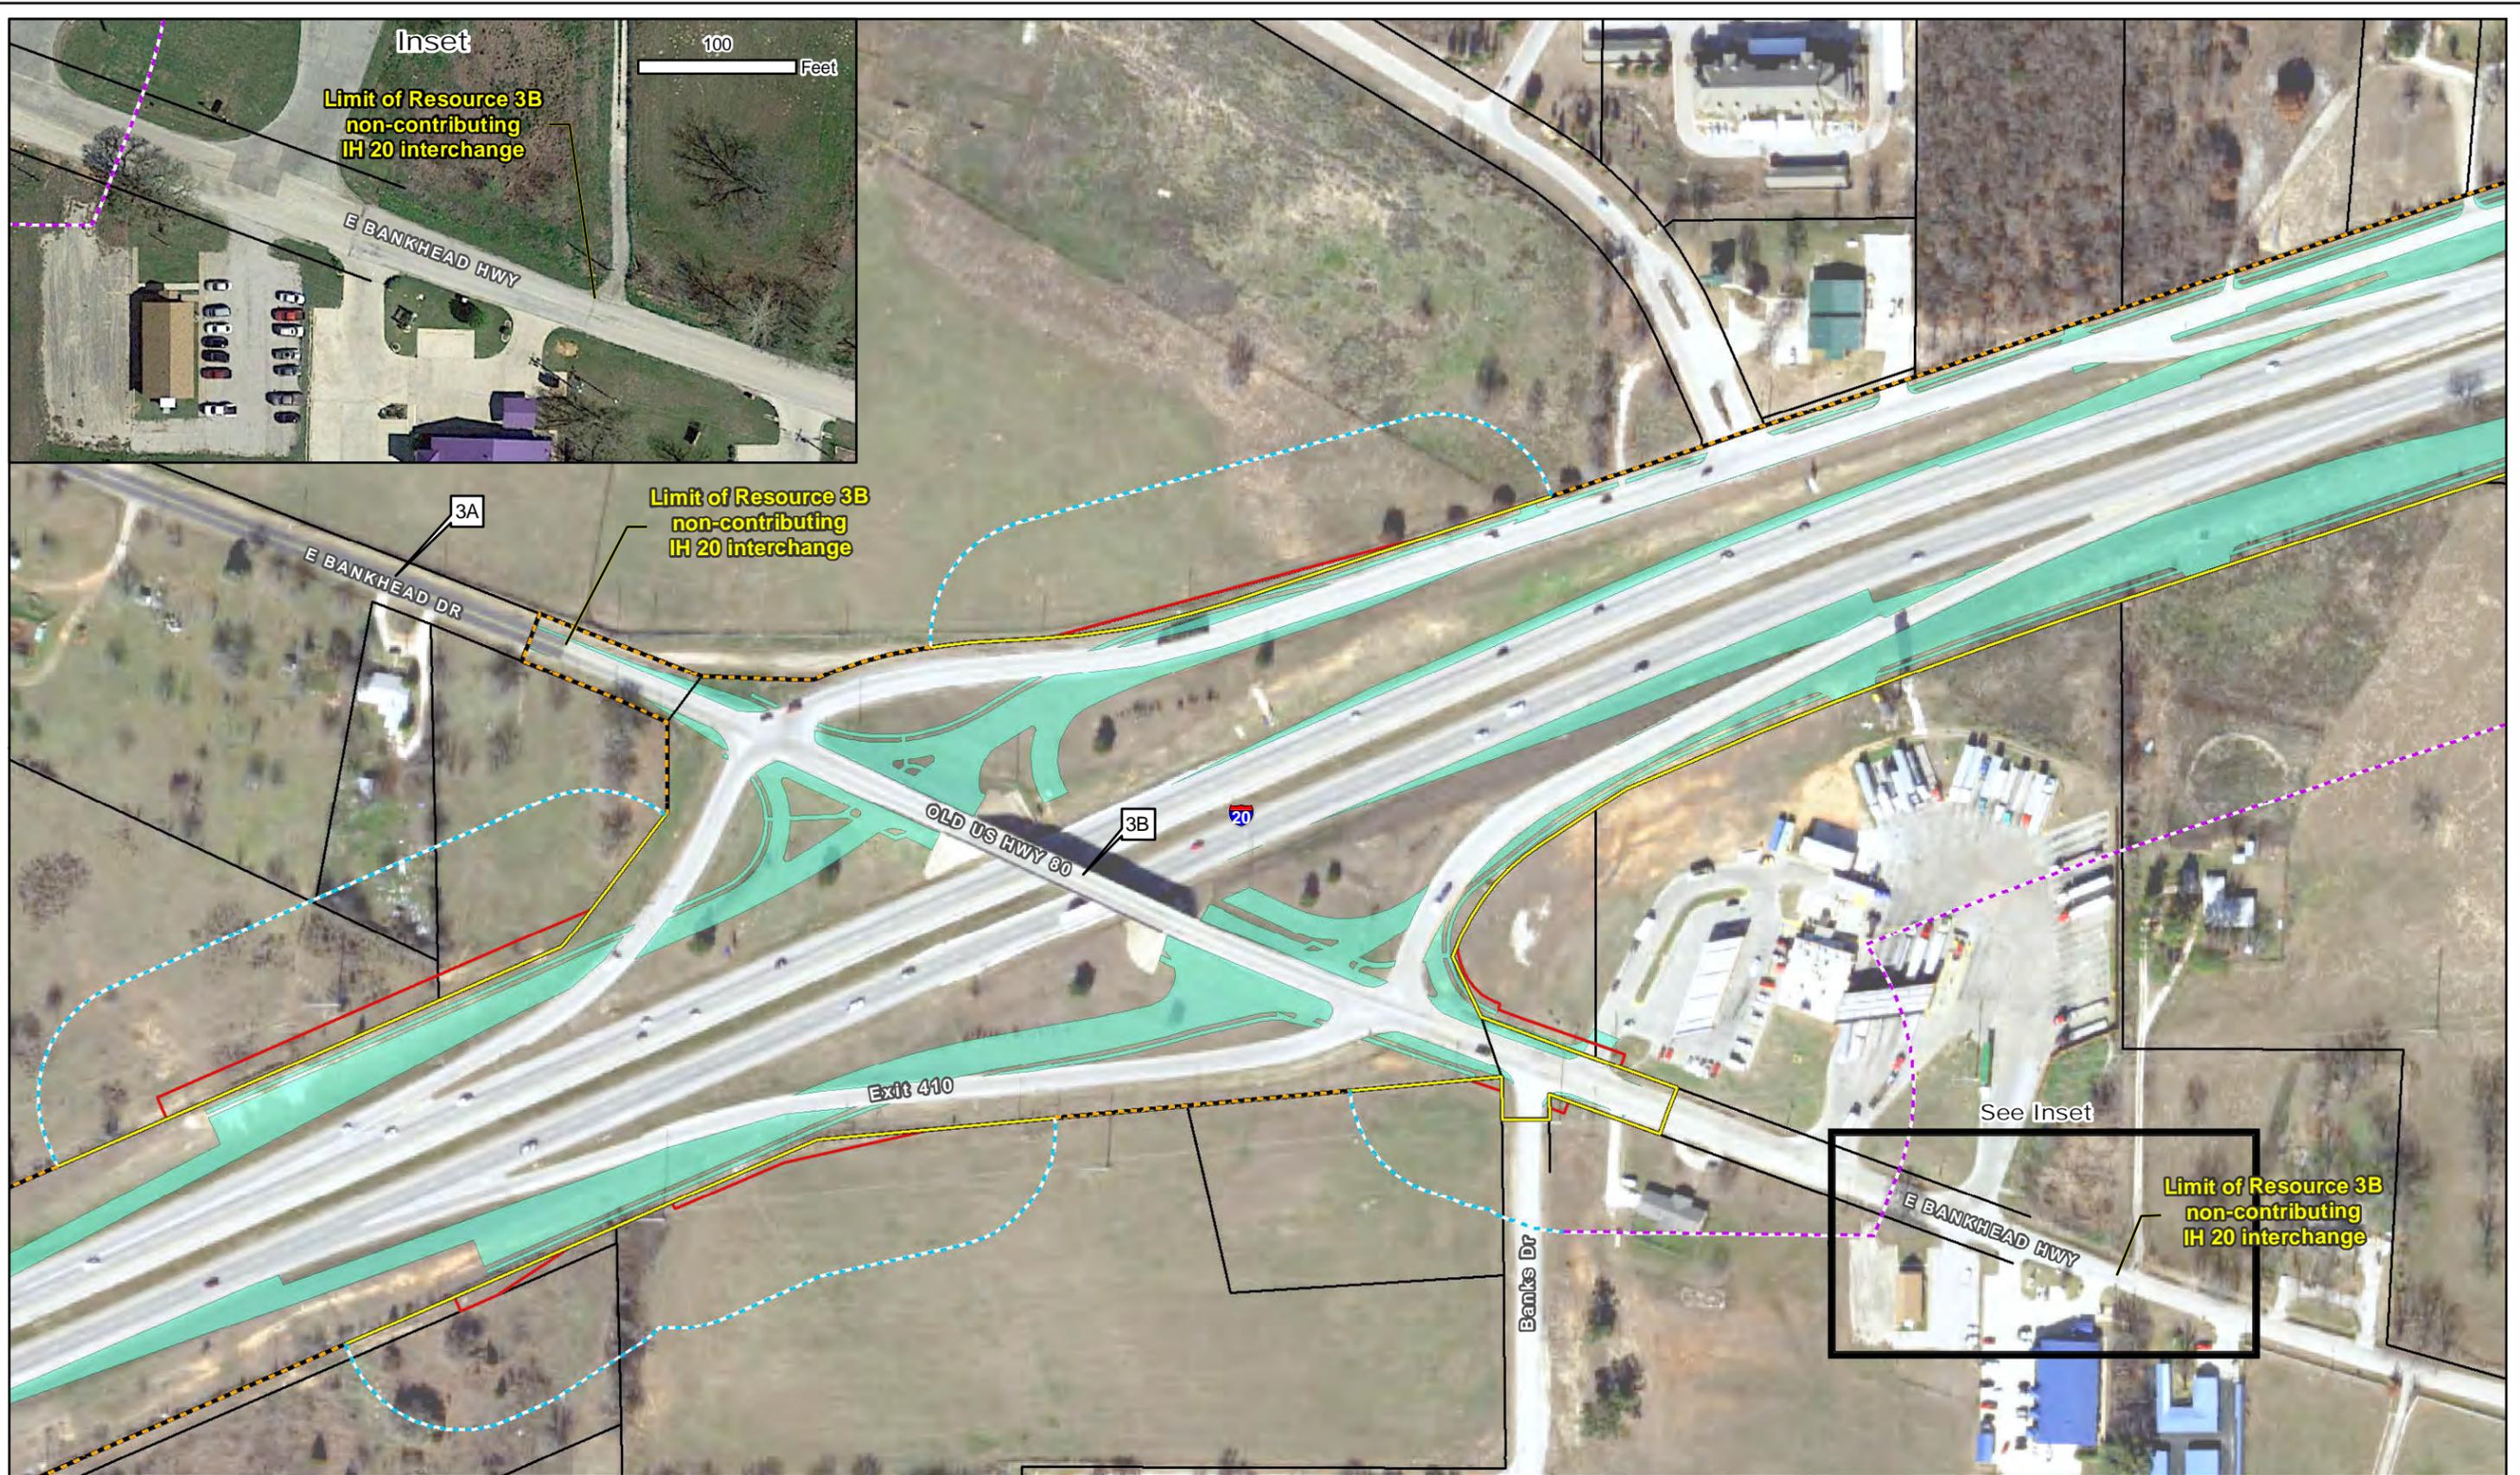

Historic Resources
 Location Map
Resource 3 (Bankhead Road Interchange) **IH 20 at Center Point Road**

- Existing Right-of-Way
- Proposed Right-of-Way
- Proposed New Pavement
- Available Property Lines
- Historic-Age Resource
- APE
- 300-foot
- 150-foot
- Existing Right-of-Way



| | | |
|---|--|--|
| <p>Data Sources: CMEC (2016), Freese and Nichols (2016) Aerial Source: TNRRIS (2015) Inset Aerial Source: Google (2015)</p> | | <p>0 200 Feet 0 60 Meters</p> <p>1 in = 200 feet Scale: 1:2,400 Date: 6/27/2016</p> |
| Prepared for: TXDOT CSJ: 0314-07-051, 0314-07-052, 0314-07-046 | | |

Resource ID: 4A **Name:** None **Year Built:** ca. 1970 **Source:** Field survey
Parcel ID: Unknown
Address: IH 20 FRONTAGE RD WB, EAST OF ATWOOD COURT Weatherford Parker County Texas
Lat: 32.746271 **Long:** -97.740238
Type: Building **Style:** None **Form:** Ranch
Historic Function/ Subcategory: Domestic/ Single Dwelling **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Domestic/ Single Dwelling **Contributing to District?** No



Primary (south) elevation; view facing north/northwest.

Photo 1 date taken: 6/10/16

Description: This resource is a single-story massed Ranch house with complex roof form. It is clad in brick and has a partial width integrated porch. There is an attached carport, also clad in brick, on the west side.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This resource is a modest example of a Ranch house. No associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction, when compared to other nearby houses. Also, it does not represent the work of a master or possess high artistic value. As a result, it is recommended not eligible for inclusion in the NRHP.

Resource ID: 4A

Address: IH 20 FRONTAGE RD WB, EAST OF ATWOOD COURT

Parcel ID: Unknown

Oblique of south and west elevations; view facing northeast.

Photo 2 date taken:
6/10/16



Resource ID: 4B **Name:** None **Year Built:** ca. 1970 **Source:** Field survey
Parcel ID: Unknown
Address: IH 20 FRONTAGE RD WB, EAST OF ATWOOD COURT Weatherford Parker County Texas
Lat: 32.746362 **Long:** -97.740391
Type: Building **Style:** None **Form:** Rectangular
Historic Function/ Subcategory: Domestic/ Secondary Structure **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Domestic/ Secondary Structure **Contributing to District?** N/A



Primary (south) elevation; view facing north/northeast.

Photo 1 date taken: 6/10/16

Description: This resource is a modest side-gable building clad in stucco. Due to significant set back from the public right-of-way and the heavy vegetation coverage, the exact function and use of the building was not readily apparent.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This is a utilitarian building with no distinctive characteristics. During the historic context development, no associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction. Also, it does not represent the work of a master or possess high artistic value. As such, it is recommended not eligible for inclusion in the NRHP.

Resource ID: 4B

Address: IH 20 FRONTAGE RD WB, EAST OF ATWOOD COURT

Parcel ID: Unknown

Overview of Resources 6A
(right) and 6B (left); view facing
northeast.

Photo 2 date taken:
6/10/16



Resource ID: 5 **Name:** None **Year Built:** ca. 1965 **Source:** Field survey
Parcel ID: Unknown
Address: IH 20 FRONTAGE RD WB, EAST OF ATWOOD COURT Weatherford Parker County Texas
Lat: 32.746221 **Long:** -97.739791
Type: Building **Style:** None **Form:** Bungalow
Historic Function/ Subcategory: Domestic/ Single Dwelling **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Domestic/ Single Dwelling **Contributing to District?** N/A



Primary (south) elevations; view facing north.

Photo 1 date taken: 6/10/16

Description: This is a one-story, front-gable house with a partial width attached porch and aluminum sash windows. The engineered stone siding is replacement material, and it appears at least one window has been replaced.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This resource is a modest example of the bungalow form. No associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction, when compared to other nearby houses. Also, it does not represent the work of a master or possess high artistic value. Furthermore, the modifications have impacted its integrity. As a result, it is recommended not eligible for inclusion in the NRHP.

Resource ID: 5

Address: IH 20 FRONTAGE RD WB, EAST OF ATWOOD COURT

Parcel ID: Unknown

Oblique of south and west elevations; view facing northeast.

Photo 2 date taken:
6/10/16



Resource ID: 6 **Name:** None **Year Built:** ca. 1955 **Source:** Field survey
Parcel ID: R000098313
Address: 304 CENTER POINT RD Weatherford Parker County Texas
Lat: 32.750338 **Long:** -97.729896
Type: Building **Style:** None **Form:** Minimal Traditional
Historic Function/ Subcategory: Domestic/ Single Dwelling **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Vacant/ Not in Use **Contributing to District?** N/A



Primary (east) elevation; view facing west/northwest.

Photo 1 date taken: 6/10/16

Description: This resource is a single-story, Minimal Traditional house with complex roof form and aluminum sash windows. The house is clad in replacement vinyl siding, and a large, non-historic-age addition extends the house to the north. The house is currently vacant.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This resource is a modest example of the Minimal Traditional form. No associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction, when compared to other nearby houses. Also, it does not represent the work of a master or possess high artistic value. Furthermore, the modifications have impacted its integrity. As a result, it is recommended not eligible for inclusion in the NRHP.

Resource ID: 6

Address: 304 CENTER POINT RD

Parcel ID: R000098313

Oblique of east and north elevations; view facing southwest.

Photo 2 date taken:
6/10/16



Resource ID: 7A **Name:** None **Year Built:** ca. 1955 **Source:** Field survey
Parcel ID: R000050213 **Address:** 312 CENTER POINT RD Weatherford Parker County Texas
Lat: 32.749705 **Long:** -97.729687
Type: Building **Style:** None **Form:** Bungalow
Historic Function/ Subcategory: Domestic/ Single Dwelling **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Vacant/ Not in Use **Contributing to District?** N/A



Primary (east) elevation; view facing west.

Photo 1 date taken: 6/10/16

Description: This resource is a one-story, front-gable house in the bungalow form. The house has a partial width, shed roof porch and aluminum sash windows. It is clad in replacement vinyl siding. The house is currently vacant.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This resource is a modest example of the bungalow form. No associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction, when compared to other nearby houses. Also, it does not represent the work of a master or possess high artistic value. As a result, it is recommended not eligible for inclusion in the NRHP.

Resource ID: 7A

Address: 312 CENTER POINT RD

Parcel ID: R000050213

Oblique of east and south elevations; view facing northwest.

Photo 2 date taken:
6/10/16



Resource ID: 7B **Name:** None **Year Built:** ca. 1990 **Source:** Field survey
Parcel ID: 000050213
Address: 312 CENTER POINT RD Weatherford Parker County Texas
Lat: 32.749524 **Long:** -97.729822
Type: Building **Style:** None **Form:** Rectangular
Historic Function/ Subcategory: Domestic/ Secondary Structure **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Domestic/ Secondary Structure **Contributing to District?** N/A



Oblique of east and north elevation; view facing west.

Photo 1 date taken: 6/10/16

Description: This resource is a small, open-bay garage clad in vertical wood siding. There is a pedestrian door in the east elevation. It appears it may have had an addition on the east elevation that is no longer extant.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This resource is less than 50 years old and was not found to possess exceptional significance under Criterion Consideration G. As a result, it is recommended not eligible for the NRHP under Criterion A, B, or C.

Resource ID: 7B


Address: 312 CENTER POINT RD

Parcel ID: 000050213

East elevation; view facing west.

Photo 2 date taken:
6/10/16



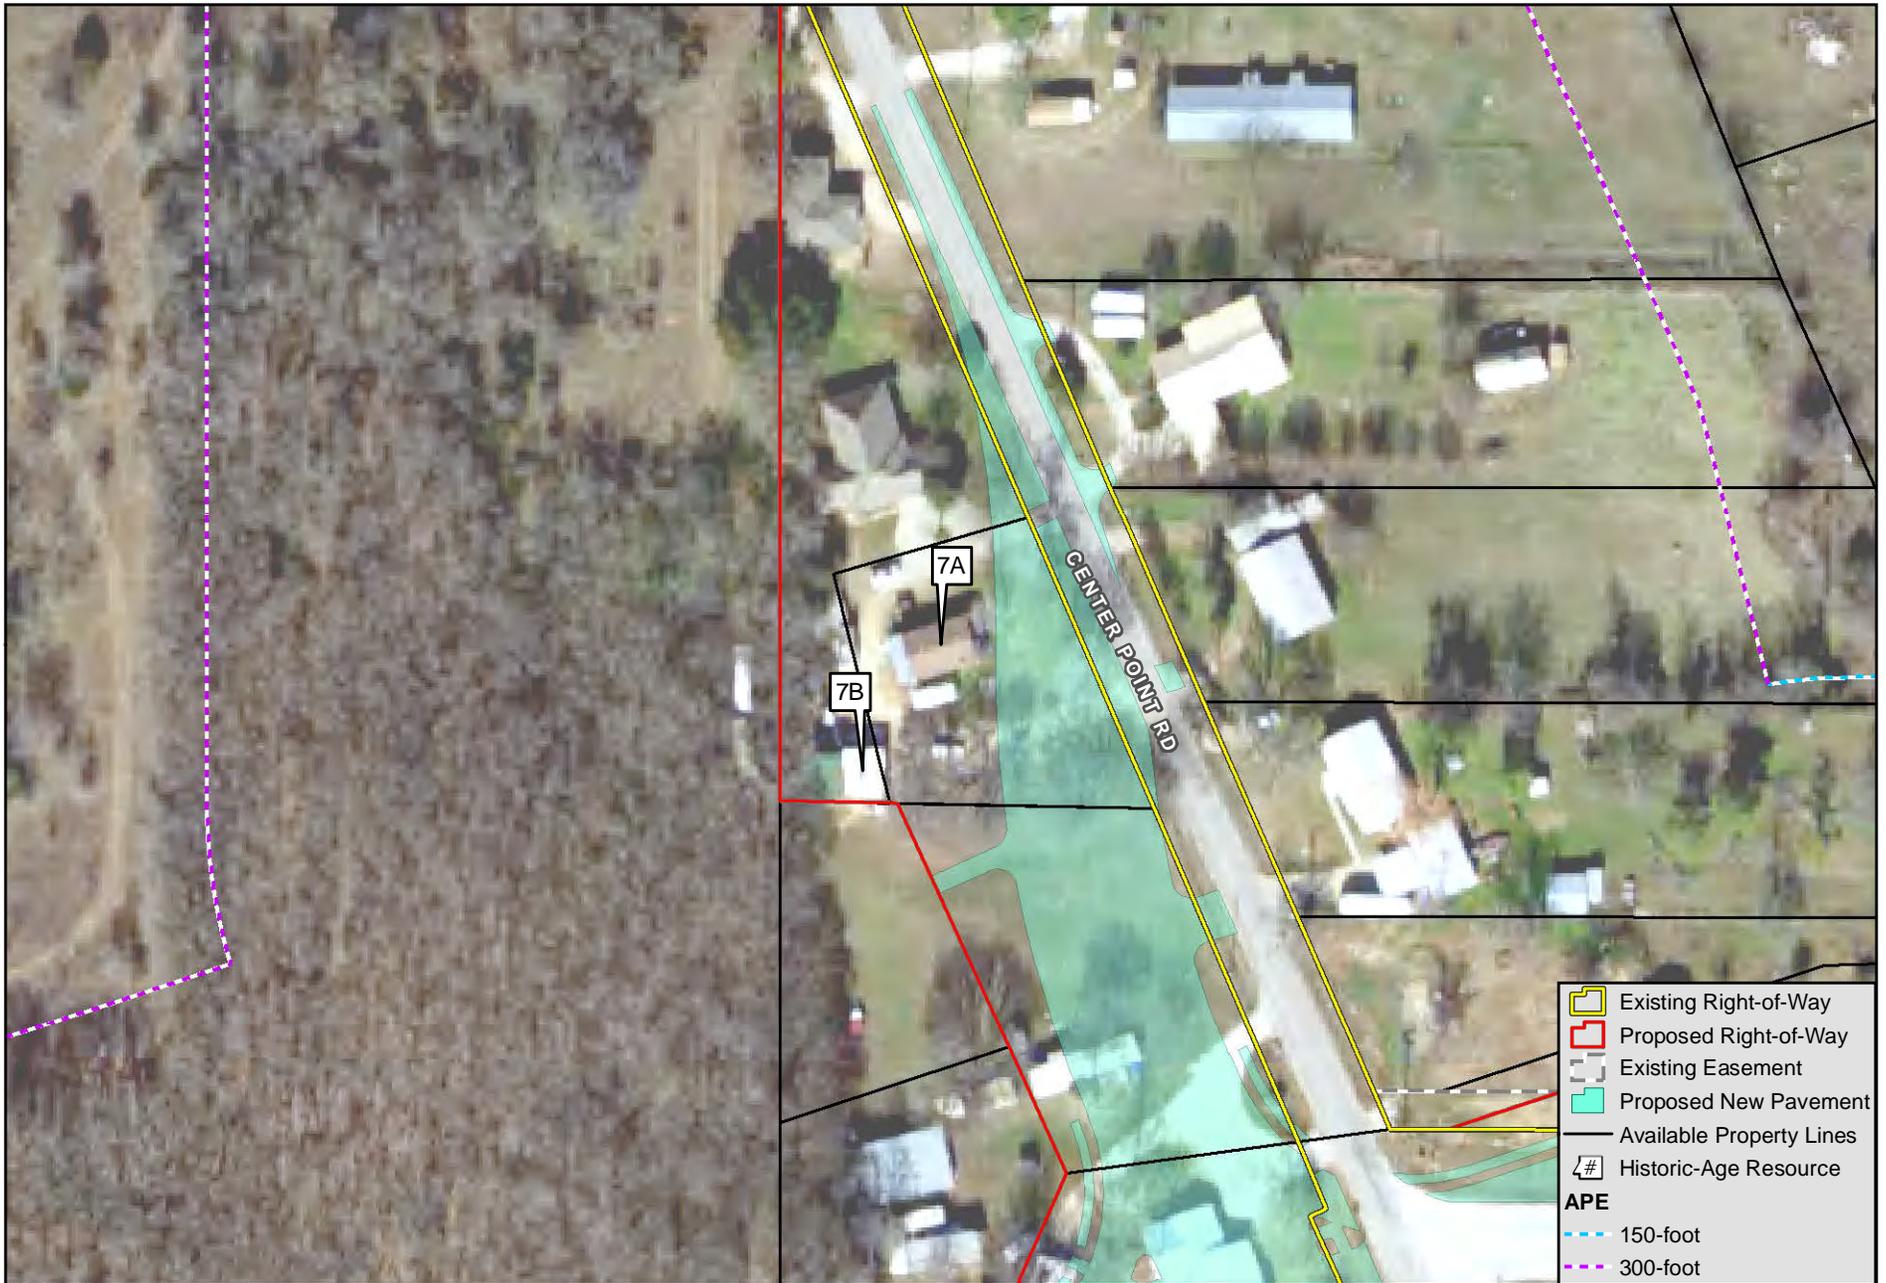


- Existing Right-of-Way
- Proposed Right-of-Way
- Existing Easement
- Proposed New Pavement
- Available Property Lines
- Historic-Age Resource
- APE**
- 150-foot
- 300-foot

Historic Resources
Location Map
Resource 7

IH 20 at Center Point Road



Data Sources: CMEC (2016)
Freese and Nichols (2016)
Aerial Source: TNRIS (2015)

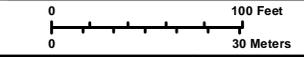

| | |
|--------------------------------|-----------------|
| Prepared for: TxDOT | 1 in = 100 feet |
| CSJ: 0314-07-051, 0314-07-052, | Scale: 1:1,200 |
| 0314-07-046 | Date: 6/21/2016 |

Resource ID: 8A **Name:** None **Year Built:** ca. 1960 **Source:** Field survey
Parcel ID: R000101135
Address: 320 CENTER POINT RD Weatherford Parker County Texas
Lat: 32.748803 **Long:** -97.729228
Type: Building **Style:** None **Form:** Bungalow
Historic Function/ Subcategory: Domestic/ Single Dwelling **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Vacant/ Not in Use **Contributing to District?** N/A



Primary (east) elevation; view facing west.

Photo 1 date taken: 6/10/16

Description: This resource is the primary residence on a parcel with several manufactured houses, travel trailers, and utility or storage buildings. This is a single-story, cross-gabled house in the bungalow form. It has a partial width, integrated porch, and is clad in asbestos shingle and vinyl siding. The roof material is corrugated metal. A large addition extends the house to the north and includes a garage. It appears the windows have been replaced.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This resource is a modest example of the bungalow form. No associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction, when compared to other nearby houses. Also, it does not represent the work of a master or possess high artistic value. Furthermore, the modifications have impacted its integrity. As a result, it is recommended not eligible for inclusion in the NRHP.

Resource ID: 8A

Address: 320 CENTER POINT RD

Parcel ID: R000101135

Oblique of east and north elevations; view facing southwest.

Photo 2 date taken:
6/10/16



Resource ID: 8B **Name:** None **Year Built:** ca. 1995 **Source:** Aerial photos
Parcel ID: R000101135 **Address:** 320 CENTER POINT RD Weatherford Parker County Texas
Lat: 32.74866 **Long:** -97.729283
Type: Building **Style:** None **Form:** Irregular
Historic Function/ Subcategory: Rec & Culture/Swimming Pool **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Vacant/ Not in Use **Contributing to District?** N/A



Swimming pool located south of Resource 10A; view facing northwest.

Photo 1 date taken: 6/10/16

Description: This resource is a small, irregularly shaped, in-ground swimming pool located southwest of the primary residence (Resource 8A). It is no longer in use.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This resource is less than 50 years old and was not found to possess exceptional significance under Criterion Consideration G. As a result, it is recommended not eligible for the NRHP under Criterion A, B, or C.

Resource ID: 8B

Address: 320 CENTER POINT RD

Parcel ID: R000101135

Overview of swimming pool in relationship to Resource 10A, with IH 20 visible in the background/left side of photo; view facing west.

Photo 2 date taken:
6/10/16



Resource ID: 8C **Name:** None **Year Built:** ca. 1975 **Source:** Field survey
Parcel ID: R000101135 **Address:** 320 CENTER POINT RD Weatherford Parker County Texas
Lat: 32.749097 **Long:** -97.729462
Type: Building **Style:** None **Form:** Rectangular
Historic Function/ Subcategory: Domestic/ Single Dwelling **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Vacant/ Not in Use **Contributing to District?** N/A



Primary (south) elevation; view facing northwest.

Photo 1 date taken: 6/10/16

Description: This resource is a non-historic-age manufactured house located north of the primary residence (Resource 8A) on the parcel. It appears to be abandoned.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This resource is less than 50 years old and was not found to possess exceptional significance under Criterion Consideration G. As a result, it is recommended not eligible for the NRHP under Criterion A, B, or C.

Resource ID: 8C

Address: 320 CENTER POINT RD

Parcel ID: R000101135

Oblique of south and east elevations; view facing northwest.

Photo 2 date taken:
6/10/16



Resource ID: 8D **Name:** None **Year Built:** ca. 1960 **Source:** Field survey
Parcel ID: R000101135
Address: 320 CENTER POINT RD Weatherford Parker County Texas
Lat: 32.749065 **Long:** -97.729593
Type: Building **Style:** None **Form:** Rectangular
Historic Function/ Subcategory: Domestic/ Secondary Structure **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Vacant/ Not in Use **Contributing to District?** N/A



East elevation; view facing west.

Photo 1 date taken: 6/10/16

Description: This resource is a small, front-gabled utilitarian building clad in plywood siding. It appears to be a well house but the function/use could not be confirmed.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This is a utilitarian building with no distinctive characteristics. During the historic context development, no associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction. Also, it does not represent the work of a master or possess high artistic value. As such, it is recommended not eligible for inclusion in the NRHP.

Resource ID: 8D

Address: 320 CENTER POINT RD

Parcel ID: R000101135

Oblique of south and east elevations; view facing northwest.

Photo 2 date taken:
6/10/16



Resource ID: 8E **Name:** None **Year Built:** ca. 1965 **Source:** Field survey
Parcel ID: R000101135
Address: 320 CENTER POINT RD Weatherford Parker County Texas
Lat: 32.748967 **Long:** -97.729741
Type: Building **Style:** None **Form:** Rectangular
Historic Function/ Subcategory: Domestic/ Secondary Structure **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Vacant/ Not in Use **Contributing to District?** N/A



Primary (east) elevation; view facing west.

Photo 1 date taken: 6/10/16

Description: This resource is a multi-bay, side gabled garage or equipment storage building clad in corrugated metal. It is open on the east side.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This is a utilitarian building with no distinctive characteristics. During the historic context development, no associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction. Also, it does not represent the work of a master or possess high artistic value. As such, it is recommended not eligible for inclusion in the NRHP.

Resource ID: 8E

Address: 320 CENTER POINT RD

Parcel ID: R000101135

Oblique of east and south elevations; photo also shows travel trailers parked in yard; view facing northwest.

Photo 2 date taken:
6/10/16



| | | | |
|--|-------------------------------------|--------------------------------------|-----------------------------|
| Resource ID: 8F | Name: None | Year Built: ca. 1980 | Source: Field survey |
| Parcel ID: R000101135 | Address: 320 CENTER POINT RD | Weatherford Parker County Texas | |
| | Lat: 32.748797 | Long: -97.729501 | |
| | Type: Building | Style: None | Form: Rectangular |
| Historic Function/ Subcategory: Domestic/ Single Dwelling | | Indiv. NRHP Eligible? No | Effect: N/A |
| Current Function/Subcategory: Vacant/ Not in Use | | Contributing to District? N/A | |



Oblique of north and east elevations; view facing southwest.

Photo 1 date taken: 6/10/16

Description: This resource is a non-historic-age manufactured house that is located behind (west of) the primary residence (Resource 8A). It is abandoned and has vegetation growing through the building.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This resource is less than 50 years old and was not found to possess exceptional significance under Criterion Consideration G. As a result, it is recommended not eligible for the NRHP under Criterion A, B, or C.

Resource ID: 8F


Address: 320 CENTER POINT RD

Parcel ID: R000101135

Zoomed in view of east (primary) and north elevations; view facing northwest. Photo of full east elevation difficult to obtain due to extensive vegetation.

Photo 2 date taken:
6/10/16



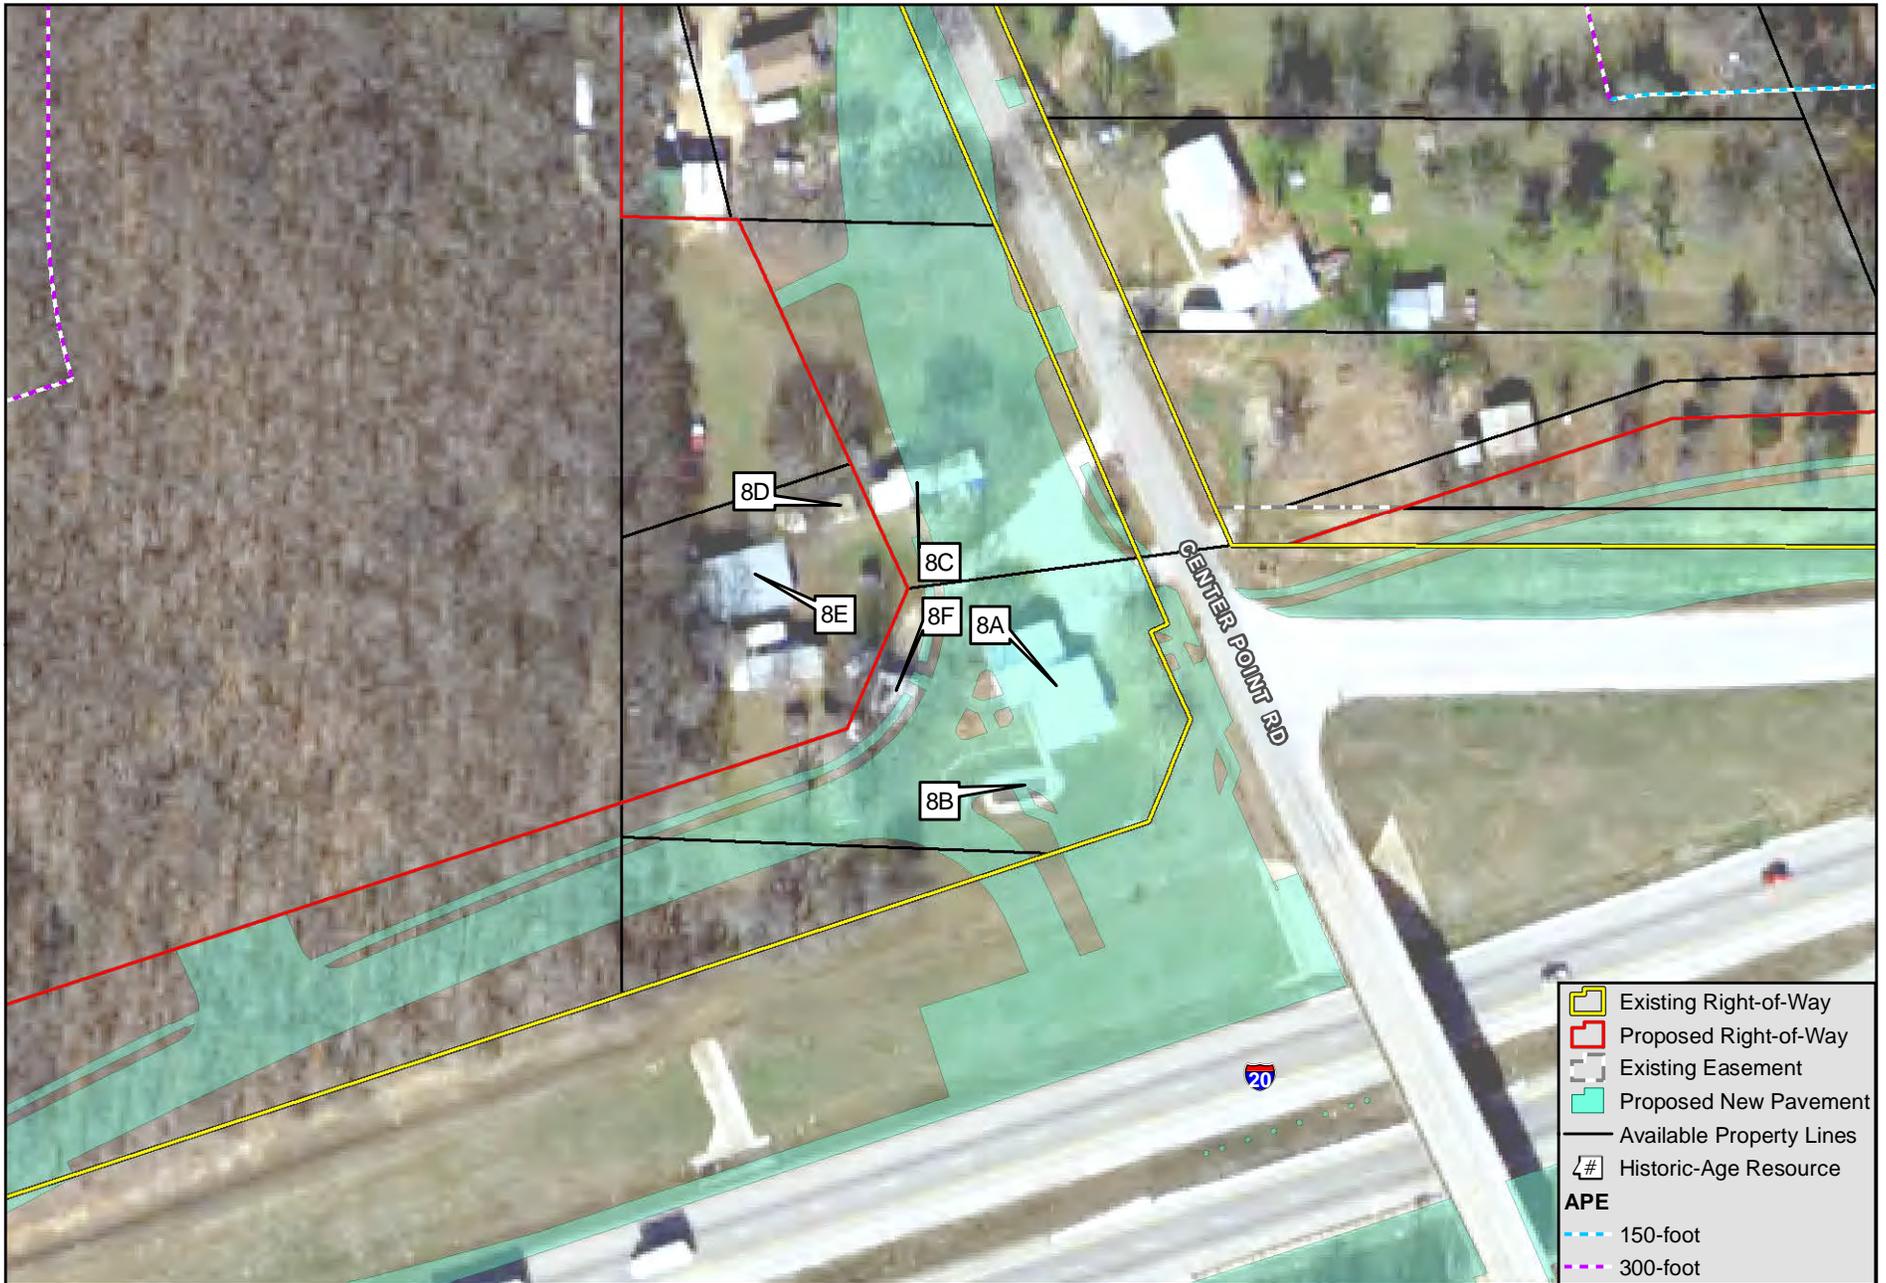


Historic Resources
Location Map
Resource 8

IH 20 at Center Point Road



Data Sources: CMEC (2016)
Freese and Nichols (2016)
Aerial Source: TNRIS (2015)

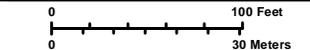

| | |
|--------------------------------|-----------------|
| Prepared for: TxDOT | 1 in = 100 feet |
| CSJ: 0314-07-051, 0314-07-052, | Scale: 1:1,200 |
| 0314-07-046 | Date: 6/21/2016 |

Resource ID: 9A **Name:** None **Year Built:** ca. 1925 **Source:** Field survey
Parcel ID: R000039915 **Address:** 3303 E BANKHEAD DR Weatherford Parker County Texas
Lat: 32.741116 **Long:** -97.729987
Type: Building **Style:** None **Form:** Bungalow
Historic Function/ Subcategory: Domestic/ Single Dwelling **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Domestic/ Single Dwelling **Contributing to District?** N/A



Oblique of east and south elevations; view facing northwest.

Photo 1 date taken: 6/10/16

Description: Resource 9A is a one-story, cross gable house in the bungalow form. The house is clad in horizontal wood siding and has a corrugated metal roof. The partial width, front gable porch wraps around the projecting entrance to the north. The windows are covered with storm windows and appear to be two-over-two aluminum sash windows. An addition extends the house to the north. A water well is located at the southeast corner of the porch, and an underground storm cellar is located near the northeast corner of the porch.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: Resource 9 does not represent a particularly early example of an agricultural complex. Research did not reveal important associations with events or persons of historic importance. While the farmstead retains original barns, other agricultural-related buildings have been added to the complex over time. As such, the farmstead does not embody distinctive characteristics of a type, period, or method of construction when compared to other farmsteads in the region. The resource does not represent the work of a master or possess high artistic value. As a result, Resource 12 is recommended not eligible for inclusion in the NRHP under Criteria A, B, or C.

Resource ID: 9A

Address: 3303 E BANKHEAD DR

Parcel ID: R000039915

Overview of house and several outbuildings; view facing north/northwest.

Photo 2 date taken:
6/10/16



Resource ID: 9B **Name:** None **Year Built:** ca. 1925 **Source:** Field survey
Parcel ID: R000039915 **Address:** 3303 E BANKHEAD DR Weatherford Parker County Texas
Lat: 32.741205 **Long:** -97.729912
Type: Structure **Style:** None **Form:** Irregular
Historic Function/ Subcategory: Domestic/ Secondary Structure **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Domestic/ Secondary Structure **Contributing to District?** N/A



Oblique of east and south elevations; view facing northwest.

Photo 1 date taken: 6/10/16

Description: Resource 9B is a wood clad well house and associated metal windmill. These structures are located northeast of the house, at the edge of the house's front yard.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: These are utilitarian structures with no distinctive characteristics. During the historic context development, no associations were identified linking them to persons or events of historic importance. Furthermore, the resources do not embody distinctive characteristics of a type, period, or method of construction. Also, they do not represent the work of a master or possess high artistic value. As such, they are recommended not eligible individually for inclusion in the NRHP.

Resource ID: 9B

Address: 3303 E BANKHEAD DR

Parcel ID: R000039915

Overview of well house and
windmill; view facing
northwest.

Photo 2 date taken:
6/10/16



Resource ID: 9C **Name:** None **Year Built:** ca. 1960 **Source:** Field survey
Parcel ID: R000039915 **Address:** 3303 E BANKHEAD DR Weatherford Parker County Texas
Lat: 32.741309 **Long:** -97.729663
Type: Building **Style:** None **Form:** Rectangular
Historic Function/ Subcategory: Domestic/ Secondary Structure **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Domestic/ Secondary Structure **Contributing to District?** N/A



Primary (south) elevation; view facing north/northwest.

Photo 1 date taken: 6/10/16

Description: This resource is a front gable garage clad in vertical wood siding. There is a large garage door in the south elevation, and the building has aluminum sash windows. It appears the original one-car garage was extended to the west with an addition.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This is an utilitarian building with no distinctive characteristics. During the historic context development, no associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction. Also, it does not represent the work of a master or possess high artistic value. As such, it is recommended not eligible individually for inclusion in the NRHP.

Resource ID: 9C

Address: 3303 E BANKHEAD DR

Parcel ID: R000039915

Overview of garage in relation to house and other buildings; view facing north.

Photo 2 date taken:
6/10/16



| | | | |
|---|------------------------------------|--------------------------------------|-----------------------------|
| Resource ID: 9D | Name: None | Year Built: ca. 1925 | Source: Field survey |
| Parcel ID: R000039915 | Address: 3303 E BANKHEAD DR | Weatherford Parker County Texas | |
| | Lat: 32.741313 | Long: -97.729423 | |
| | Type: Building | Style: None | Form: Rectangular |
| Historic Function/ Subcategory: Agriculture/ Outbuilding | | Indiv. NRHP Eligible? No | Effect: N/A |
| Current Function/Subcategory: Agriculture/ Outbuilding | | Contributing to District? N/A | |



Primary (south) elevation; view facing north/northeast.

Photo 1 date taken: 6/10/16

Description: This resource is a side gabled barn clad in corrugated metal. There are open equipment storage bays on the west end of the building and open animal stalls at the east end.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This is an utilitarian building with no distinctive characteristics. During the historic context development, no associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction. Also, it does not represent the work of a master or possess high artistic value. As such, it is recommended not eligible individually for inclusion in the NRHP.

Resource ID: 9D

Address: 3303 E BANKHEAD DR

Parcel ID: R000039915

East end of the building with open animal stalls (currently being used for hay storage); view facing northwest.

Photo 2 date taken:
6/10/16



Resource ID: 9E **Name:** None **Year Built:** ca. 1925 **Source:** Field survey
Parcel ID: R000039915 **Address:** 3303 E BANKHEAD DR Weatherford Parker County Texas
Lat: 32.741517 **Long:** -97.729697
Type: Building **Style:** None **Form:** Rectangular
Historic Function/ Subcategory: Agriculture/ Outbuilding **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Agriculture/ Outbuilding **Contributing to District?** N/A



South elevation; view facing north/northeast.

Photo 1 date taken: 6/10/16

Description: This resource is a large, side gabled animal barn clad in wood, and with a corrugated metal roof. Animal pens are connected to the south elevation of the barn. During fieldwork, there was no evidence of animals currently living at the complex.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This is an utilitarian building with no distinctive characteristics. During the historic context development, no associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction. Also, it does not represent the work of a master or possess high artistic value. As such, it is recommended not eligible individually for inclusion in the NRHP.

Resource ID: 9E

Address: 3303 E BANKHEAD DR

Parcel ID: R000039915

Overview of animal barn
(center of photo) in relation to
adjacent buildings; view facing
north.

Photo 2 date taken:
6/10/16



| | | | |
|---|------------------------------------|--------------------------------------|---|
| Resource ID: 9F | Name: None | Year Built: ca. 2000 | Source: Field survey/aerial photos |
| Parcel ID: R000039915 | Address: 3303 E BANKHEAD DR | Weatherford Parker County Texas | |
| | Lat: 32.741815 | Long: -97.729688 | |
| | Type: Building | Style: None | Form: Rectangular |
| Historic Function/ Subcategory: Agriculture/ Outbuilding | | Indiv. NRHP Eligible? No | Effect: N/A |
| Current Function/Subcategory: Agriculture/ Outbuilding | | Contributing to District? N/A | |



Oblique of south and east elevations; view facing northwest.

Photo 1 date taken: 6/10/16

Description: This resource is a large corrugated metal building that appears to be used for equipment storage. There are two, large garage doors in the south elevation.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This resource is less than 50 years old and was not found to possess exceptional significance under Criterion Consideration G. As a result, it is recommended not eligible for the NRHP under Criterion A, B, or C.

Resource ID: 9F

Address: 3303 E BANKHEAD DR

Parcel ID: R000039915

East elevation; view facing west.

Photo 2 date taken:
6/10/16



| | | | |
|---|------------------------------------|--------------------------------------|-----------------------------|
| Resource ID: 9G | Name: None | Year Built: ca. 1950 | Source: Field survey |
| Parcel ID: R000039915 | Address: 3303 E BANKHEAD DR | Weatherford Parker County Texas | |
| | Lat: 32.741704 | Long: -97.730353 | |
| | Type: Building | Style: None | Form: Rectangular |
| Historic Function/ Subcategory: Agriculture/ Outbuilding | | Indiv. NRHP Eligible? No | Effect: N/A |
| Current Function/Subcategory: Agriculture/ Outbuilding | | Contributing to District? N/A | |



Oblique of west and south elevations; view facing northeast.

Photo 1 date taken: 6/10/16

Description: This resource is a large, front gable barn clad in corrugated metal. There is a large door in the west elevation and open animal stalls at the south side.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This is an utilitarian building with no distinctive characteristics. During the historic context development, no associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction. Also, it does not represent the work of a master or possess high artistic value. As such, it is recommended not eligible individually for inclusion in the NRHP.

Resource ID: 9G

Address: 3303 E BANKHEAD DR

Parcel ID: R000039915

Overview of barn in relation to adjacent buildings; view facing northeast.

Photo 2 date taken:
6/10/16



| | | | |
|---|------------------------------------|--------------------------------------|---|
| Resource ID: 9H | Name: None | Year Built: ca. 2000 | Source: Field survey/aerial photos |
| Parcel ID: R000039915 | Address: 3303 E BANKHEAD DR | Weatherford Parker County Texas | |
| | Lat: 32.741424 | Long: -97.730159 | |
| | Type: Building | Style: None | Form: Rectangular |
| Historic Function/ Subcategory: Agriculture/ Outbuilding | | Indiv. NRHP Eligible? No | Effect: N/A |
| Current Function/Subcategory: Agriculture/ Outbuilding | | Contributing to District? N/A | |



Overview of modern, corrugated metal buildings added to complex. Building at far left is Resource F. The middle and right buildings appear to be used as storage and workshop buildings; view facing northeast.

Photo 1 date taken: 6/10/16

Description: This resource is a collection of two corrugated metal buildings added to the complex northwest of the primary residence. They appear to be used as storage buildings or workshops.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This resource is less than 50 years old and was not found to possess exceptional significance under Criterion Consideration G. As a result, it is recommended not eligible for the NRHP under Criterion A, B, or C.

Resource ID: 9H

Address: 3303 E BANKHEAD DR


Parcel ID: R000039915


Overview of animal barn
(center of photo) in relation to
adjacent buildings; view facing
north.

Photo 2 date taken:
6/10/16



Photo 3 date taken:
6/10/16

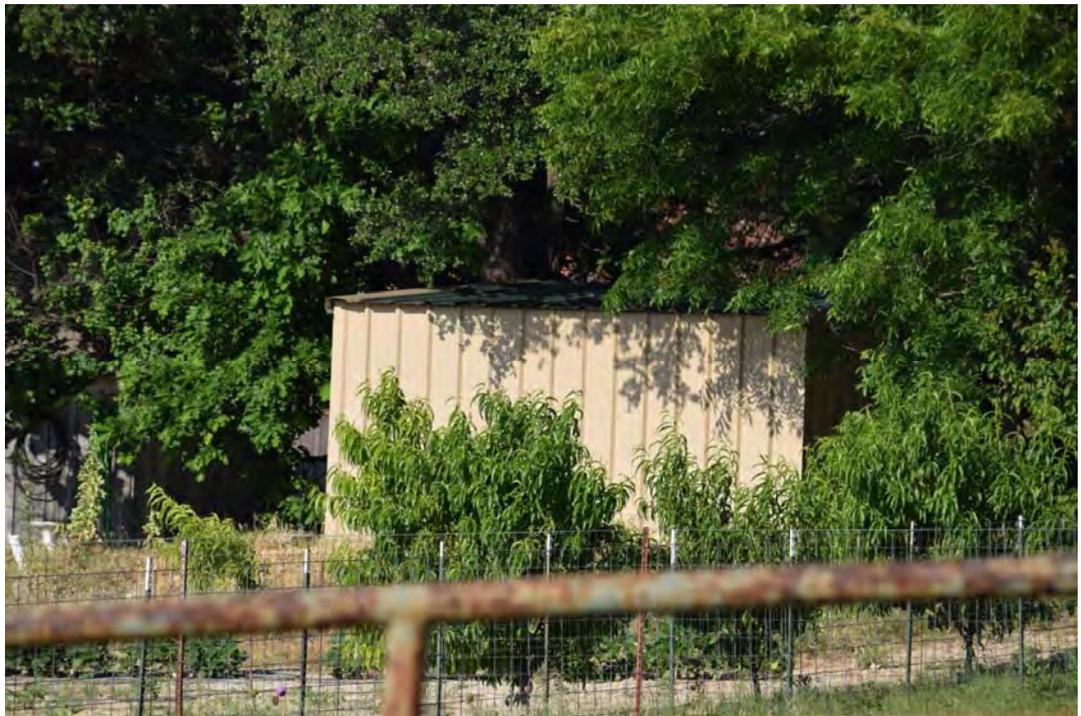

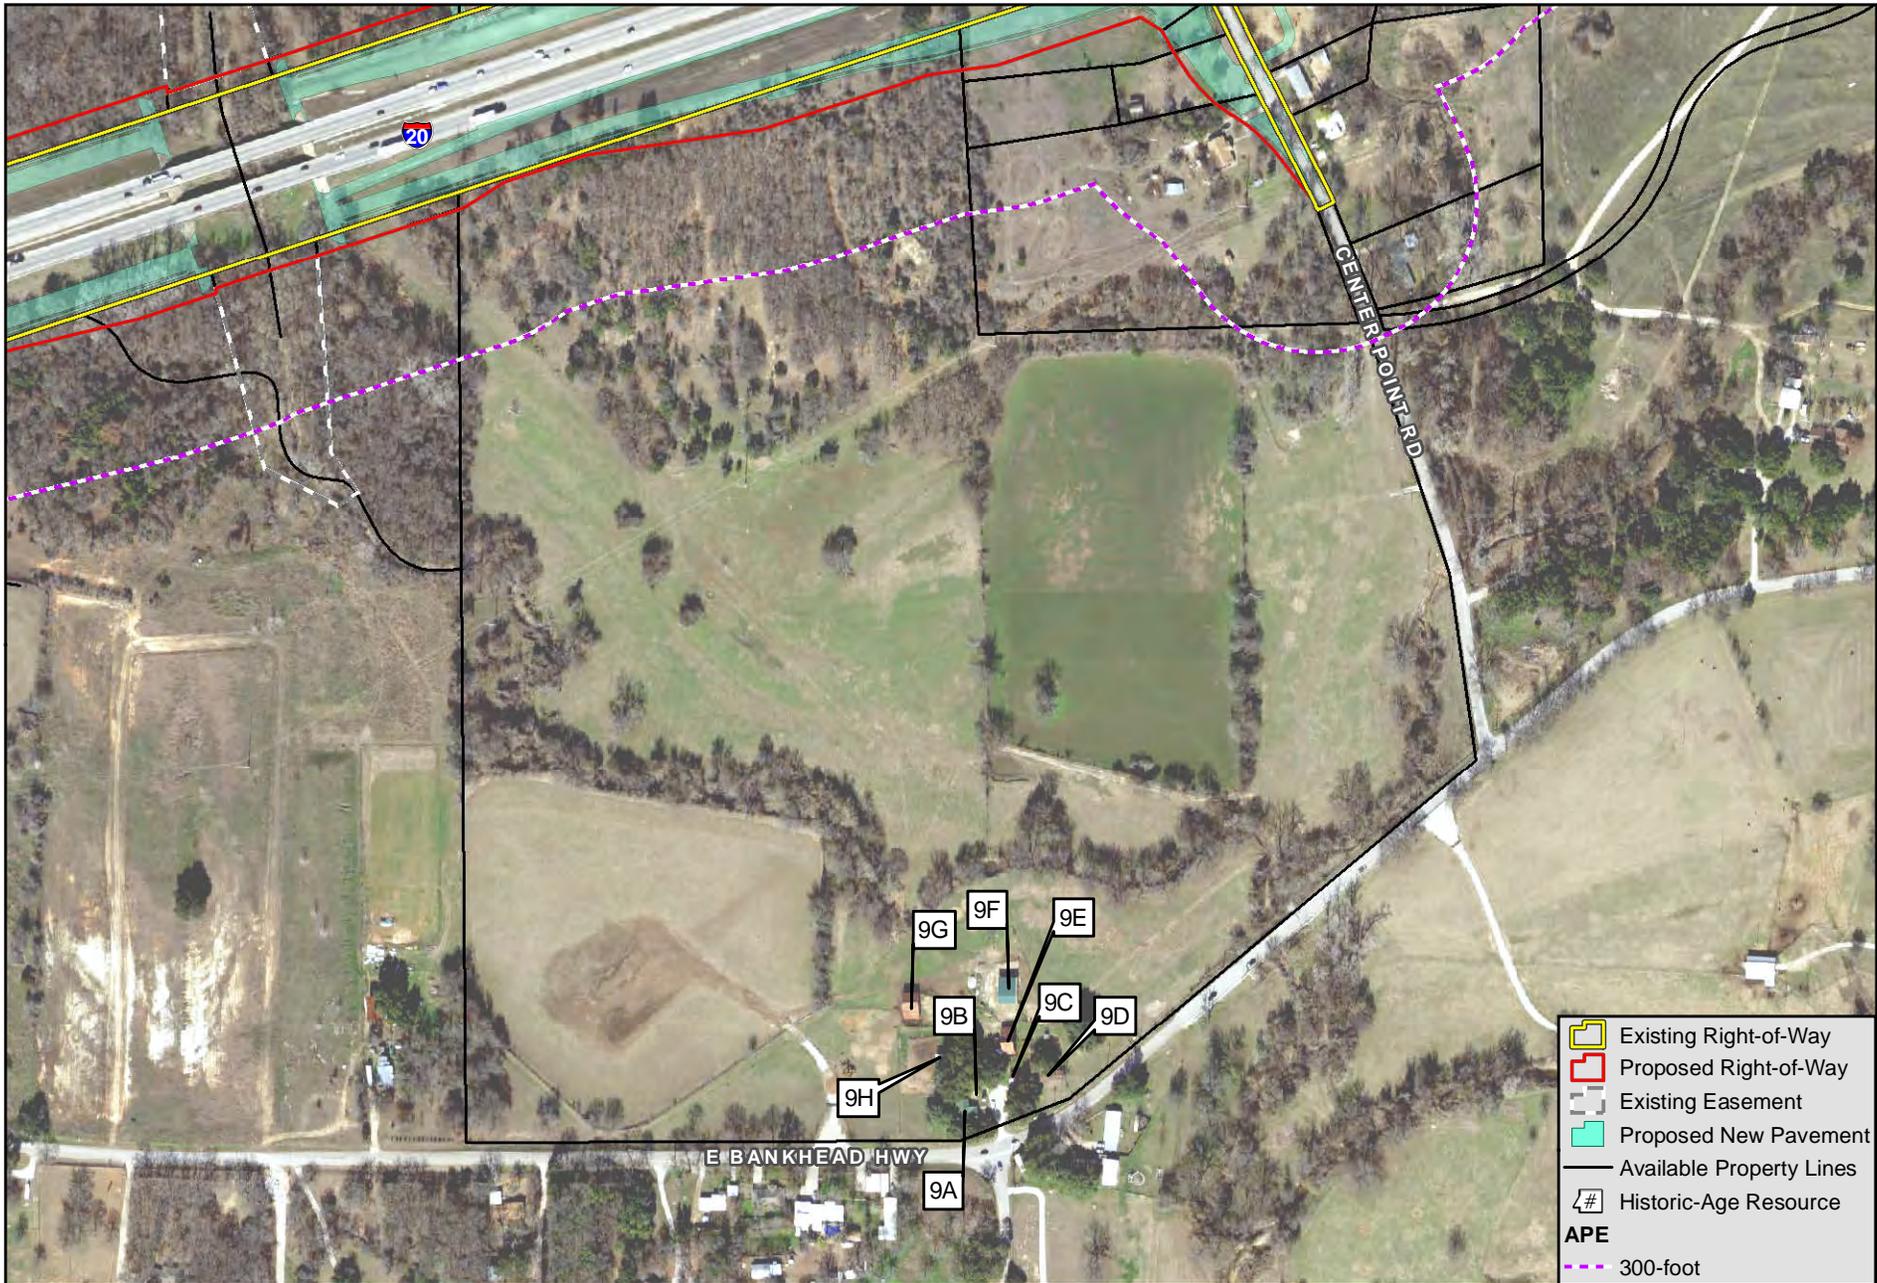

Historic Resources
Location Map
Resource 9

IH 20 at Center Point Road



Data Sources: CMEC (2016)
Freese and Nichols (2016)
Aerial Source: TNRIS (2015)

| | |
|--------------------------------|-----------------|
| | 0 to 400 Feet |
| | 0 to 100 Meters |
| Prepared for: TxDOT | 1 in = 400 feet |
| CSJ: 0314-07-051, 0314-07-052, | Scale: 1:4,800 |
| 0314-07-046 | Date: 6/21/2016 |

Resource ID: 10A **Name:** None **Year Built:** ca. 1970 **Source:** Field survey
Parcel ID: R000050209
Address: 301 CENTER POINT RD Weatherford Parker County Texas
Lat: 32.745974 **Long:** -97.726985
Type: Building **Style:** None **Form:** Ranch
Historic Function/ Subcategory: Domestic/ Single Dwelling **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Domestic/ Single Dwelling **Contributing to District?** N/A



Primary (west) elevation; view facing east.

Photo 1 date taken: 6/10/16

Description: This resource is a one-story, side gable Ranch house with cross-gable entrance. It is clad in a combination of horizontal wood siding and vertical wood siding. Additions to each side of the original massing extend the house to the north and south. Some windows are aluminum sash windows and others are replacement vinyl windows. There is also a carport attached to the northeast corner of the house.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This resource is a modest example of the Ranch house. No associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction, when compared to other nearby houses. Also, it does not represent the work of a master or possess high artistic value. Furthermore, the modifications have impacted its integrity. As a result, it is recommended not eligible for inclusion in the NRHP.

Resource ID: 10A

Address: 301 CENTER POINT RD

Parcel ID: R000050209

Oblique of west and south elevations; view facing northeast.

Photo 2 date taken:
6/10/16



Resource ID: 10B **Name:** None **Year Built:** ca. 1990 **Source:** Field survey
Parcel ID: R000050209
Address: 301 CENTER POINT RD Weatherford Parker County Texas
Lat: 32.746119 **Long:** -97.726904
Type: Building **Style:** None **Form:** Rectangular
Historic Function/ Subcategory: Domestic/ Secondary Structure **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Domestic/ Secondary Structure **Contributing to District?** N/A



East elevation of storage building (left side of photo) showing relationship to house; view facing west/northwest.

Photo 1 date taken: 6/10/16

Description: This resource is a non-historic-age front-gable storage building located northeast of the primary residence. It is clad in vertical wood siding.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This resource is less than 50 years old and was not found to possess exceptional significance under Criterion Consideration G. As a result, it is recommended not eligible for the NRHP under Criterion A, B, or C.

Resource ID: 10B

Address: 301 CENTER POINT RD

Parcel ID: R000050209

East elevation of storage
building; view facing west.

Photo 2 date taken:
6/10/16



Resource ID: 11A **Name:** None **Year Built:** 1966 **Source:** Parker CAD
Parcel ID: R000050196 **Address:** 505 CENTER POINT RD Weatherford Parker County Texas
Lat: 32.746757 **Long:** -97.727432
Type: Building **Style:** None **Form:** Ranch
Historic Function/ Subcategory: Domestic/ Single Dwelling **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Domestic/ Single Dwelling **Contributing to District?** N/A



West elevation; view facing east.

Photo 1 date taken: 6/10/16

Description: This resource is a 1966 Ranch house clad in brick. It has a partial width, shed roof porch. A large addition to the south end of the house creates a two-story section for the house. The addition is clad in vinyl siding. There is a carport located southwest of the house.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This resource is a modest example of the Ranch house. No associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction, when compared to other nearby houses. Also, it does not represent the work of a master or possess high artistic value. Furthermore, the modifications have impacted its integrity. As a result, it is recommended not eligible for inclusion in the NRHP.

Resource ID: 11A

Address: 505 CENTER POINT RD

Parcel ID: R000050196

Oblique of west and south elevations, including carport; view facing northeast.

Photo 2 date taken:
6/10/16



Resource ID: 11B **Name:** None **Year Built:** ca. 1980 **Source:** Field survey
Parcel ID: R000050196 **Address:** 505 CENTER POINT RD Weatherford Parker County Texas
Lat: 32.746898 **Long:** -97.727442
Type: Building **Style:** None **Form:** Rectangular
Historic Function/ Subcategory: Domestic/ Secondary Structure **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Domestic/ Secondary Structure **Contributing to District?** N/A



West elevation; view facing east

Photo 1 date taken: 6/10/16

Description: This resource is a small storage building located northeast of the house. It does not appear to be historic age.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This resource is less than 50 years old and was not found to possess exceptional significance under Criterion Consideration G. As a result, it is recommended not eligible for the NRHP under Criterion A, B, or C.

Resource ID: 11B

Address: 505 CENTER POINT RD

Parcel ID: R000050196

Oblique of south and west elevations; view facing northeast.

Photo 2 date taken:
6/10/16



Resource ID: 12A **Name:** None **Year Built:** 1966 **Source:** Parker CAD
Parcel ID: R000050196
Address: 501 CENTER POINT RD Weatherford Parker County Texas
Lat: 32.747621 **Long:** -97.727755
Type: Building **Style:** None **Form:** Bungalow
Historic Function/ Subcategory: Domestic/ Single Dwelling **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Domestic/ Single Dwelling **Contributing to District?** N/A



Primary (west) elevation; view facing east.

Photo 1 date taken: 6/10/16

Description: This resource is a one-story, front gable house in the bungalow form. It has a small, gable roof porch. It is clad in horizontal wood siding and has aluminum sash windows.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This resource is a modest example of the bungalow. No associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction, when compared to other nearby houses. Also, it does not represent the work of a master or possess high artistic value. As a result, it is recommended not eligible for inclusion in the NRHP.

Resource ID: 12A

Address: 501 CENTER POINT RD

Parcel ID: R000050196

Oblique of west and north elevations; view facing southeast.

Photo 2 date taken:
6/10/16



Overview of property showing Resource 15A at center, 15B at right, and 15C at left; view facing southeast.

Photo 3 date taken:
6/10/16



Resource ID: 12B **Name:** None **Year Built:** ca. 1970 **Source:** Field survey
Parcel ID: R000050196
Address: 505 CENTER POINT RD Weatherford Parker County Texas
Lat: 32.747481 **Long:** -97.727581
Type: Building **Style:** None **Form:** Rectangular
Historic Function/ Subcategory: Domestic/ Secondary Structure **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Domestic/ Secondary Structure **Contributing to District?** N/A



Oblique of west and north elevations; view facing southeast.

Photo 1 date taken: 6/10/16

Description: Resource 12B represents two corrugated metal storage buildings that are connected with fencing. The south building (right side in photo above) is a two-bay equipment storage building. The north building appears to be a chicken coop. The buildings are located southeast of the primary residence.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: These are utilitarian buildings with no distinctive characteristics. During the historic context development, no associations were identified linking them to persons or events of historic importance. Furthermore, the resources do not embody distinctive characteristics of a type, period, or method of construction. Also, they do not represent the work of a master or possess high artistic value. As such, they are recommended not eligible for inclusion in the NRHP.

Resource ID: 12B

Address: 505 CENTER POINT RD

Parcel ID: R000050196

Oblique of west and south elevations; view facing northeast.

Photo 2 date taken:
6/10/16



Resource ID: 12C **Name:** None **Year Built:** ca. 1970 **Source:** Field survey
Parcel ID: R000050196 **Address:** 505 CENTER POINT RD Weatherford Parker County Texas
Lat: 32.747844 **Long:** -97.727677
Type: Building **Style:** None **Form:** Rectangular
Historic Function/ Subcategory: Domestic/ Secondary Structure **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Domestic/ Secondary Structure **Contributing to District?** N/A



Oblique of south (primary) and west elevations; view facing northeast.

Photo 1 date taken: 6/10/16

Description: This resource is a two-bay garage clad in corrugated metal. The garage doors are wood. It is located northeast of the primary residence.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This is an utilitarian building with no distinctive characteristics. During the historic context development, no associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction. Also, it does not represent the work of a master or possess high artistic value. As such, it is recommended not eligible for inclusion in the NRHP.

Resource ID: 12C

Address: 505 CENTER POINT RD

Parcel ID: R000050196

West elevation; view facing
east/northeast.

Photo 2 date taken:
6/10/16





Historic Resources
Location Map
Resource 12

IH 20 at Center Point Road



Data Sources: CMEC (2016)
Freese and Nichols (2016)
Aerial Source: TNRIS (2015)

| | | |
|--------------------------------|-----------------|-----------|
| | 0 | 100 Feet |
| | 0 | 30 Meters |
| Prepared for: TxDOT | 1 in = 100 feet | |
| CSJ: 0314-07-051, 0314-07-052, | Scale: 1:1,200 | |
| 0314-07-046 | Date: 6/21/2016 | |

Resource ID: 13 **Name:** NBI 021840031407042 **Year Built:** 1968 **Source:** National Bridge Inventory
Parcel ID: N/A
Address: CENTER POINT RD OVER IH 20 Weatherford Parker County Texas
Lat: 32.748246 **Long:** -97.728613
Type: Structure **Style:** None **Form:** Bridge
Historic Function/ Subcategory: Transportation/ Road-related **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Transportation/ Road-related **Contributing to District?** N/A



West elevation; view facing north/northeast.

Photo 1 date taken: 6/10/16

Description: Constructed in 1968 when IH 20 was developed, this bridge carries Center Point Road over IH 20 (NBI 021840031407042). It is a three-span, prestressed concrete girder bridge. It does not appear to have had any major alterations and retains its original railing.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: In accordance with Section 6007 of the Safe, Accountable, Flexible, Efficient Transportation Equity Act: A Legacy for Users (SAFETEA-LU), this bridge within the right-of-way of the interstate system is not eligible for the National Register since it was not included on FHWA's Final List of Nationally and Exceptionally Significant Features of the Federal Interstate Highway System.

Resource ID: 13

Address: CENTER POINT RD OVER IH 20

Parcel ID: N/A

Deck and railing of bridge; view facing north/northeast.



Photo 2 date taken:
6/10/16

Resource ID: 14A **Name:** None **Year Built:** ca. 1965 **Source:** Field survey
Parcel ID: Unknown **Address:** 315 CENTER POINT RD Weatherford Parker County Texas
Lat: 32.74951 **Long:** -97.728958
Type: Building **Style:** None **Form:** Minimal Traditional
Historic Function/ Subcategory: Domestic/ Single Dwelling **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Domestic/ Single Dwelling **Contributing to District?** N/A



Oblique of west and south elevations; view facing northeast.

Photo 1 date taken: 6/10/16

Description: This resource is a one-story, side gable Minimal Traditional house. It is clad in replacement vinyl siding, has replacement vinyl windows and several additions that resulted in an altered roof line. An ell connects the garage to the house.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This resource is a modest example of the Minimal Traditional house. No associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction, when compared to other nearby houses. Also, it does not represent the work of a master or possess high artistic value. Furthermore, the modifications have impacted its integrity. As a result, it is recommended not eligible for inclusion in the NRHP.

Resource ID: 14A

Address: 315 CENTER POINT RD

Parcel ID: Unknown

Oblique of west and north elevations; view facing southeast.

Photo 2 date taken:
6/10/16



Resource ID: 14B **Name:** None **Year Built:** ca. 1965 **Source:** Field survey
Parcel ID: Unknown **Address:** 315 CENTER POINT RD Weatherford Parker County Texas
Lat: 32.749346 **Long:** -97.728621
Type: Building **Style:** None **Form:** Rectangular
Historic Function/ Subcategory: Domestic/ Secondary Structure **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Domestic/ Secondary Structure **Contributing to District?** N/A



Oblique of west and south elevations; view facing northeast.

Photo 1 date taken: 6/10/16

Description: This resource is a corrugated metal building that appears to be an animal barn now being used for storage.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This is an utilitarian building with no distinctive characteristics. During the historic context development, no associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction. Also, it does not represent the work of a master or possess high artistic value. As such, it is recommended not eligible for inclusion in the NRHP.

Resource ID: 14B

Address: 315 CENTER POINT RD

Parcel ID: Unknown

Overview of property with Resource 17A at left, 17B at center, and 17C and 17D at right; view facing northeast.

Photo 2 date taken:
6/10/16



Resource ID: 14C **Name:** None **Year Built:** ca. 1980 **Source:** Field survey
Parcel ID: Unknown **Address:** 315 CENTER POINT RD Weatherford Parker County Texas
Lat: 32.749141 **Long:** -97.728525
Type: Building **Style:** None **Form:** Rectangular
Historic Function/ Subcategory: Domestic/ Secondary Structure **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Domestic/ Secondary Structure **Contributing to District?** N/A



Oblique of west and north elevations; view facing southeast.

Photo 1 date taken: 6/10/16

Description: This resource is a small, front gable building clad in plywood siding. The function and use was not apparent.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This is an utilitarian building with no distinctive characteristics. During the historic context development, no associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction. Also, it does not represent the work of a master or possess high artistic value. As such, it is recommended not eligible for inclusion in the NRHP.

Resource ID: 14C

Address: 315 CENTER POINT RD

Parcel ID: Unknown

South and west elevations; view facing northeast.

Photo 2 date taken:
6/10/16



Resource ID: 14D **Name:** None **Year Built:** ca. 1965 **Source:** Field survey
Parcel ID: Unknown **Address:** 315 CENTER POINT RD Weatherford Parker County Texas
Lat: 32.749169 **Long:** -97.728459
Type: Building **Style:** None **Form:** Rectangular
Historic Function/ Subcategory: Domestic/ Secondary Structure **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Domestic/ Secondary Structure **Contributing to District?** N/A



Oblique of west and north elevations; view facing southeast.

Photo 1 date taken: 6/10/16

Description: This resource is a side gable barn clad in corrugated metal. A wood panel covers the building's door. Animal pen fencing is attached to the building's north end. It does not appear to currently be in use.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This is an utilitarian building with no distinctive characteristics. During the historic context development, no associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction. Also, it does not represent the work of a master or possess high artistic value. As such, it is recommended not eligible for inclusion in the NRHP.

Resource ID: 14D


Address: 315 CENTER POINT RD

Parcel ID: Unknown

West elevation; view facing east.

Photo 2 date taken:
6/10/16



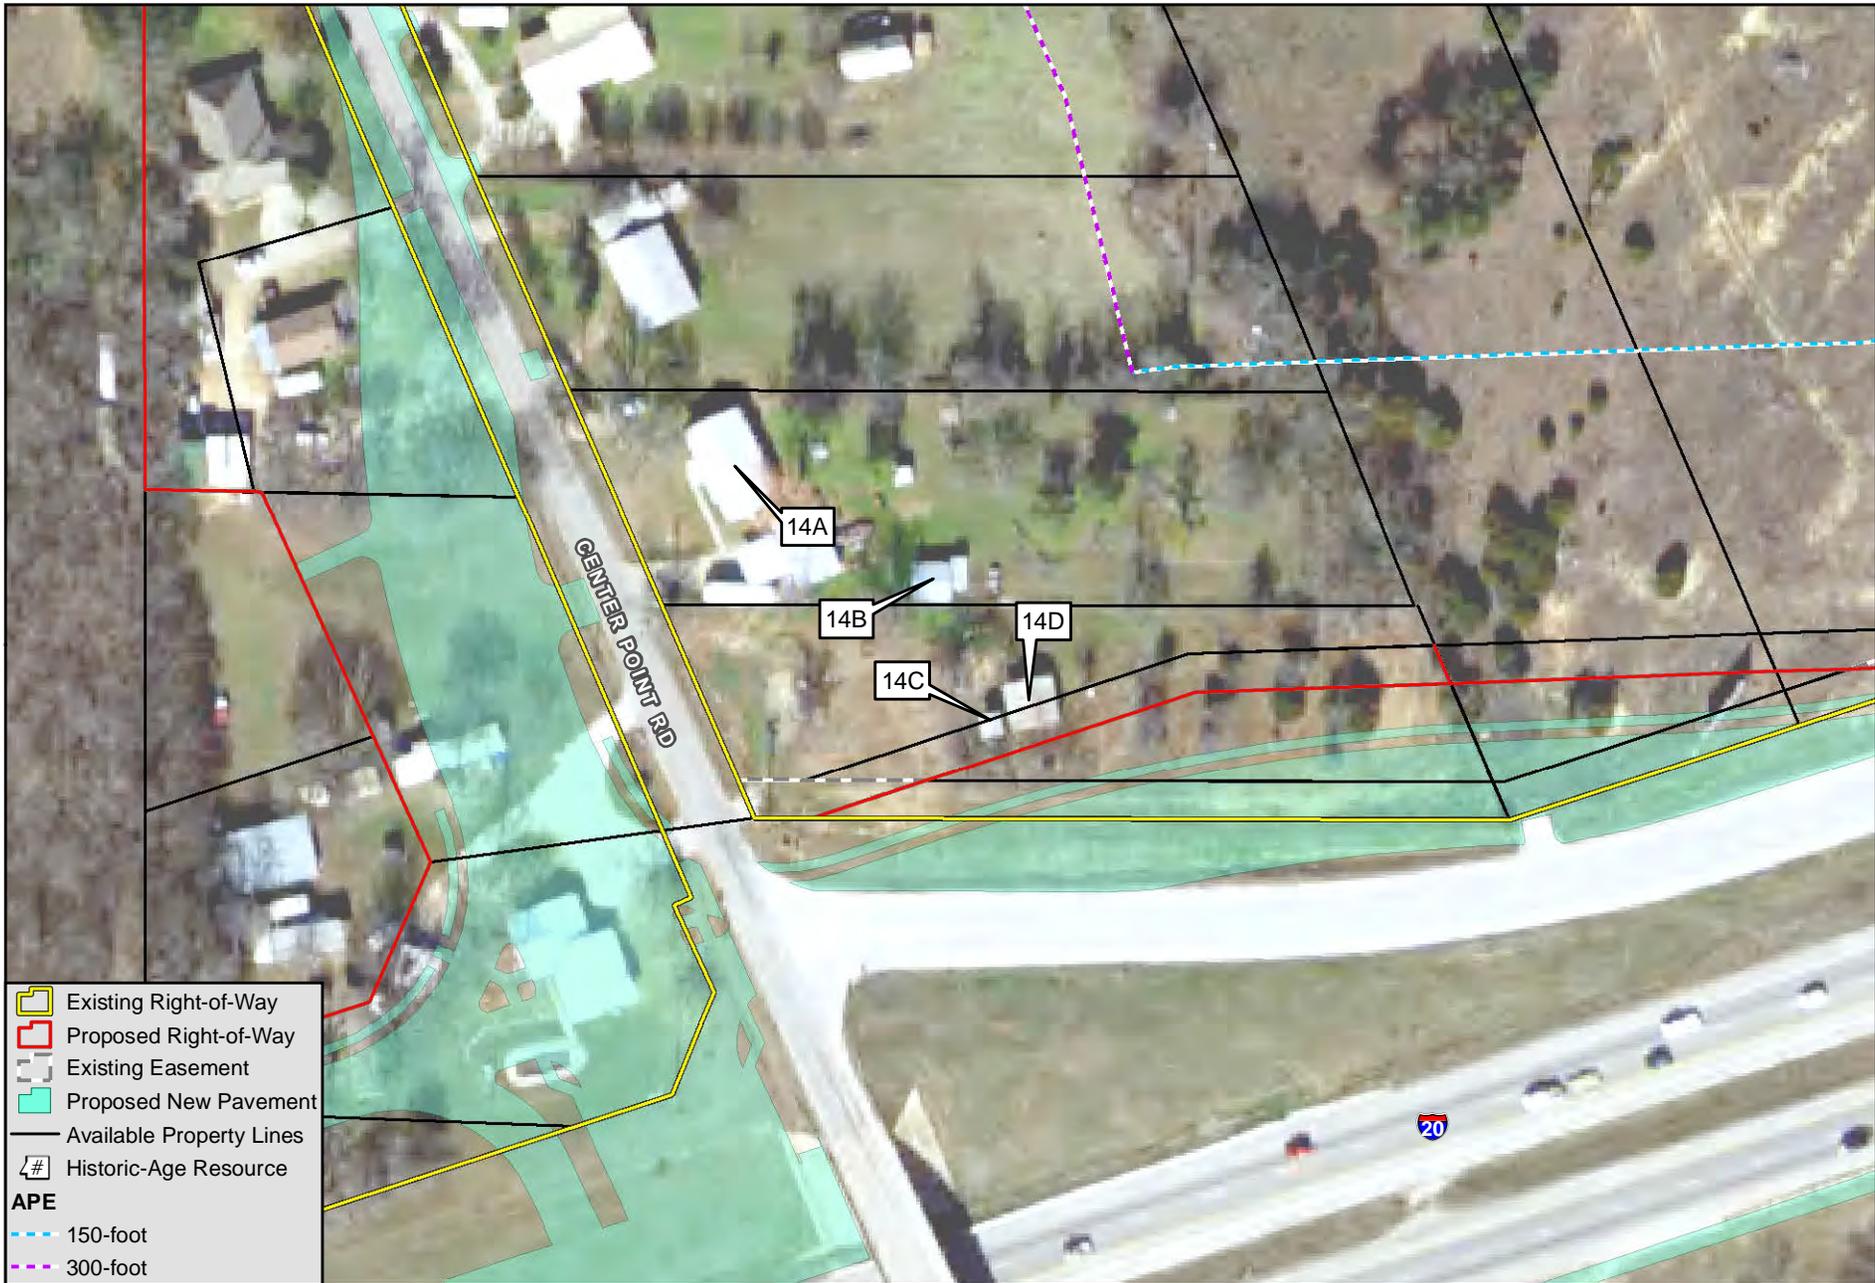

-  Existing Right-of-Way
-  Proposed Right-of-Way
-  Existing Easement
-  Proposed New Pavement
-  Available Property Lines
-  Historic-Age Resource
- APE**
-  150-foot
-  300-foot

Historic Resources
Location Map
Resource 14

IH 20 at Center Point Road



| | | | |
|---|--|---|---|
| Data Sources: CMEC (2016) Freese and Nichols (2016) Aerial Source: TNRIS (2015) | Prepared for: TxDOT CSJ: 0314-07-051, 0314-07-052, 0314-07-046 |  |  |
| | | 1 in = 100 feet Scale: 1:1,200 | |
| | | Date: 6/21/2016 | |

Resource ID: 15A **Name:** None **Year Built:** ca. 1960 **Source:** Field survey
Parcel ID: R000050210 **Address:** 311 CENTER POINT RD Weatherford Parker County Texas
Lat: 32.74979 **Long:** -97.729098
Type: Building **Style:** None **Form:** Minimal Traditional
Historic Function/ Subcategory: Domestic/ Single Dwelling **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Domestic/ Single Dwelling **Contributing to District?** N/A



Oblique of west and south elevations; view facing northeast.

Photo 1 date taken: 6/10/16

Description: This resource is a one-story, side gable Minimal Traditional house. It has a small, integrated entry porch and wood sash windows. The siding is replacement, multi-colored asphalt "shingles." Remnants of what is believed to be the original asbestos shingle siding is still present in the gable ends.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This resource is a modest example of the Minimal Traditional house. No associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction, when compared to other nearby houses. Also, it does not represent the work of a master or possess high artistic value. Furthermore, the modifications have impacted its integrity. As a result, it is recommended not eligible for inclusion in the NRHP.

Resource ID: 15A

Address: 311 CENTER POINT RD

Parcel ID: R000050210

Oblique of west and north elevations; view facing southeast.

Photo 2 date taken:
6/10/16



Resource ID: 15B **Name:** None **Year Built:** ca. 1960 **Source:** Field survey
Parcel ID: R000050210 **Address:** 311 CENTER POINT RD Weatherford Parker County Texas
Lat: 32.749885 **Long:** -97.729151
Type: Building **Style:** None **Form:** Rectangular
Historic Function/ Subcategory: Domestic/ Secondary Structure **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Domestic/ Secondary Structure **Contributing to District?** N/A



Primary (west) elevations; view facing southeast.

Photo 1 date taken: 6/10/16

Description: This resource is a one car, front gable garage that stands north of the primary residence. It is clad in the same asphalt "shingle" material as the house and has metal garage doors.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This is an utilitarian building with no distinctive characteristics. During the historic context development, no associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction. Also, it does not represent the work of a master or possess high artistic value. As such, it is recommended not eligible for inclusion in the NRHP.

Resource ID: 15B

Address: 311 CENTER POINT RD

Parcel ID: R000050210

Detail of west elevation of
garage; view facing east.

Photo 2 date taken:
6/10/16



| | | | |
|--|-------------------------------------|--------------------------------------|-----------------------|
| Resource ID: 16A | Name: None | Year Built: 1949 | Source: Owner |
| Parcel ID: R000050211 | Address: 309 CENTER POINT RD | Weatherford | Parker County Texas |
| | Lat: 32.750113 | Long: -97.729213 | |
| | Type: Building | Style: None | Form: Bungalow |
| Historic Function/ Subcategory: | Domestic/ Single Dwelling | Indiv. NRHP Eligible? No | Effect: N/A |
| Current Function/Subcategory: | Domestic/ Single Dwelling | Contributing to District? N/A | |



Oblique of west and south elevations; view facing northeast.

Photo 1 date taken: 6/10/16

Description: This resource is a one-story, front gable house in the bungalow form. It has a partial width integrated porch, is clad in hardiplank siding, and has a corrugated metal roof. An addition constructed in the last few years, according to the owner, extends the house to the north, and the windows are replacement vinyl windows.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This resource is a modest example of the bungalow form. No associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction, when compared to other nearby houses. Also, it does not represent the work of a master or possess high artistic value. Furthermore, the modifications have impacted its integrity. As a result, it is recommended not eligible for inclusion in the NRHP.

Resource ID: 16A

Address: 309 CENTER POINT RD

Parcel ID: R000050211

Oblique of west and north elevations; view facing southeast.

Photo 2 date taken:
6/10/16



Resource ID: 16B **Name:** None **Year Built:** ca. 1990 **Source:** Field survey
Parcel ID: R000050211 **Address:** 309 CENTER POINT RD Weatherford Parker County Texas
Lat: 32.750104 **Long:** -97.728711
Type: Building **Style:** None **Form:** Rectangular
Historic Function/ Subcategory: Domestic/ Secondary Structure **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Domestic/ Secondary Structure **Contributing to District?** N/A



Oblique of west and south elevations; view facing northeast.

Photo 1 date taken: 6/10/16

Description: This resource is a one-story, front gable workshop/garage building. It is clad in hardiplank and has a corrugated metal roof. There are large garage doors in the primary (west) elevation and in south elevation of the building.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This resource is less than 50 years old and was not found to possess exceptional significance under Criterion Consideration G. As a result, it is recommended not eligible for the NRHP under Criterion A, B, or C.

Resource ID: 16B

Address: 309 CENTER POINT RD

Parcel ID: R000050211

South elevation of Resource 19B, with Resource 18A at left side of photo; view facing northeast.

Photo 2 date taken:
6/10/16



Resource ID: 17A **Name:** None **Year Built:** ca. 1960 **Source:** Field survey
Parcel ID: R000050209
Address: 301 CENTER POINT RD Weatherford Parker County Texas
Lat: 32.750772 **Long:** -97.729445
Type: Building **Style:** None **Form:** Ranch
Historic Function/ Subcategory: Domestic/ Single Dwelling **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Domestic/ Single Dwelling **Contributing to District?** N/A



West elevation; view facing east.

Photo 1 date taken: 6/10/16

Description: This resource is a one-story, cross gable Ranch house with small, integrated porch. It is clad in replacement vinyl siding, with decorative stone siding on a portion of the primary (west) elevation. It appears to retain original windows, which are shaded by metal awnings. There is a two-car carport attached to the south elevation. Substantial vegetation obscures a majority of the house.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This resource is a modest example of the Ranch house. No associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction, when compared to other nearby houses. Also, it does not represent the work of a master or possess high artistic value. Furthermore, the modifications have impacted its integrity. As a result, it is recommended not eligible for inclusion in the NRHP.

Resource ID: 17A

Address: 301 CENTER POINT RD

Parcel ID: R000050209

Oblique of west and north elevations; view facing southeast.

Photo 2 date taken:
6/10/16



Resource ID: 17B **Name:** None **Year Built:** ca. 1960 **Source:** Field survey
Parcel ID: R000050209 **Address:** 301 CENTER POINT RD Weatherford Parker County Texas
Lat: 32.750481 **Long:** -97.72948
Type: Building **Style:** None **Form:** Rectangular
Historic Function/ Subcategory: Domestic/ Secondary Structure **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Domestic/ Secondary Structure **Contributing to District?** N/A



Oblique of west and north elevations; view facing southeast.

Photo 1 date taken: 6/10/16

Description: This resource is a front gable utilitarian building located south of the primary residence. It is clad in vertical wood panels. The building appears to be used as a workshop.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This is an utilitarian building with no distinctive characteristics. During the historic context development, no associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction. Also, it does not represent the work of a master or possess high artistic value. As such, it is recommended not eligible for inclusion in the NRHP.

Resource ID: 17B

Address: 301 CENTER POINT RD

Parcel ID: R000050209

Oblique of west and south elevations; view facing northeast.

Photo 2 date taken:
6/10/16



Resource ID: 17C **Name:** None **Year Built:** ca. 1960 **Source:** Field survey
Parcel ID: R000050209 **Address:** 301 CENTER POINT RD Weatherford Parker County Texas
Lat: 32.750475 **Long:** -97.729129
Type: Building **Style:** None **Form:** Rectangular
Historic Function/ Subcategory: Domestic/ Secondary Structure **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Domestic/ Secondary Structure **Contributing to District?** N/A



Oblique of west and south elevations; view facing northeast.

Photo 1 date taken: 6/10/16

Description: This resource is a side gable equipment storage building clad in corrugated metal. There are aluminum sash windows in the west elevation. It is assumed the doors are located on the north side of the building but were not visible from the public right-of-way.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This is an utilitarian building with no distinctive characteristics. During the historic context development, no associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction. Also, it does not represent the work of a master or possess high artistic value. As such, it is recommended not eligible for inclusion in the NRHP.

Resource ID: 17C

Address: 301 CENTER POINT RD

Parcel ID: R000050209

West elevation (Resource 20C
at back); view facing southeast.

Photo 2 date taken:
6/10/16



Resource ID: 17D **Name:** None **Year Built:** ca. 1960 **Source:** Field survey
Parcel ID: R000050209 **Address:** 301 CENTER POINT RD Weatherford Parker County Texas
Lat: 32.750587 **Long:** -97.729377
Type: Building **Style:** None **Form:** Rectangular
Historic Function/ Subcategory: Domestic/ Secondary Structure **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Domestic/ Secondary Structure **Contributing to District?** N/A



West elevations of small, white storage buildings (2 of 3 at edge of back yard); view facing east.

Photo 1 date taken: 6/10/16

Description: This resource is a series of three, small storage buildings located along the edge of the backyard. The buildings are front gable, clad in horizontal wood siding, and have doors in the west elevations.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: These are utilitarian buildings with no distinctive characteristics. During the historic context development, no associations were identified linking them to persons or events of historic importance. Furthermore, the resources do not embody distinctive characteristics of a type, period, or method of construction. Also, they do not represent the work of a master or possess high artistic value. As such, they are recommended not eligible for inclusion in the NRHP.

Resource ID: 17D

Address: 301 CENTER POINT RD

Parcel ID: R000050209

Oblique of west and south elevations of third, small white storage building located at the edge of the backyard; view facing northeast.

Photo 2 date taken:
6/10/16



Resource ID: 18A **Name:** None **Year Built:** ca. 1960 **Source:** Field survey
Parcel ID: R000044000 **Address:** 229 CENTER POINT RD Weatherford Parker County Texas
Lat: 32.75126 **Long:** -97.729622
Type: Building **Style:** None **Form:** Minimal Traditional
Historic Function/ Subcategory: Domestic/ Single Dwelling **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Domestic/ Single Dwelling **Contributing to District?** N/A



West elevation; view facing east.

Photo 1 date taken: 6/10/16

Description: This resource is a one-story, side gable Minimal Traditional house. It has a partial width, front gable porch. The house is clad in horizontal wood siding, and the windows are aluminum sash windows. There are carports attached to the north and south sides of the house.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This resource is a modest example of the Minimal Traditional form. No associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction, when compared to other nearby houses. Also, it does not represent the work of a master or possess high artistic value. As a result, it is recommended not eligible for inclusion in the NRHP.

Resource ID: 18A

Address: 229 CENTER POINT RD

Parcel ID: R000044000

Oblique of west and north elevations; view facing southeast.

Photo 2 date taken:
6/10/16



Resource ID: 18B **Name:** None **Year Built:** ca. 1960 **Source:** Field survey
Parcel ID: R000044000
Address: 229 CENTER POINT RD Weatherford Parker County Texas
Lat: 32.751377 **Long:** -97.729273
Type: Building **Style:** None **Form:** Rectangular
Historic Function/ Subcategory: Domestic/ Secondary Structure **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Domestic/ Secondary Structure **Contributing to District?** N/A



West elevation; view facing east.

Photo 1 date taken: 6/10/16

Description: This resource is a one-story, front gable garage and workshop located east of the primary residence. There is a shed roof addition on the south side of the building. The building is clad in several different types of wood siding, and has aluminum sash windows.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This is an utilitarian building with no distinctive characteristics. During the historic context development, no associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction. Also, it does not represent the work of a master or possess high artistic value. As such, it is recommended not eligible for inclusion in the NRHP.

Resource ID: 18B

Address: 229 CENTER POINT RD

Parcel ID: R000044000

Oblique of west and north elevations; view facing southeast.

Photo 2 date taken:
6/10/16



Resource ID: 18C **Name:** None **Year Built:** ca. 1960 **Source:** Field survey
Parcel ID: R000044000
Address: 229 CENTER POINT RD Weatherford Parker County Texas
Lat: 32.751162 **Long:** -97.729449
Type: Building **Style:** None **Form:** Rectangular
Historic Function/ Subcategory: Domestic/ Secondary Structure **Indiv. NRHP Eligible?** No **Effect:** N/A
Current Function/Subcategory: Domestic/ Secondary Structure **Contributing to District?** N/A



Oblique of west and north elevations; view facing southeast.

Photo 1 date taken: 6/10/16

Description: This resource is a small utilitarian building with a gable roof and clad in horizontal wood siding. Windows are boarded over and the primary entrance was not visible from the public right-of-way. The function and use of the building is not apparent.

Integrity: Location Design Setting Materials Workmanship Feeling Association

NRHP Justification: This is an utilitarian building with no distinctive characteristics. During the historic context development, no associations were identified linking it to persons or events of historic importance. Furthermore, the resource does not embody distinctive characteristics of a type, period, or method of construction. Also, it does not represent the work of a master or possess high artistic value. As such, it is recommended not eligible for inclusion in the NRHP.

Resource ID: 18C

Address: 229 CENTER POINT RD

Parcel ID: R000044000

West elevation; view facing east.

Photo 2 date taken:
6/10/16




Appendix C

Figures



Figure 1
 Project Location (Road Base)
IH 20 at Center Point Road

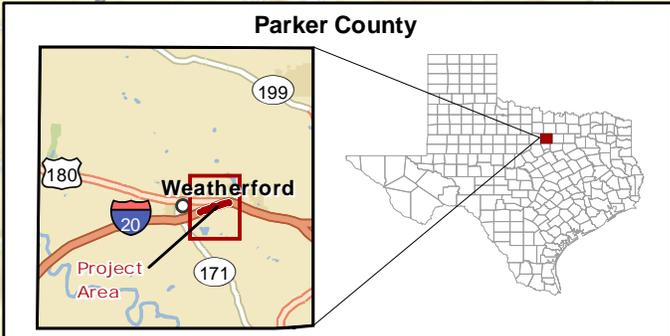

Parker County

Project Location


0 0.75 Miles
 0 1 Kilometers

Prepared for: TxDOT
 CSJ: 0314-07-051, 0314-07-052, 0314-07-046
 Scale: 1:47,520
 Date: 6/8/2016



Figure 2a
 Location of APE for Historic Resources
 IH 20 at Center Point Road

- | | | | | |
|-----------------------------|-----------------------------|----------------------------------|--------------|-----------------------|
| Existing Right-of-Way | Proposed Temporary Easement | National Bridge Inventory Bridge | Sheet Limits | 300-foot |
| Proposed Right-of-Way | Existing Easement | Cemetery | 150-foot | Existing Right-of-Way |
| Proposed Permanent Easement | Proposed New Pavement | Available Property Lines | APE | |

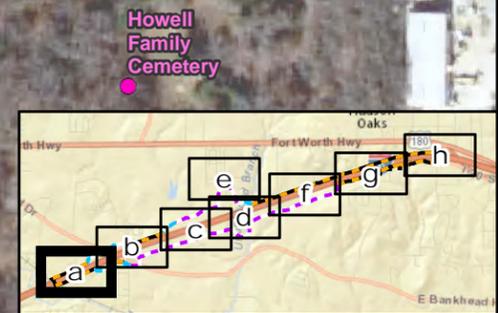

| | | |
|--------------------------------|----------------|----------------|
| | | 200 Feet |
| | | 60 Meters |
| Prepared for: TxDOT | Scale: 1:2,400 | Date: 6/9/2016 |
| CSJ: 0314-07-051, 0314-07-052, | | |
| 0314-07-046 | | |

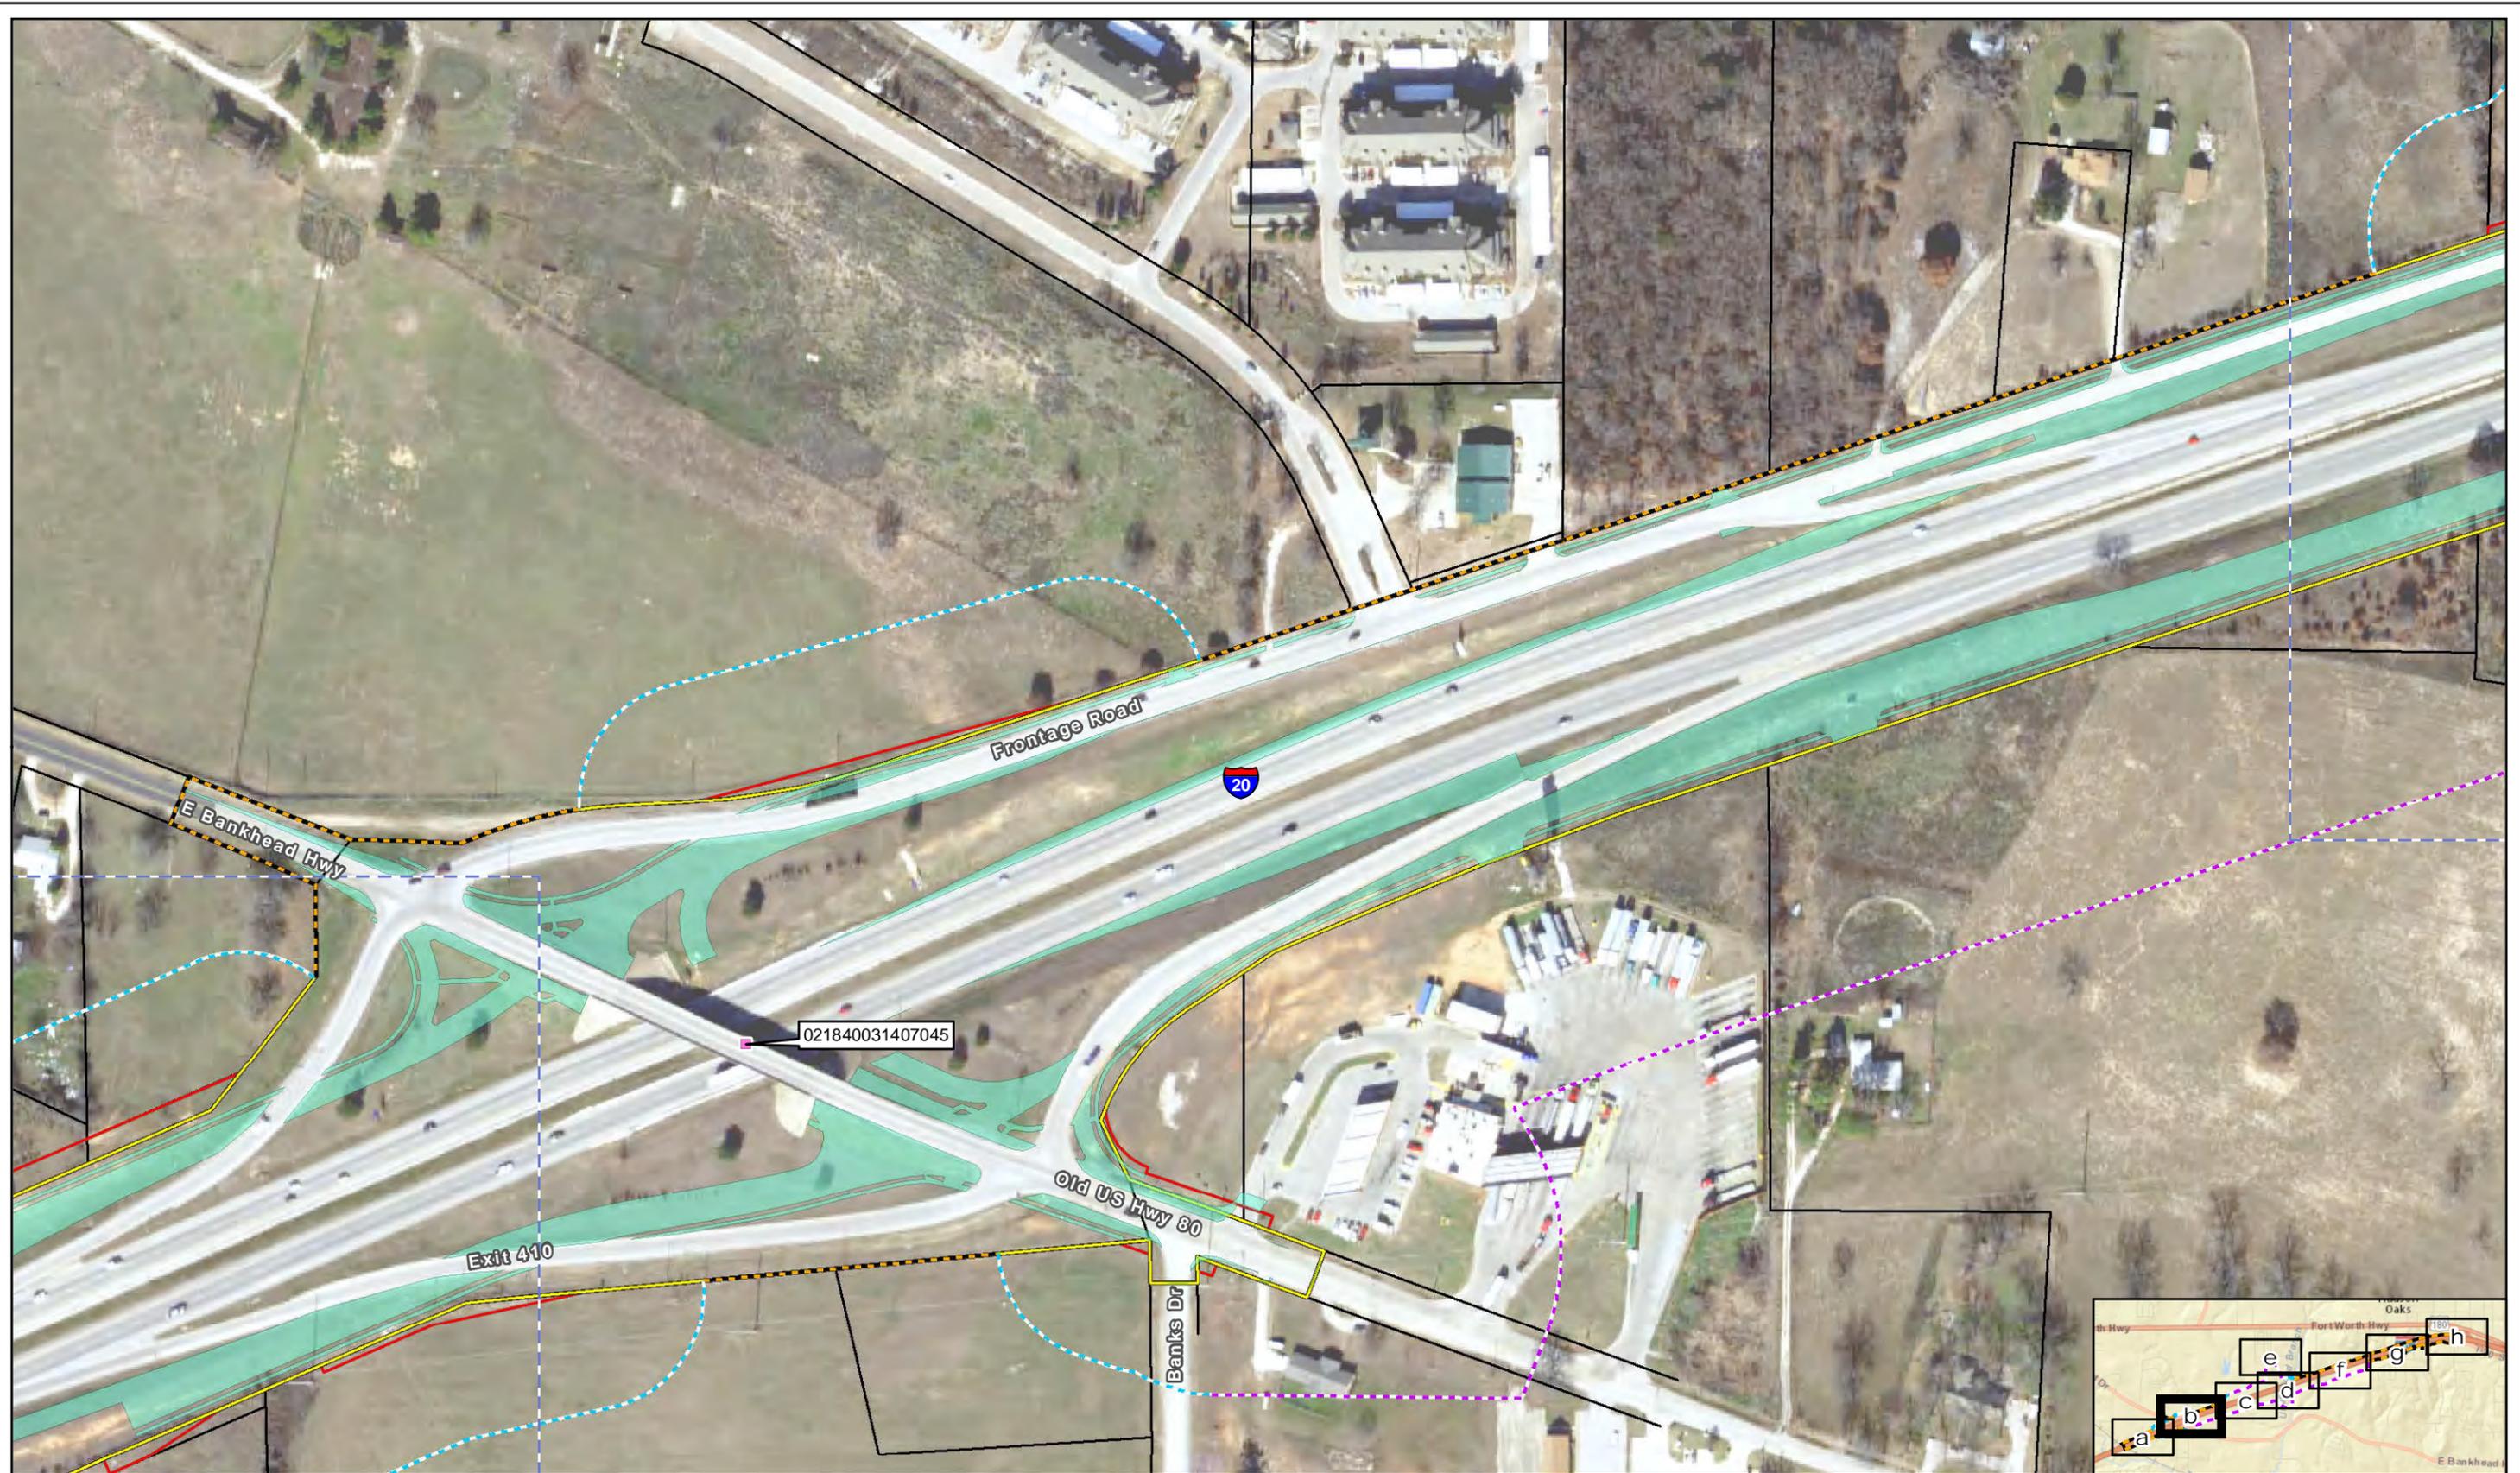


Figure 2b
 Location of APE for Historic Resources
 IH 20 at Center Point Road

- | | | | | |
|-----------------------------|-----------------------------|----------------------------------|--------------|-----------------------|
| Existing Right-of-Way | Proposed Temporary Easement | National Bridge Inventory Bridge | Sheet Limits | 300-foot |
| Proposed Right-of-Way | Existing Easement | Cemetery | APE | Existing Right-of-Way |
| Proposed Permanent Easement | Proposed New Pavement | Available Property Lines | 150-foot | |

| | |
|---|---|
| | |
| Data Sources: THC (2014), TxDOT (2015), FHWA (2016), Freese and Nichols (2016), Aerial Source: TNRIS (2015) | Prepared for: TxDOT CSJ: 0314-07-051, 0314-07-052, 0314-07-046 Date: 6/9/2016 |
| 1 in = 200 feet Scale: 1:2,400 | Date: 6/9/2016 |


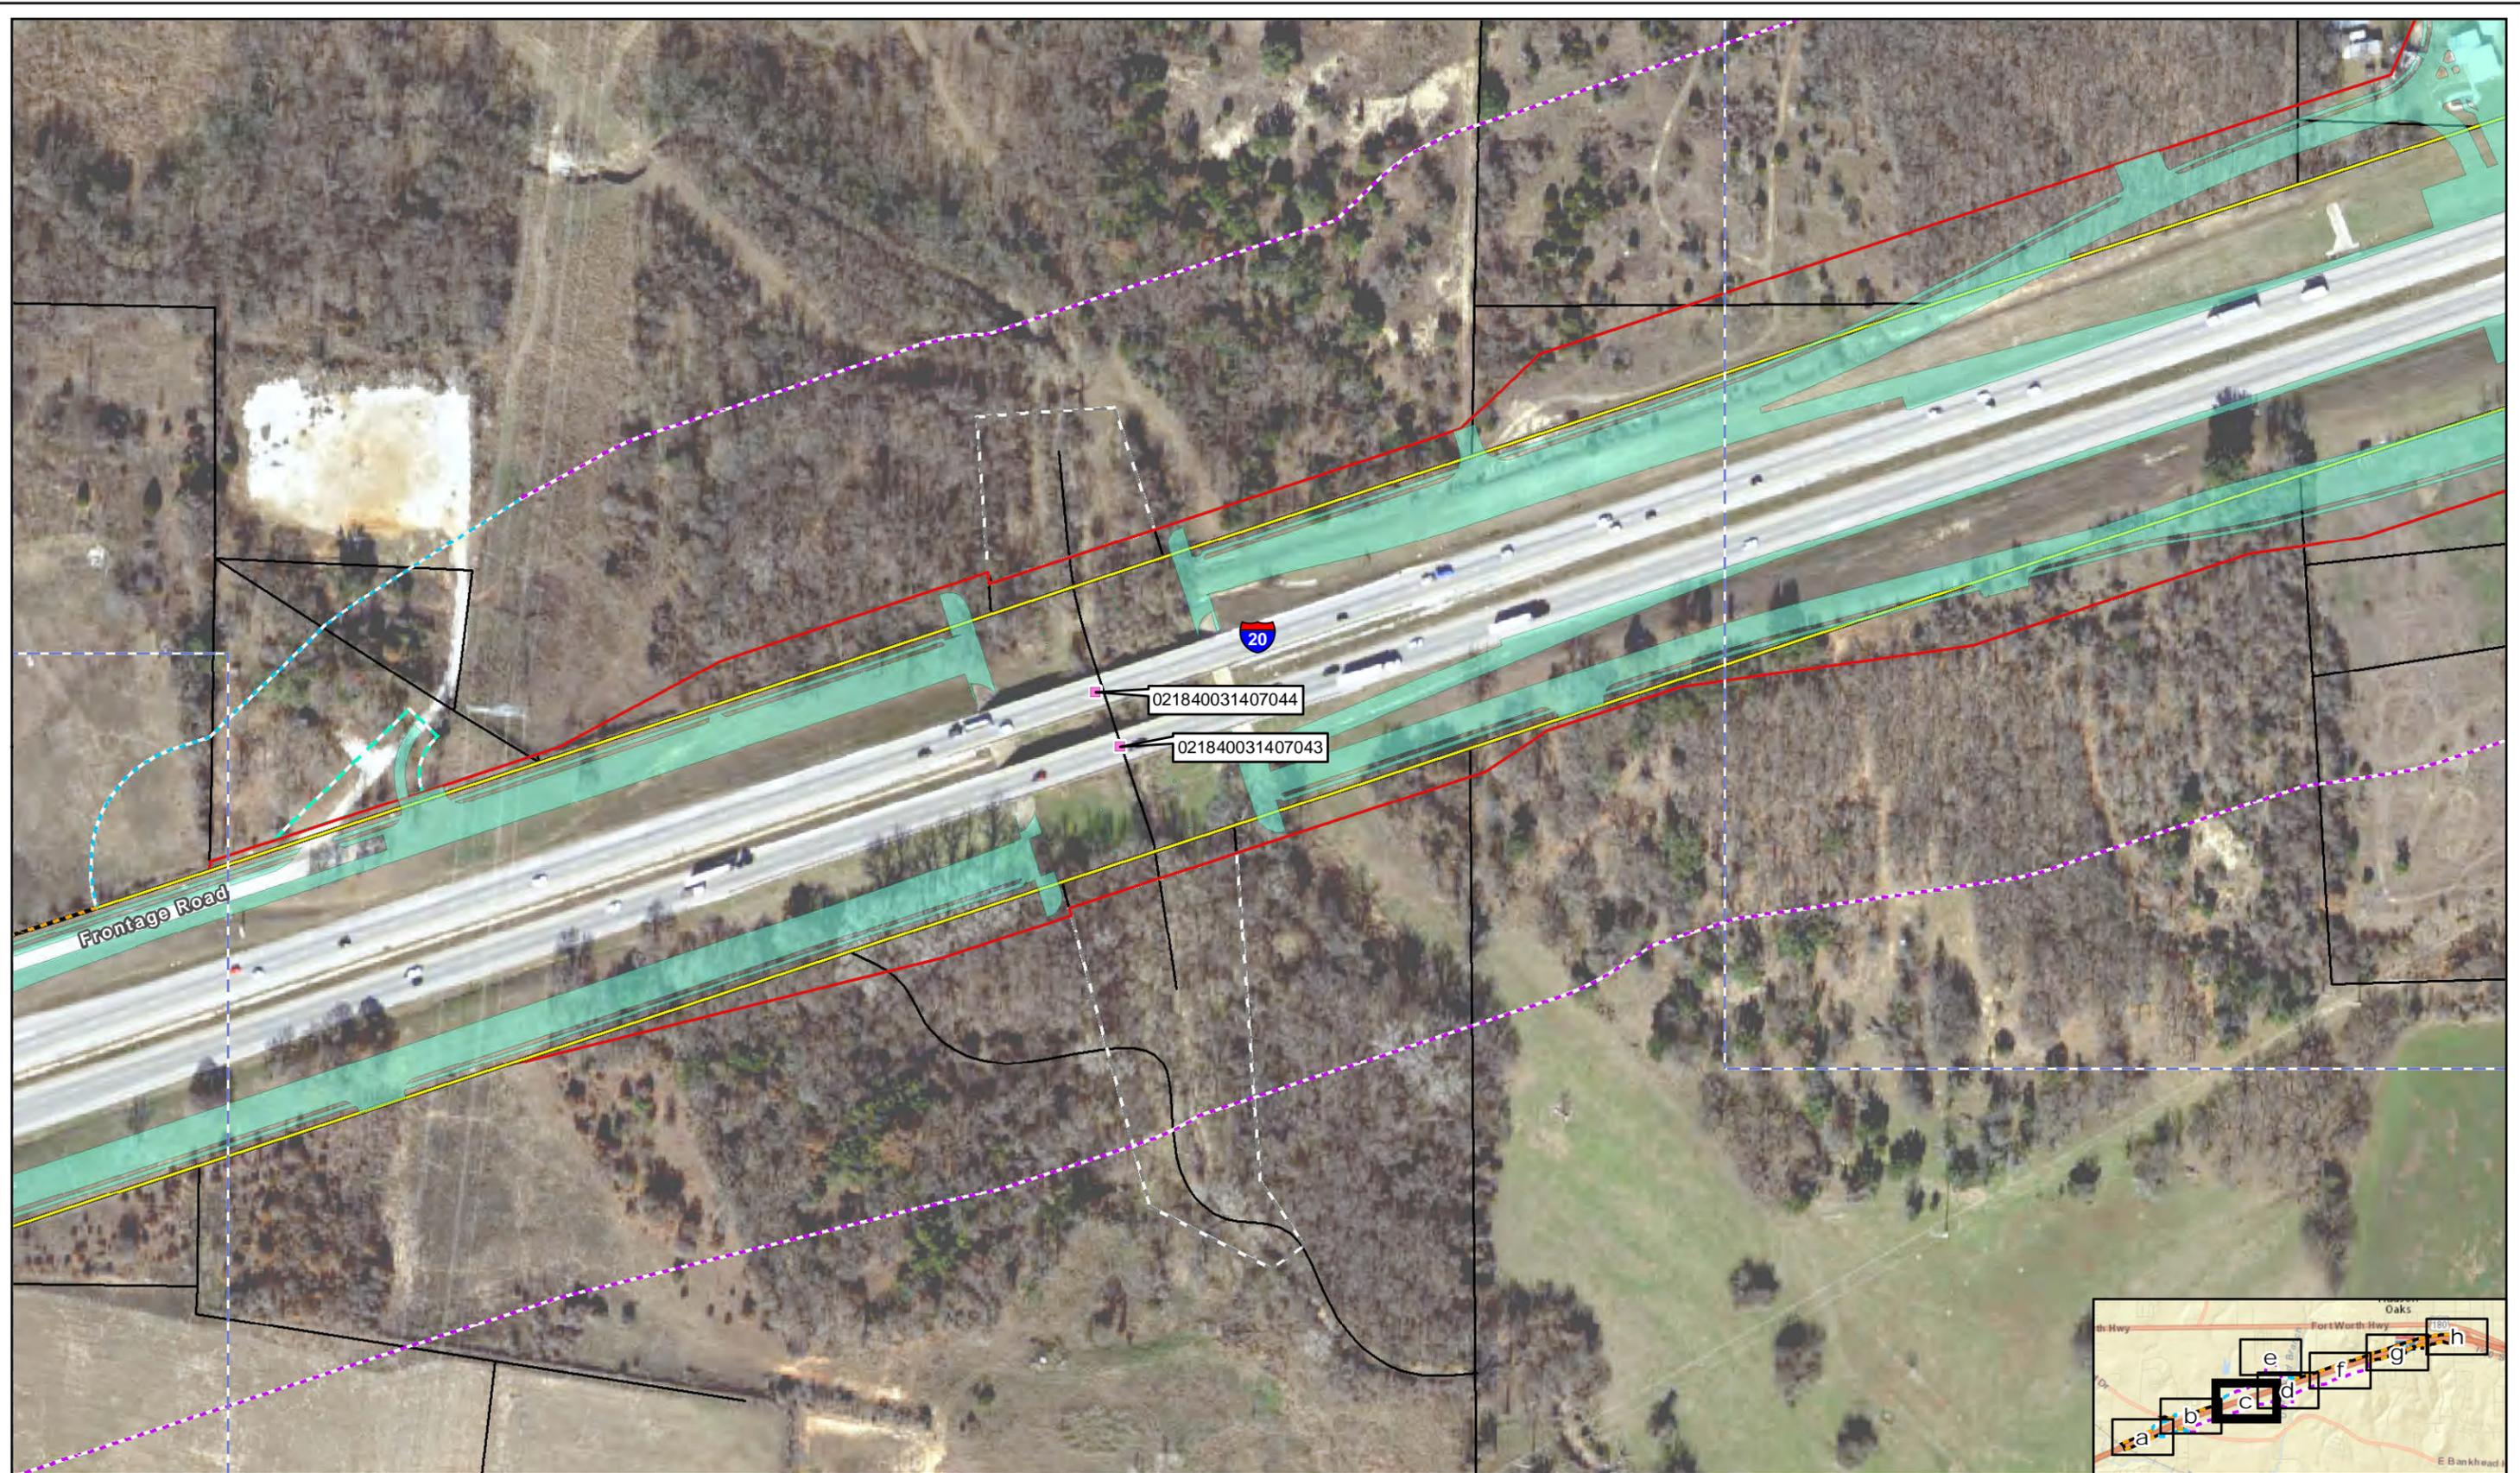


Figure 2c
 Location of APE for Historic Resources
 IH 20 at Center Point Road

- | | | | | |
|-----------------------------|-----------------------------|----------------------------------|--------------|-----------------------|
| Existing Right-of-Way | Proposed Temporary Easement | National Bridge Inventory Bridge | Sheet Limits | 300-foot |
| Proposed Right-of-Way | Existing Easement | Cemetery | APE | Existing Right-of-Way |
| Proposed Permanent Easement | Proposed New Pavement | Available Property Lines | 150-foot | |

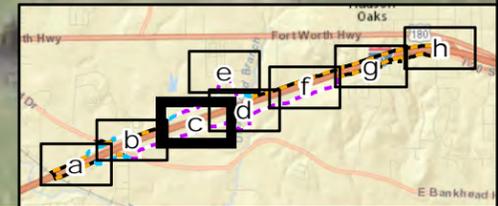

| | | |
|---|--|---------------------|
| | | 200 Feet |
| | | 60 Meters |
| Data Sources: THC (2014), TxDOT (2015), FHWA (2016), Freese and Nichols (2016), Aerial Source: TNRIS (2015) | | Prepared for: TxDOT |
| CSJ: 0314-07-051, 0314-07-052, 0314-07-046 | | 1 in = 200 feet |
| | | Scale: 1:2,400 |
| | | Date: 6/9/2016 |


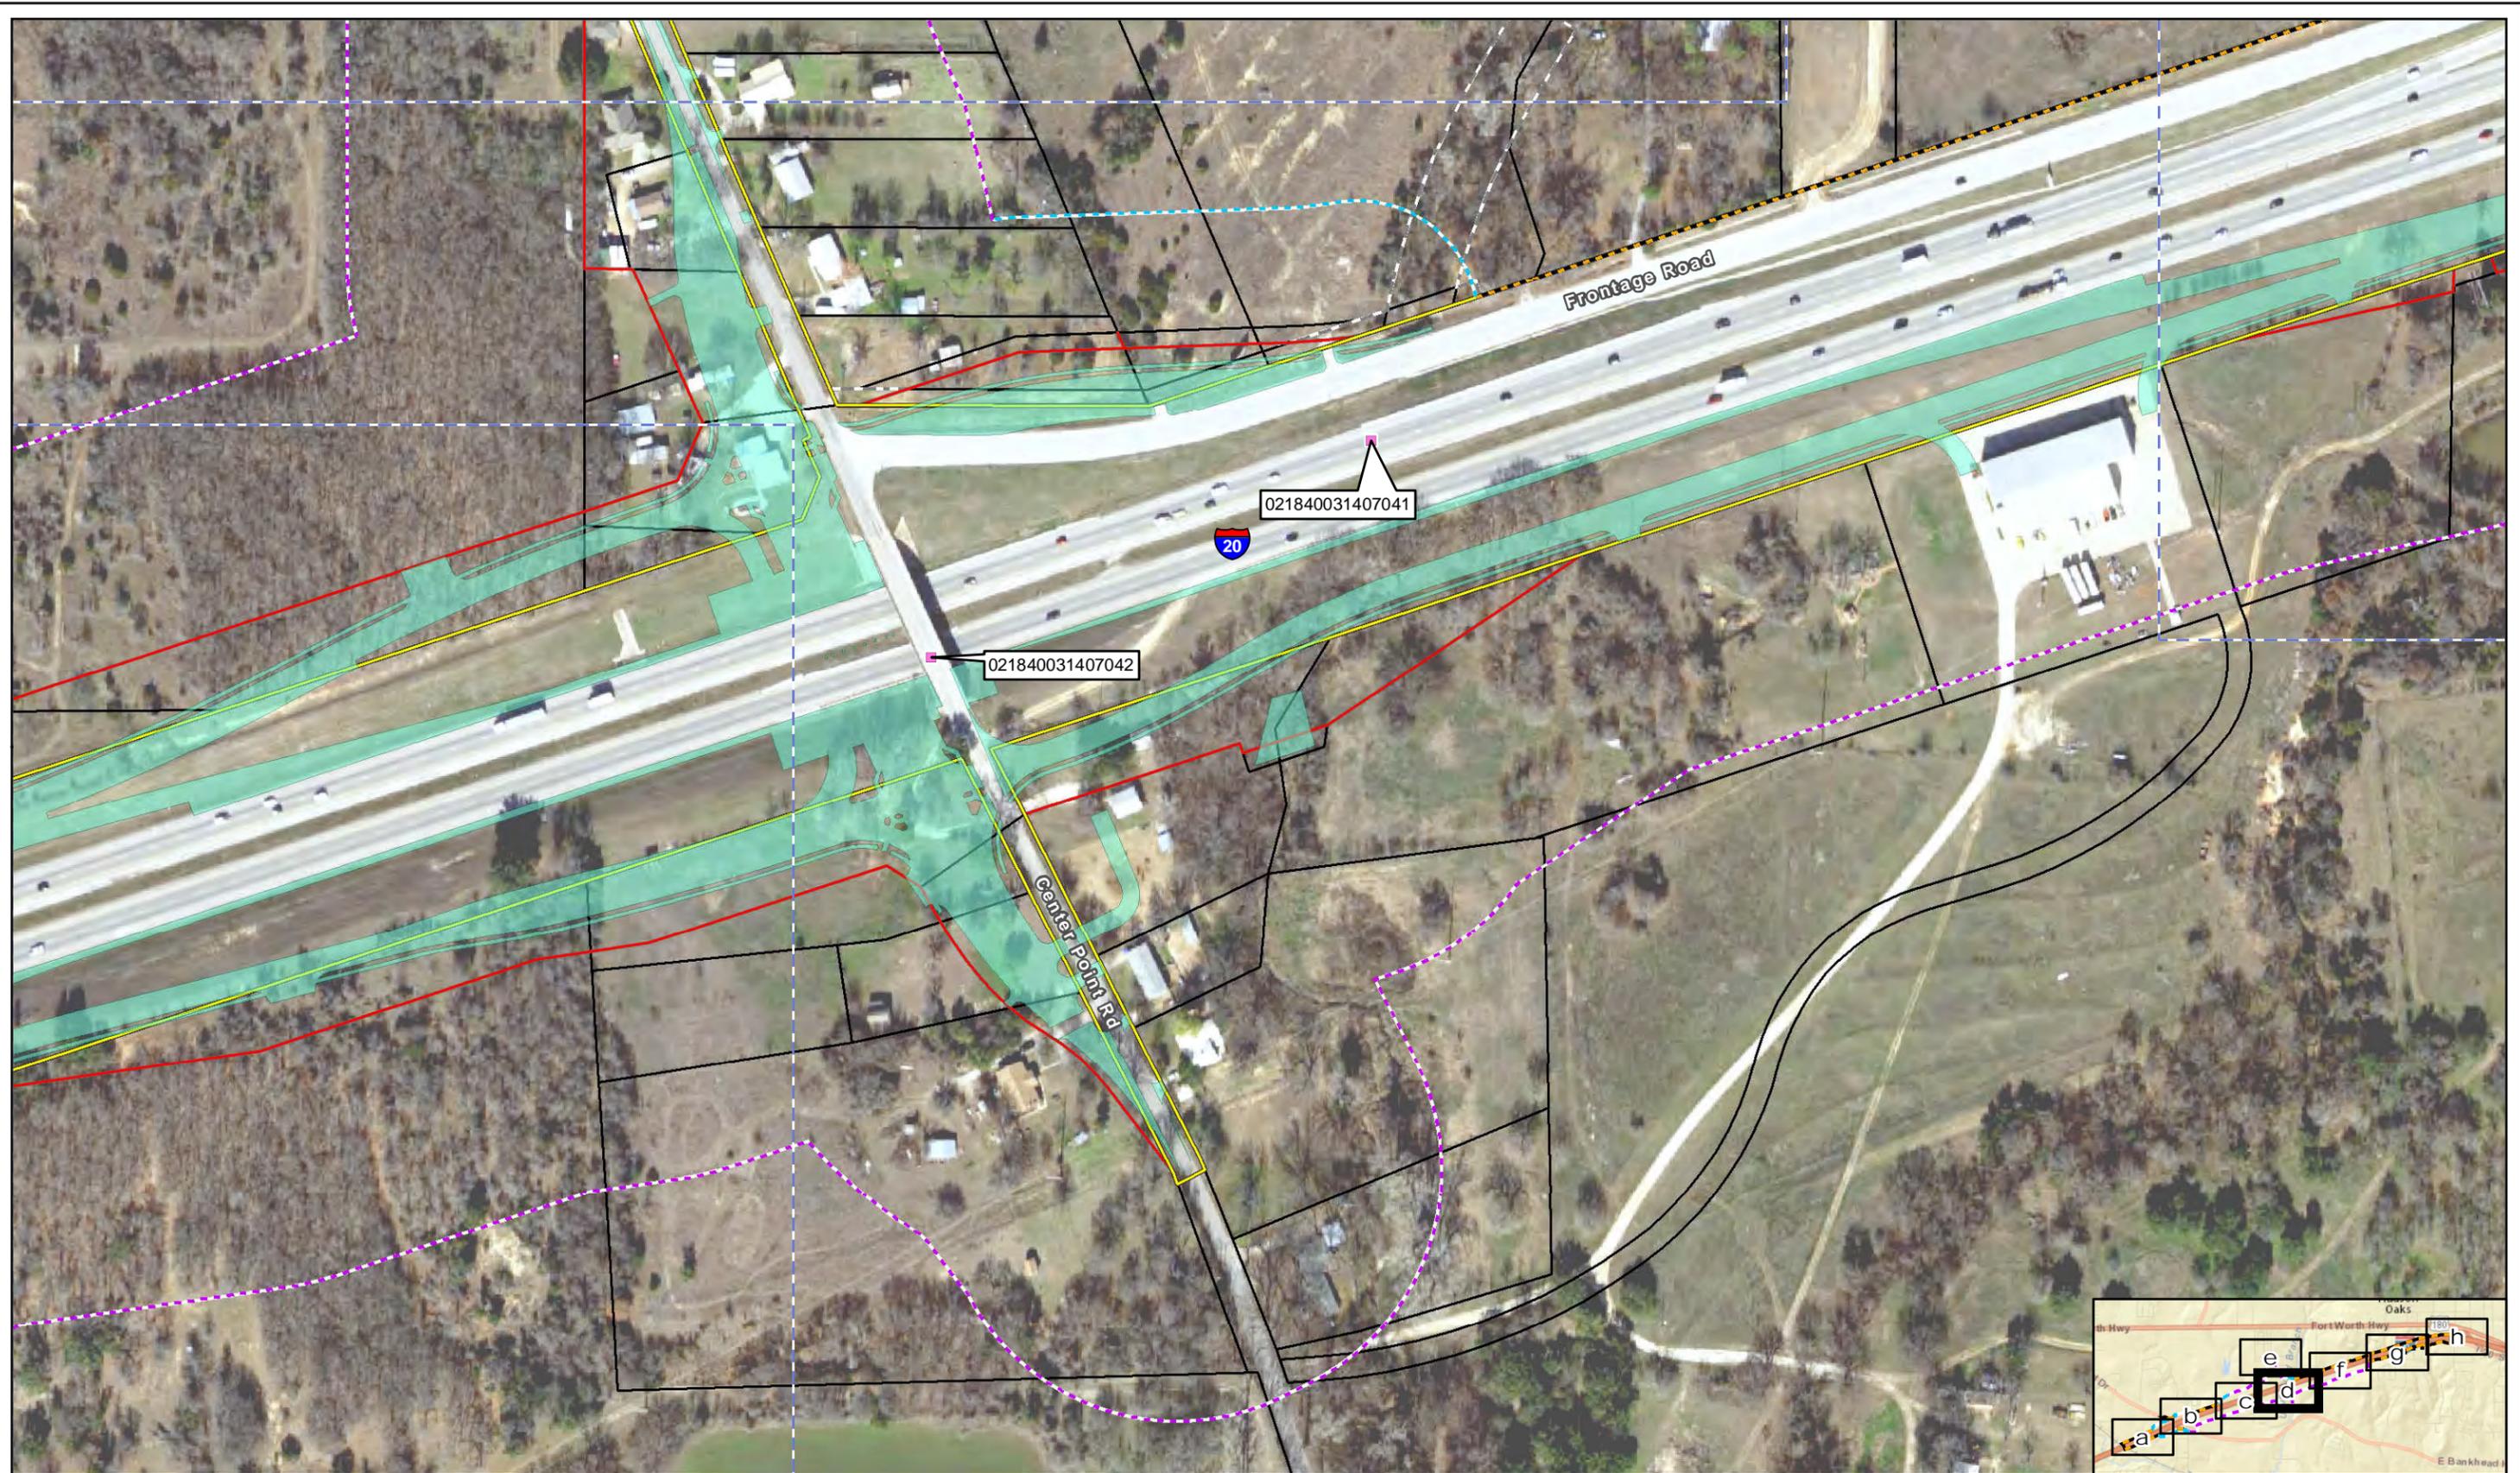


Figure 2d
Location of APE for Historic Resources
IH 20 at Center Point Road

- | | | | | |
|-----------------------------|-----------------------------|----------------------------------|--------------|-----------------------|
| Existing Right-of-Way | Proposed Temporary Easement | National Bridge Inventory Bridge | Sheet Limits | 300-foot |
| Proposed Right-of-Way | Existing Easement | Cemetery | APE | Existing Right-of-Way |
| Proposed Permanent Easement | Proposed New Pavement | Available Property Lines | 150-foot | |

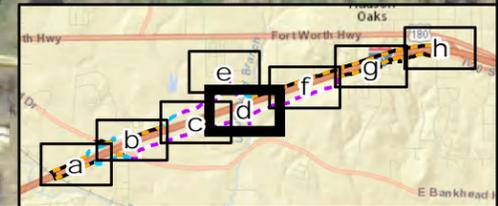

| | | |
|--------------------------------|------------------------|----------------|
| | | 200 Feet |
| | | 60 Meters |
| Prepared for: TxDOT | Scale: 1 in = 200 feet | Date: 6/9/2016 |
| CSJ: 0314-07-051, 0314-07-052, | | |
| 0314-07-046 | | |


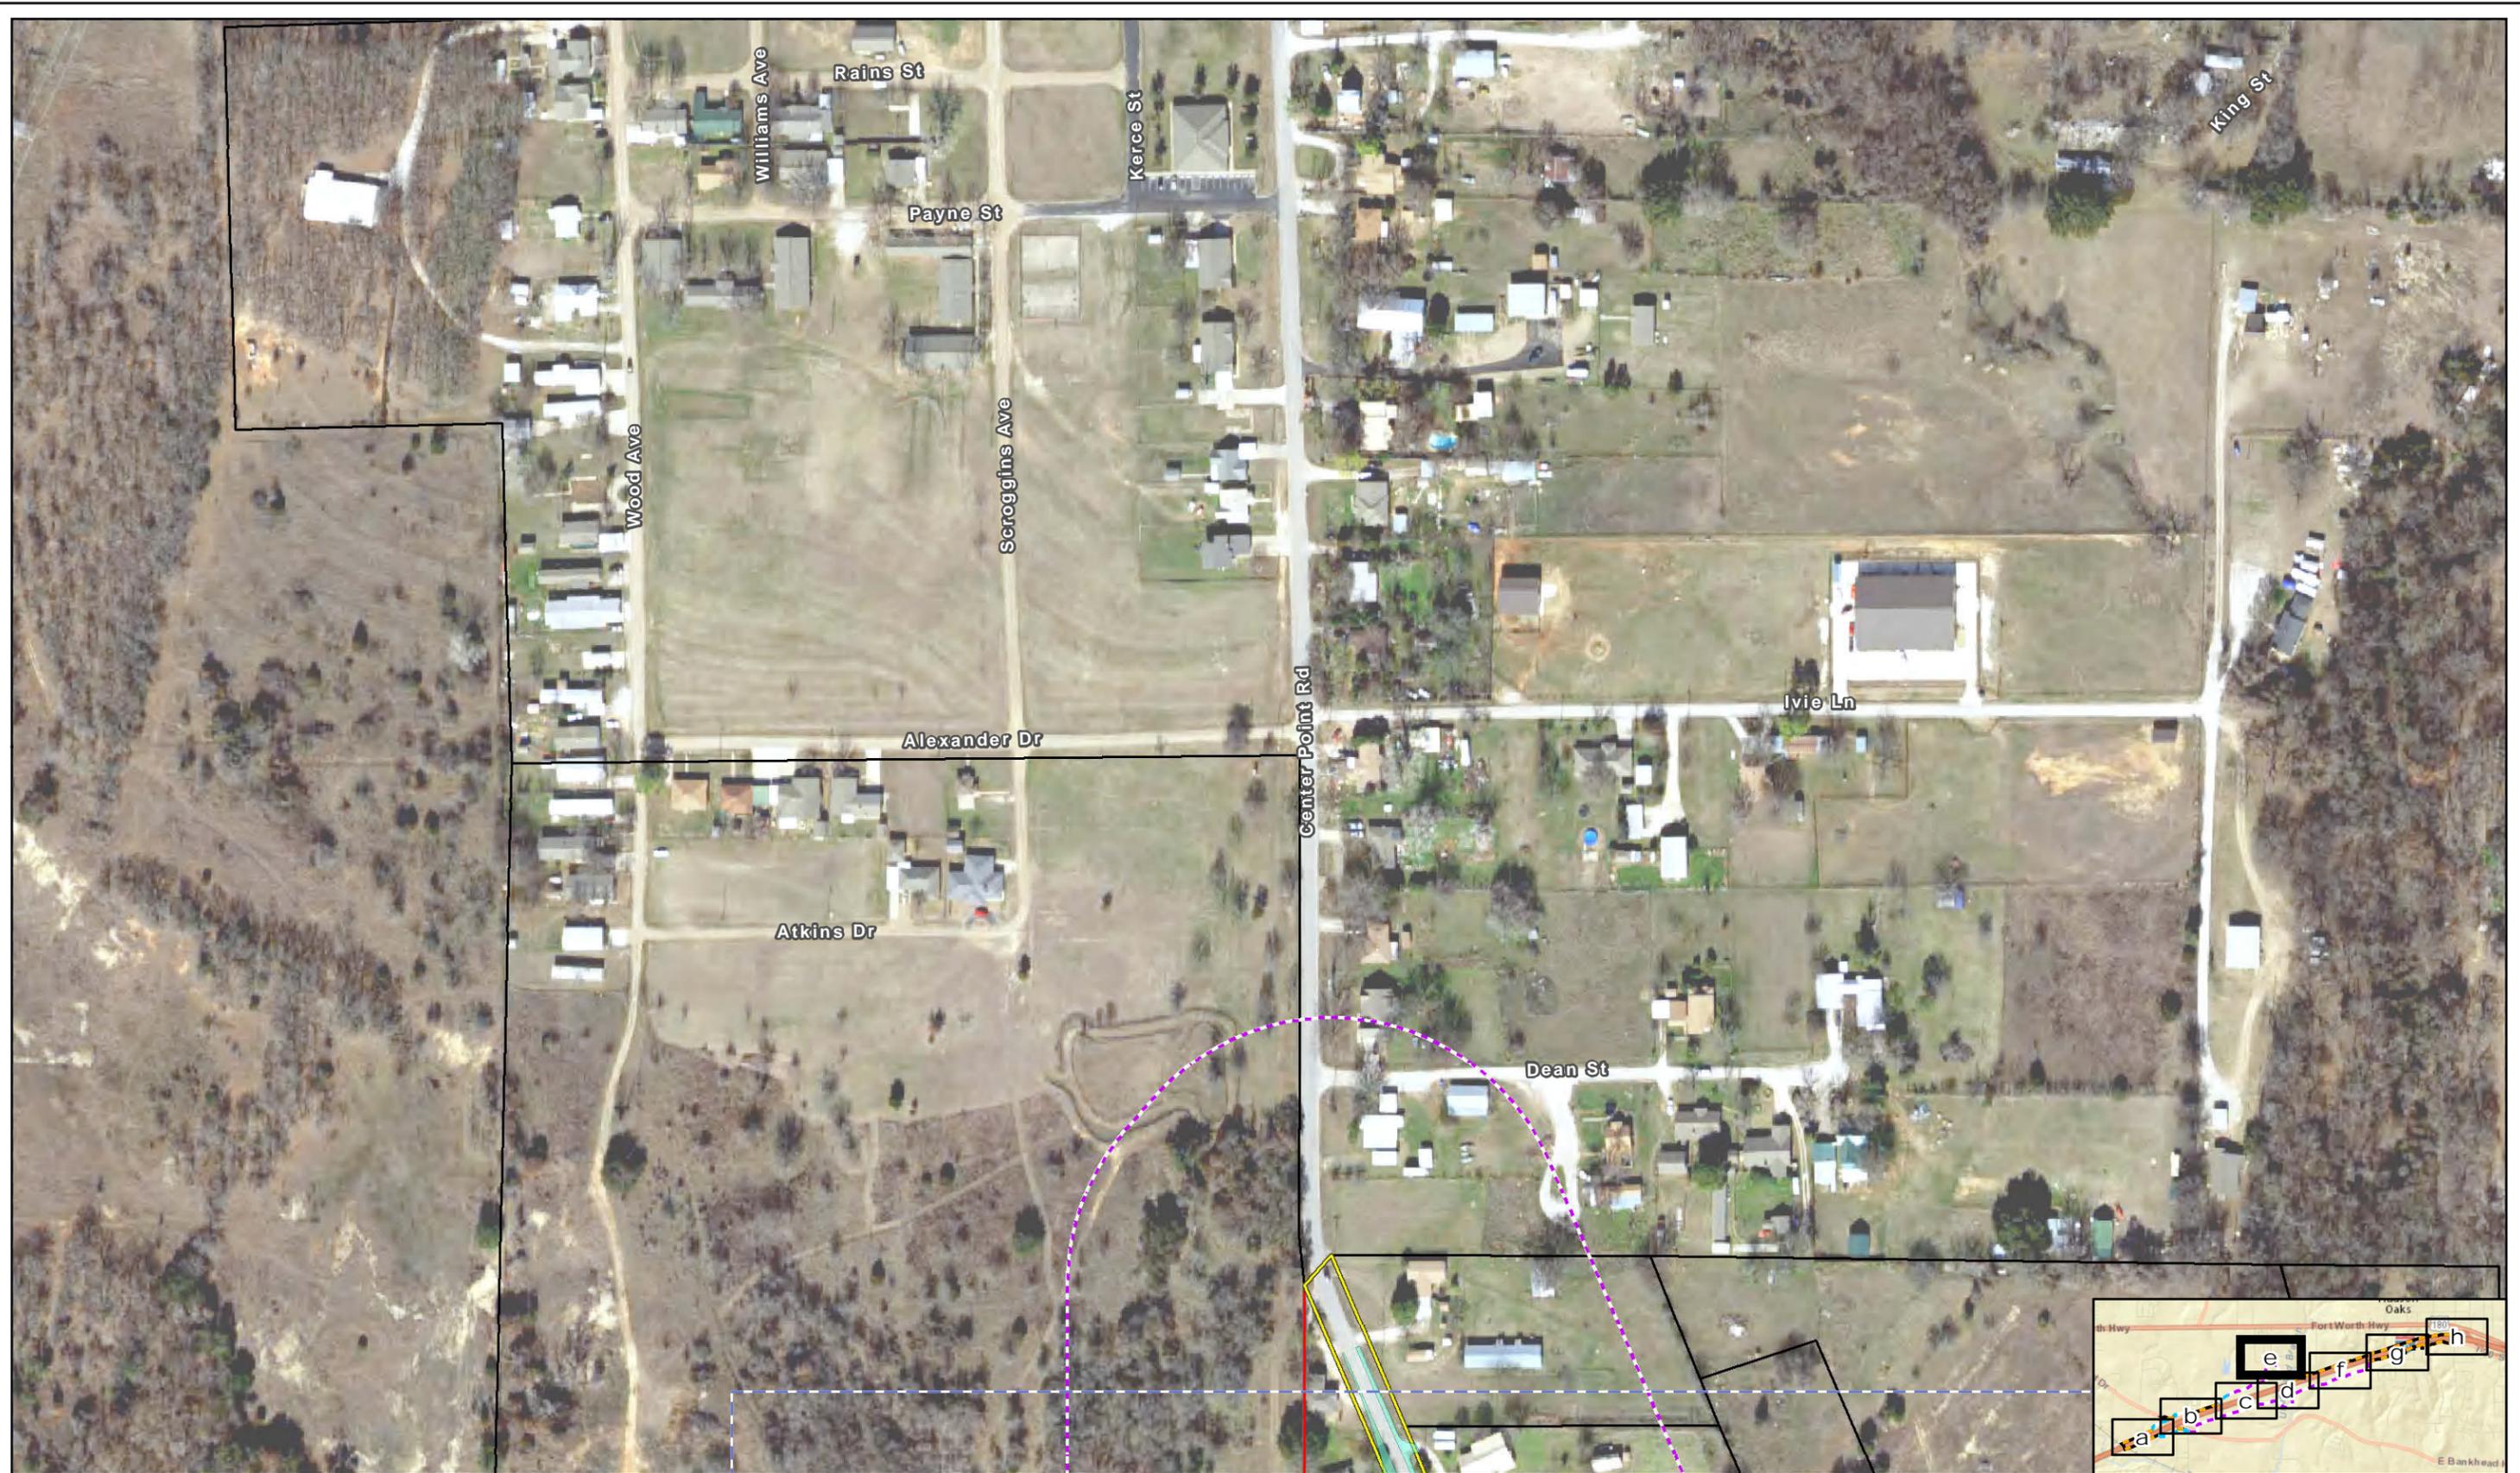


Figure 2e
Location of APE for Historic Resources
IH 20 at Center Point Road

- Existing Right-of-Way
- Proposed Right-of-Way
- Proposed Permanent Easement
- Proposed Temporary Easement
- Existing Easement
- Proposed New Pavement
- National Bridge Inventory Bridge
- Cemetery
- Available Property Lines
- Sheet Limits
- APE
- 150-foot
- 300-foot
- Existing Right-of-Way

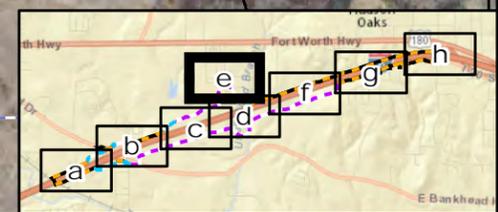


| | | |
|--------------------------------|-----------------|-----------|
| | 0 | 200 Feet |
| | 0 | 60 Meters |
| Prepared for: TxDOT | 1 in = 200 feet | |
| CSJ: 0314-07-051, 0314-07-052, | Scale: 1:2,400 | |
| 0314-07-046 | Date: 6/9/2016 | |

Data Sources: THC (2014), TxDOT (2015),
FHWA (2016), Freese and Nichols (2016)
Aerial Source: TNRIS (2015)



Figure 2f
 Location of APE for Historic Resources
 IH 20 at Center Point Road

- | | | | | |
|-----------------------------|-----------------------------|----------------------------------|--------------|-----------------------|
| Existing Right-of-Way | Proposed Temporary Easement | National Bridge Inventory Bridge | Sheet Limits | 300-foot |
| Proposed Right-of-Way | Existing Easement | Cemetery | APE | Existing Right-of-Way |
| Proposed Permanent Easement | Proposed New Pavement | Available Property Lines | 150-foot | |

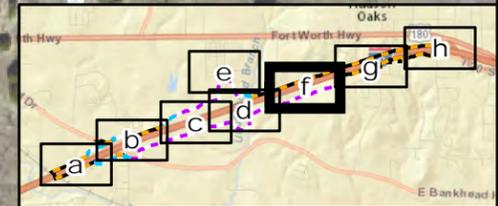

| | | | |
|--|--|---|----------------------------------|
| | | Prepared for: TxDOT | 1 in = 200 feet |
| | | CSJ: 0314-07-051, 0314-07-052, 0314-07-046 | Scale: 1:2,400 Date: 6/9/2016 |



Figure 2g
Location of APE for Historic Resources
IH 20 at Center Point Road

- | | | | | |
|-----------------------------|-----------------------------|----------------------------------|--------------|-----------------------|
| Existing Right-of-Way | Proposed Temporary Easement | National Bridge Inventory Bridge | Sheet Limits | 300-foot |
| Proposed Right-of-Way | Existing Easement | Cemetery | APE | Existing Right-of-Way |
| Proposed Permanent Easement | Proposed New Pavement | Available Property Lines | 150-foot | |

Data Sources: THC (2014), TxDOT (2015), FHWA (2016), Freese and Nichols (2016), Aerial Source: TNRIS (2015)

Prepared for: TxDOT
CSJ: 0314-07-051, 0314-07-052, 0314-07-046

1 in = 200 feet
Scale: 1:2,400
Date: 6/9/2016

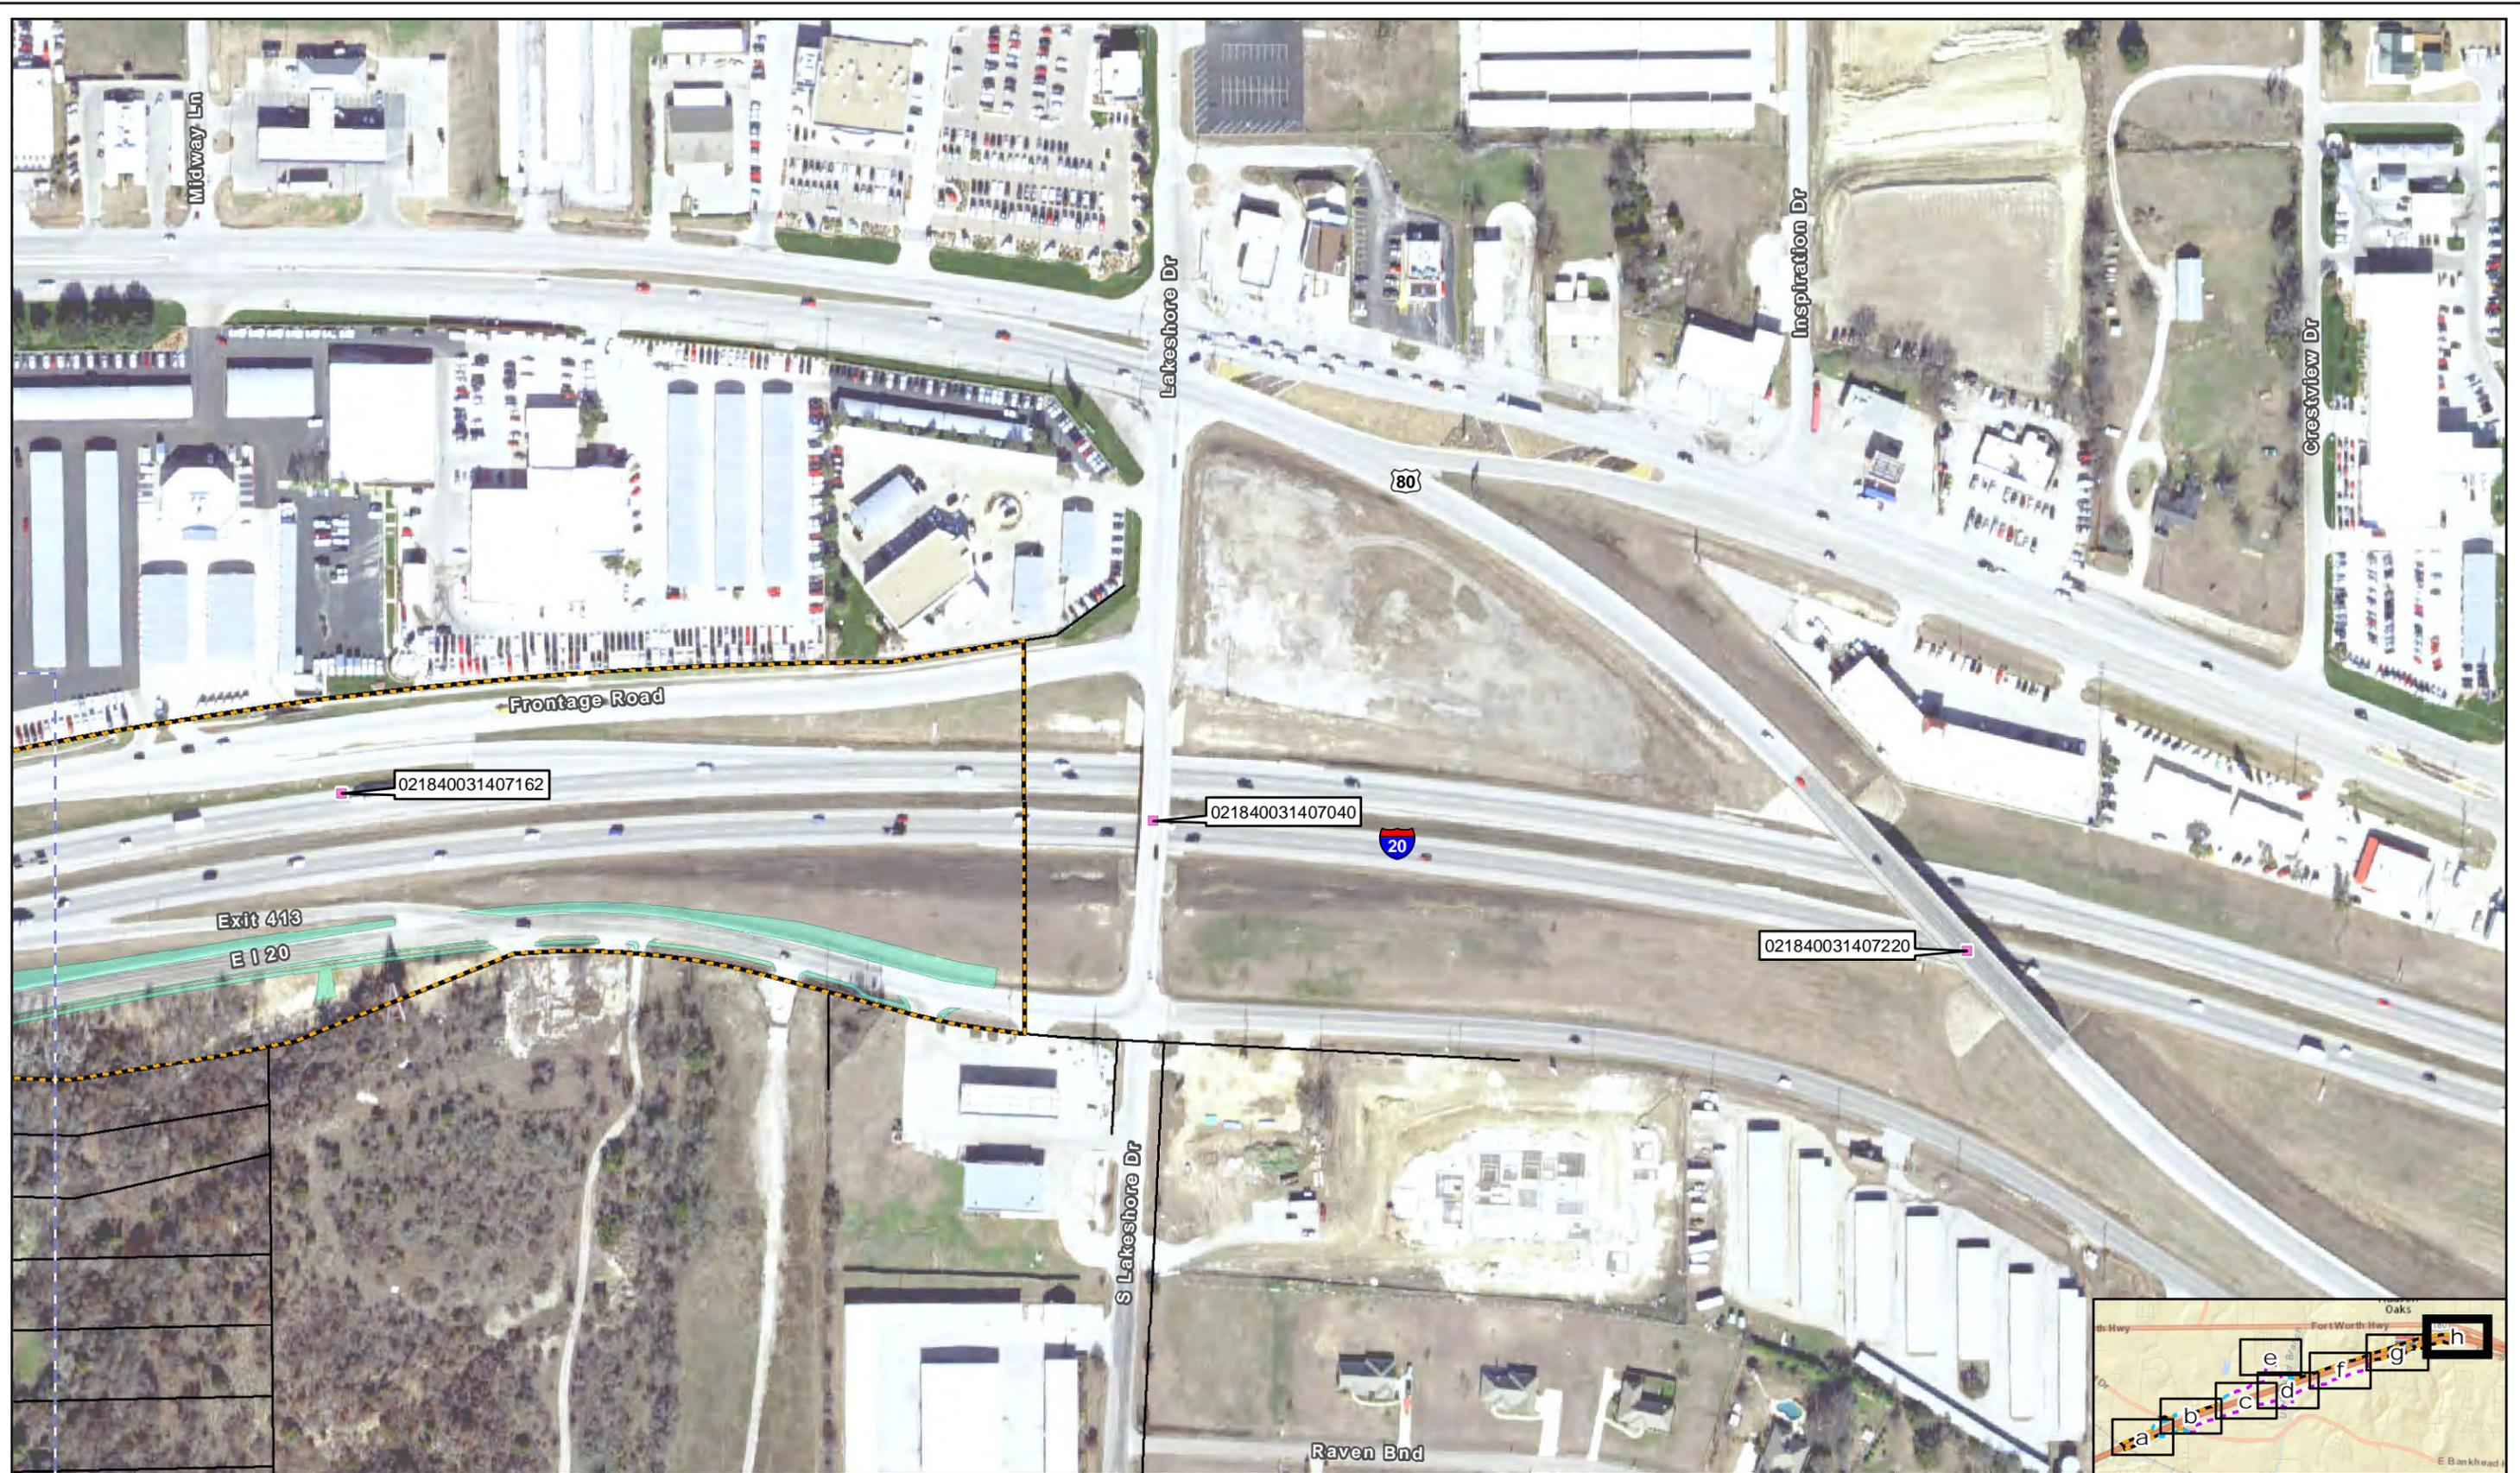


Figure 2h
 Location of APE for Historic Resources
 IH 20 at Center Point Road

- | | | | | |
|-----------------------------|-----------------------------|----------------------------------|--------------|-----------------------|
| Existing Right-of-Way | Proposed Temporary Easement | National Bridge Inventory Bridge | Sheet Limits | 300-foot |
| Proposed Right-of-Way | Existing Easement | Cemetery | APE | Existing Right-of-Way |
| Proposed Permanent Easement | Proposed New Pavement | Available Property Lines | 150-foot | |

Data Sources: THC (2014), TxDOT (2015), FHWA (2016), Freese and Nichols (2016), Aerial Source: TNRIS (2015)


Prepared for: TxDOT
 CSJ: 0314-07-051, 0314-07-052, 0314-07-046

1 in = 200 feet
 Scale: 1:2,400
 Date: 6/9/2016



Historic Resources
 Location Map
 Sheet 1 of 11

- | | | | |
|-----------------------------|-----------------------------|--------------------------|-----------------------|
| Existing Right-of-Way | Proposed Temporary Easement | Available Property Lines | 300-foot |
| Proposed Right-of-Way | Existing Easement | Historic-Age Resource | 150-foot |
| Proposed Permanent Easement | Proposed New Pavement | Sheet Limits | Existing Right-of-Way |

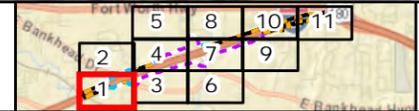


| | | |
|---|--|--|
| Data Sources: CMEC (2016), Freese and Nichols (2016) Aerial Source: TNRRIS (2015) | Prepared for: TxDOT CSJ: 0314-07-051, 0314-07-052, 0314-07-046 | 1 in = 250 feet Scale: 1:3,000 Date: 6/15/2016 |
| | 0 250 Feet 0 60 Meters | |



Historic Resources
 Location Map
 Sheet 2 of 11

- Existing Right-of-Way
- Proposed Right-of-Way
- Proposed Permanent Easement
- Proposed Temporary Easement
- Existing Easement
- Proposed New Pavement
- Available Property Lines
- Historic-Age Resource
- Sheet Limits
- APE**
- 300-foot
- 150-foot
- Existing Right-of-Way

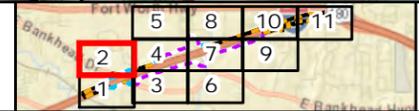

Data Sources: CMEC (2016),
 Freese and Nichols (2016)
 Aerial Source: TNRIS (2015)


Prepared for: TxDOT
 CSJ: 0314-07-051, 0314-07-052,
 0314-07-046

1 in = 250 feet
 Scale: 1:3,000
 Date: 6/15/2016



Historic Resources
 Location Map
 Sheet 3 of 11


- Existing Right-of-Way
- Proposed Right-of-Way
- Proposed Permanent Easement
- Proposed Temporary Easement
- Existing Easement
- Proposed New Pavement
- Available Property Lines
- Historic-Age Resource
- Sheet Limits
- 300-foot APE
- 150-foot APE
- Existing Right-of-Way

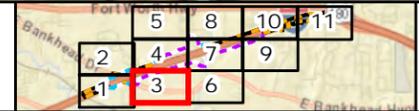

Data Sources: CMEC (2016),
 Freese and Nichols (2016)
 Aerial Source: TNRRIS (2015)


Prepared for: TxDOT
 CSJ: 0314-07-051, 0314-07-052,
 0314-07-046

1 in = 250 feet
 Scale: 1:3,000
 Date: 6/15/2016

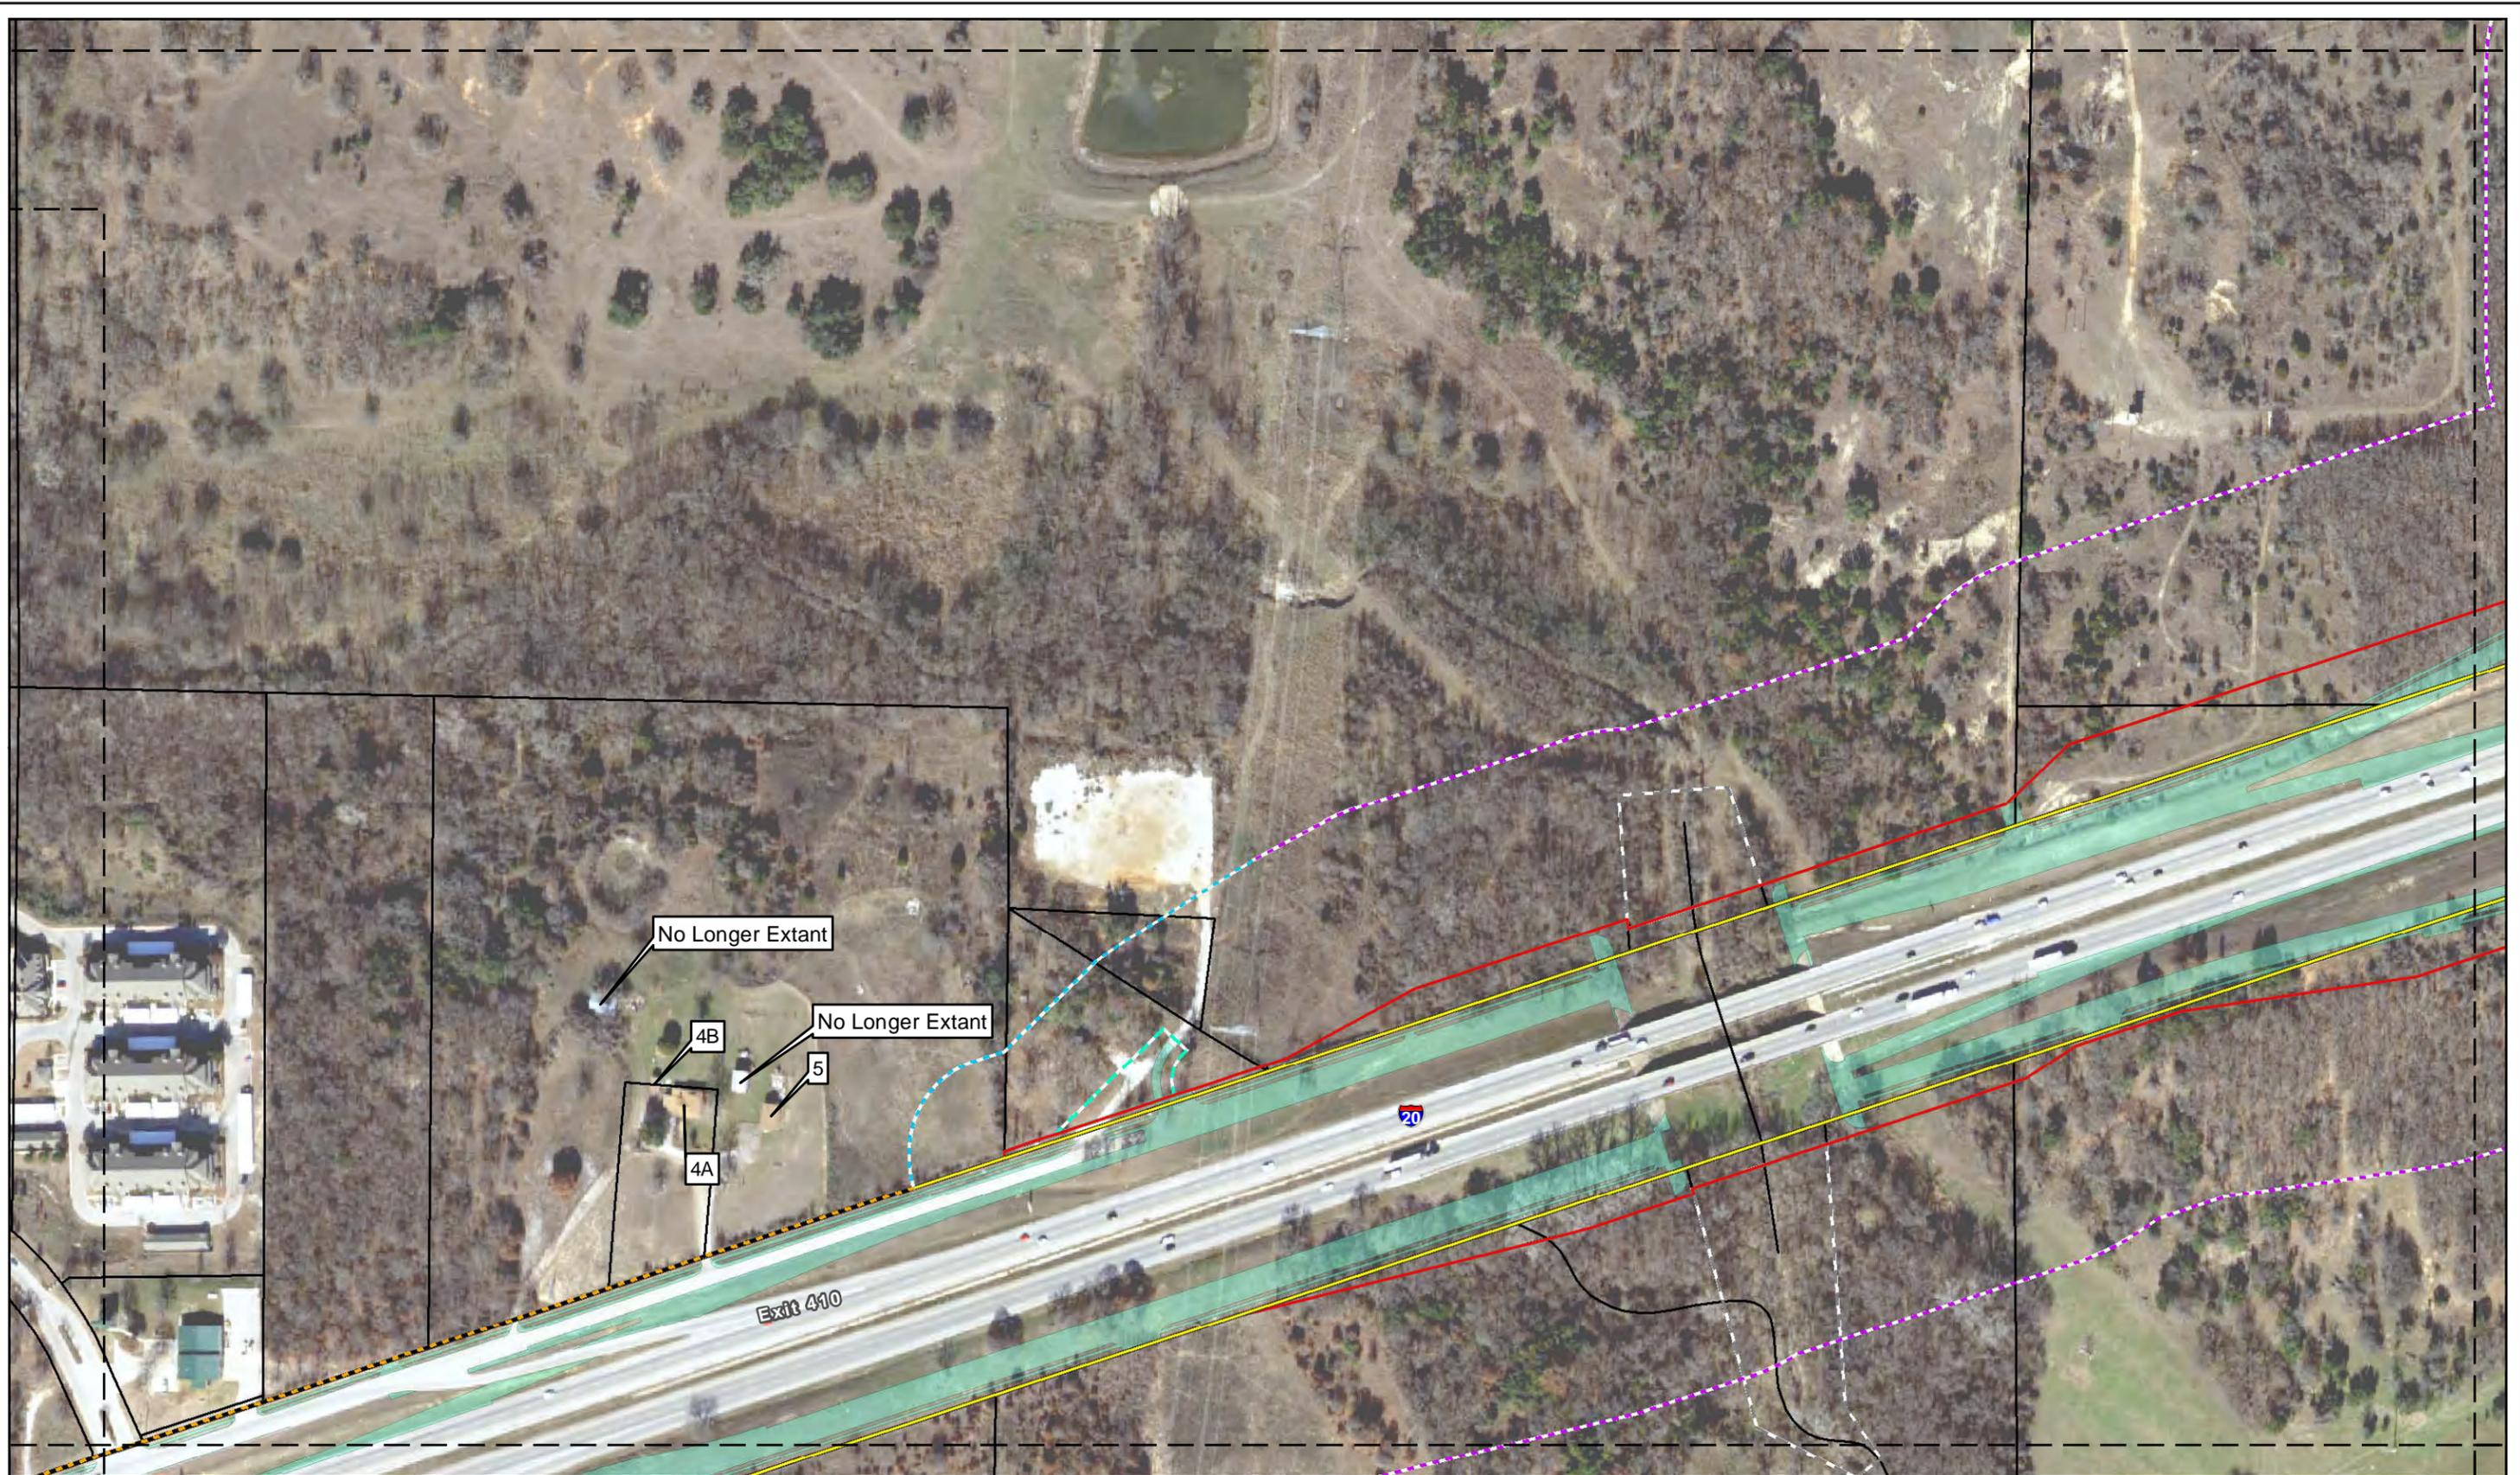

Historic Resources
 Location Map
 Sheet 4 of 11

- Existing Right-of-Way
- Proposed Right-of-Way
- Proposed Permanent Easement
- Proposed Temporary Easement
- Existing Easement
- Proposed New Pavement
- Available Property Lines
- Historic-Age Resource
- Sheet Limits
- APE
- 300-foot
- 150-foot
- Existing Right-of-Way

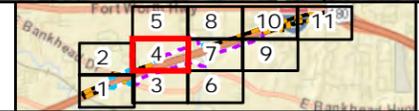


| | | |
|---|--|---|
| Data Sources: CMEC (2016), Freese and Nichols (2016) Aerial Source: TNRRIS (2015) | Prepared for: TxDOT CSJ: 0314-07-051, 0314-07-052, 0314-07-046 | 0 250 Feet 0 80 Meters 1 in = 250 feet Scale: 1:3,000 Date: 6/15/2016 |
|---|--|---|

G:\Projects\FreeseNichols\Centerpoint_Rd\Historic Resources_tabloid_20160613.mxd



Historic Resources
 Location Map
 Sheet 5 of 11

- | | | | |
|-----------------------------|-----------------------------|--------------------------|-----------------------|
| Existing Right-of-Way | Proposed Temporary Easement | Available Property Lines | APE 300-foot |
| Proposed Right-of-Way | Existing Easement | Historic-Age Resource | 150-foot |
| Proposed Permanent Easement | Proposed New Pavement | Sheet Limits | Existing Right-of-Way |

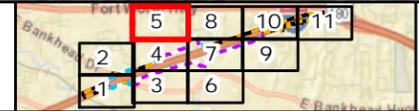


| | | |
|--|--|--|
| Data Sources: CMEC (2016), Freese and Nichols (2016) Aerial Source: TNRIS (2015) | Prepared for: TxDOT CSJ: 0314-07-051, 0314-07-052, 0314-07-046 | 1 in = 250 feet Scale: 1:3,000 Date: 6/15/2016 |
| | 0 250 Feet 0 60 Meters | |




Historic Resources
 Location Map
 Sheet 6 of 11

| | | | |
|-----------------------------|-----------------------------|--------------------------|-----------------------|
| Existing Right-of-Way | Proposed Temporary Easement | Available Property Lines | 300-foot APE |
| Proposed Right-of-Way | Existing Easement | Historic-Age Resource | 150-foot |
| Proposed Permanent Easement | Proposed New Pavement | Sheet Limits | Existing Right-of-Way |

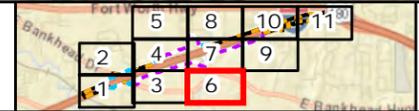

| | | |
|--|--|--|
| Data Sources: CMEC (2016), Freese and Nichols (2016), Aerial Source: TNRRIS (2015) | Prepared for: TxDOT CSJ: 0314-07-051, 0314-07-052, 0314-07-046 | 1 in = 250 feet Scale: 1:3,000 Date: 6/15/2016 |
| | | |

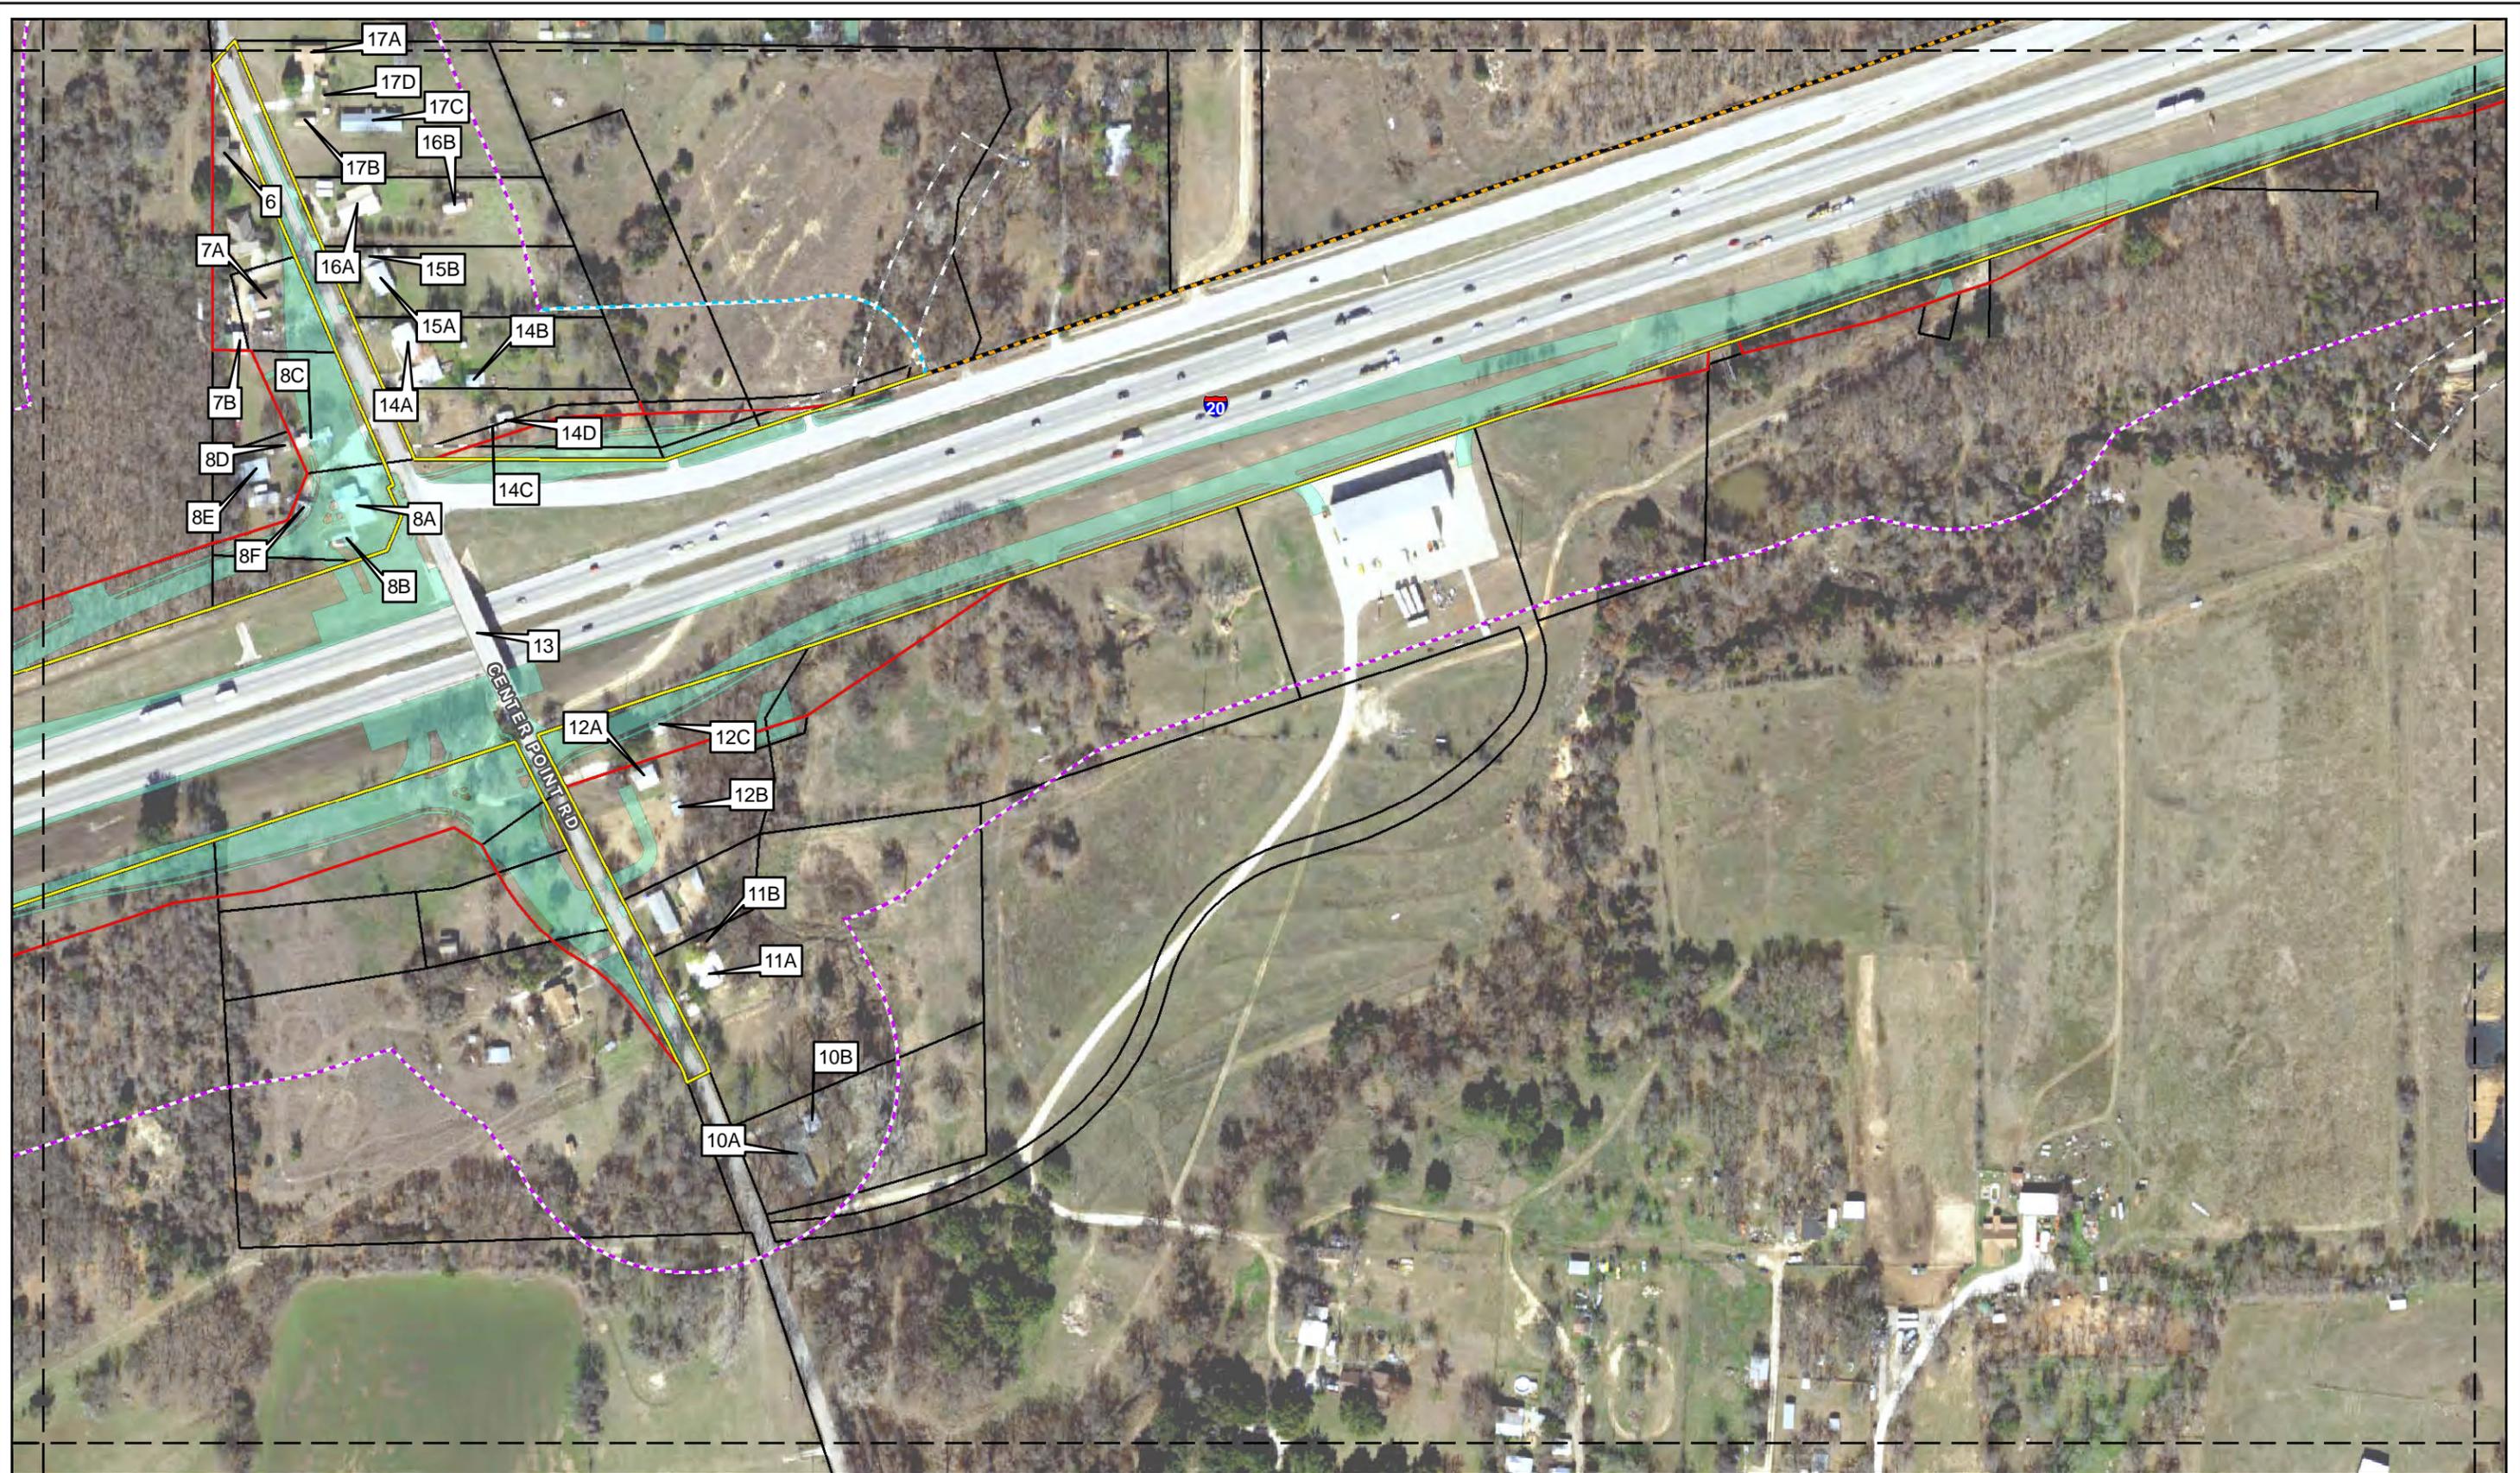

Historic Resources
 Location Map
 Sheet 7 of 11

- Existing Right-of-Way
- Proposed Right-of-Way
- Proposed Permanent Easement
- Proposed Temporary Easement
- Existing Easement
- Proposed New Pavement
- Available Property Lines
- Historic-Age Resource
- Sheet Limits
- 300-foot APE
- 150-foot
- Existing Right-of-Way




Data Sources: CMEC (2016), Freese and Nichols (2016), Aerial Source: TNRRIS (2015)
 Prepared for: TxDOT
 CSJ: 0314-07-051, 0314-07-052, 0314-07-046
 1 in = 250 feet
 Scale: 1:3,000
 Date: 6/15/2016



Historic Resources
 Location Map
 Sheet 8 of 11

- | | | | |
|-----------------------------|-----------------------------|--------------------------|-----------------------|
| Existing Right-of-Way | Proposed Temporary Easement | Available Property Lines | 300-foot APE |
| Proposed Right-of-Way | Existing Easement | Historic-Age Resource | 150-foot |
| Proposed Permanent Easement | Proposed New Pavement | Sheet Limits | Existing Right-of-Way |

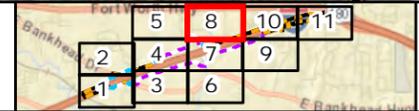


| | | |
|---|--|--|
| Data Sources: CMEC (2016), Freese and Nichols (2016), Aerial Source: TNRIS (2015) | Prepared for: TxDOT CSJ: 0314-07-051, 0314-07-052, 0314-07-046 | 1 in = 250 feet Scale: 1:3,000 Date: 6/15/2016 |
| | | |

G:\Projects\FreeseNichols\Centerpoint Rd\Historic Resources_tabloid_20160613.mxd



Historic Resources
 Location Map
 Sheet 9 of 11

- Existing Right-of-Way
- Proposed Right-of-Way
- Proposed Permanent Easement
- Proposed Temporary Easement
- Existing Easement
- Proposed New Pavement
- Available Property Lines
- Historic-Age Resource
- Sheet Limits
- APE**
- 300-foot
- 150-foot
- Existing Right-of-Way

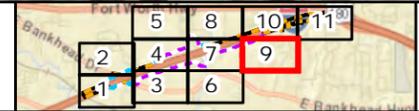


| | | |
|--|--|--|
| | | 1 in = 250 feet Scale: 1:3,000 |
| Data Sources: CMEC (2016), Freese and Nichols (2016), Aerial Source: TNRRIS (2015) | | Prepared for: TxDOT CSJ: 0314-07-051, 0314-07-052, 0314-07-046 Date: 6/15/2016 |



Historic Resources
 Location Map
 Sheet 10 of 11

- Existing Right-of-Way
- Proposed Right-of-Way
- Proposed Permanent Easement
- Proposed Temporary Easement
- Existing Easement
- Proposed New Pavement
- Available Property Lines
- Historic-Age Resource
- Sheet Limits
- APE 300-foot
- 150-foot
- Existing Right-of-Way

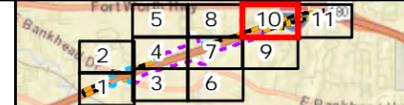

Data Sources: CMEC (2016), Freese and Nichols (2016), Aerial Source: TNRIS (2015)

Prepared for: TXDOT
 CSJ: 0314-07-051, 0314-07-052, 0314-07-046

1 in = 250 feet
 Scale: 1:3,000
 Date: 6/15/2016



Historic Resources
 Location Map
 Sheet 11 of 11

- | | | | |
|-----------------------------|-----------------------------|--------------------------|-----------------------|
| Existing Right-of-Way | Proposed Temporary Easement | Available Property Lines | 300-foot |
| Proposed Right-of-Way | Existing Easement | Historic-Age Resource | 150-foot |
| Proposed Permanent Easement | Proposed New Pavement | Sheet Limits | Existing Right-of-Way |




| | | |
|---|---|--|
| Data Sources: CMEC (2016), Freese and Nichols (2016), Aerial Source: TNRIS (2015) | Prepared for: TXDOT CSJ: 0314-07-051, 0314-07-052, 0314-07-046 | 1 in = 250 feet Scale: 1:3,000 Date: 6/15/2016 |
|---|---|--|


G:\Projects\FreeseNichols\Centerpoint Rd\Historic Resources_tabloid_20180613.mxd


Appendix D

Design Documents

| | | | | | |
|---------------------------|--|------------------------|--|-------------------------------|--|
| WIDENING ALONG MAIN LANES | | DISPLACED STRUCTURES | | PAVEMENT REMOVAL | |
| BRIDGE | | EXISTING PROPERTY LINE | | DIRECTION OF STORM WATER FLOW | |
| DRIVEWAY | | PROPOSED R.O.W. | | EXISTING ACCESS CONTROL | |
| FRONTAGE ROAD/SIDE STREET | | EXISTING R.O.W. | | PROPOSED ACCESS CONTROL | |
| SIDEWALK | | EXISTING UTILITY LINES | | DRAINAGE EASEMENT | |
| GORE AND SHOULDER | | PARCEL NUMBER | | RETAINING WALL | |
| LOCAL ROAD | | DIRECTION OF TRAFFIC | | TEMPORARY EASEMENT | |
| RAMP | | | | | |

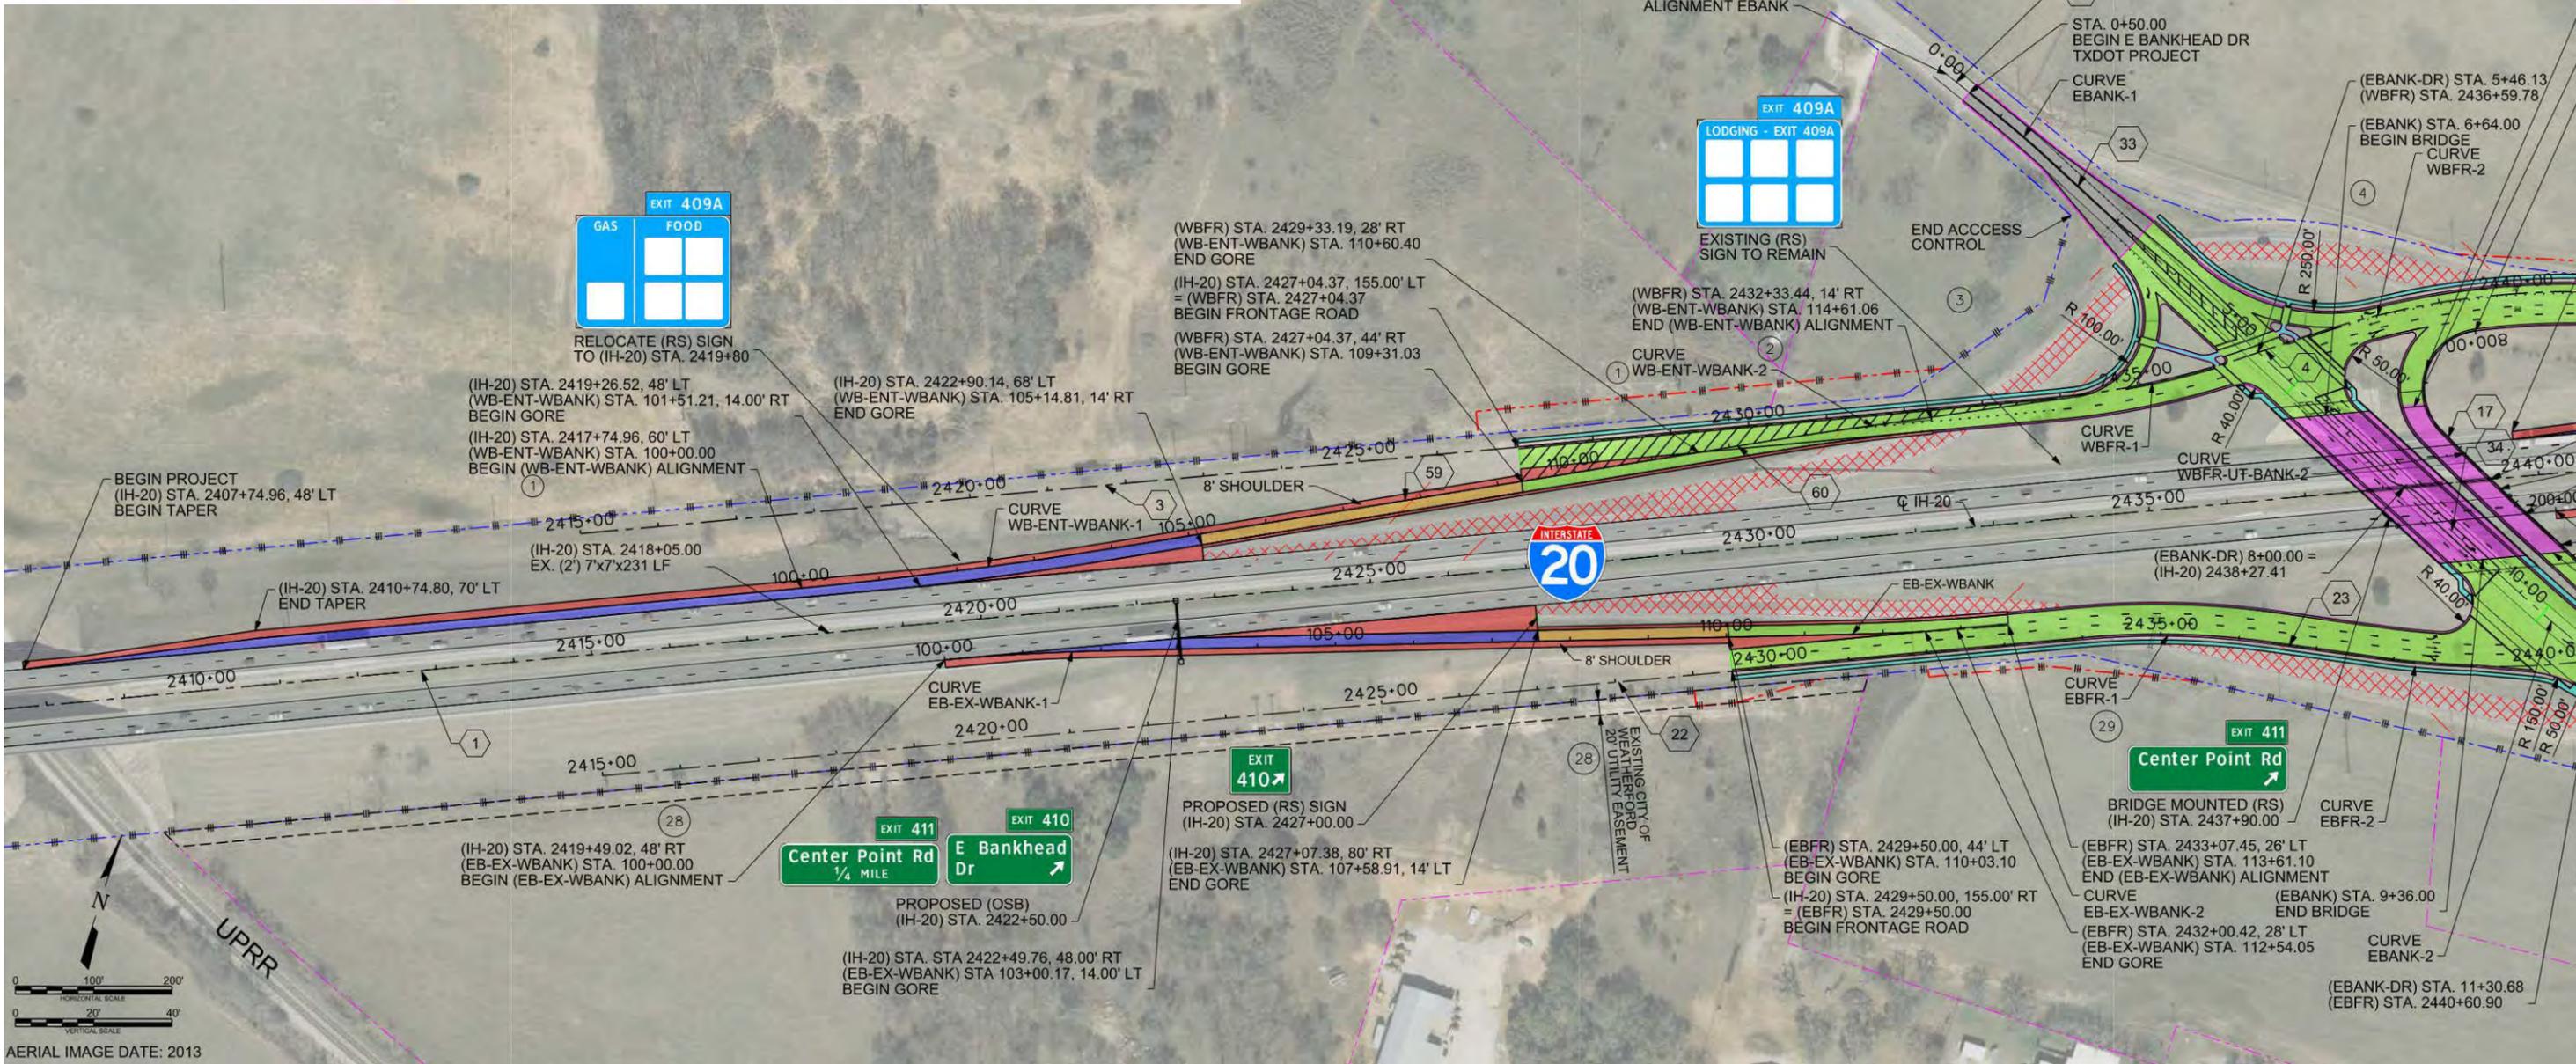


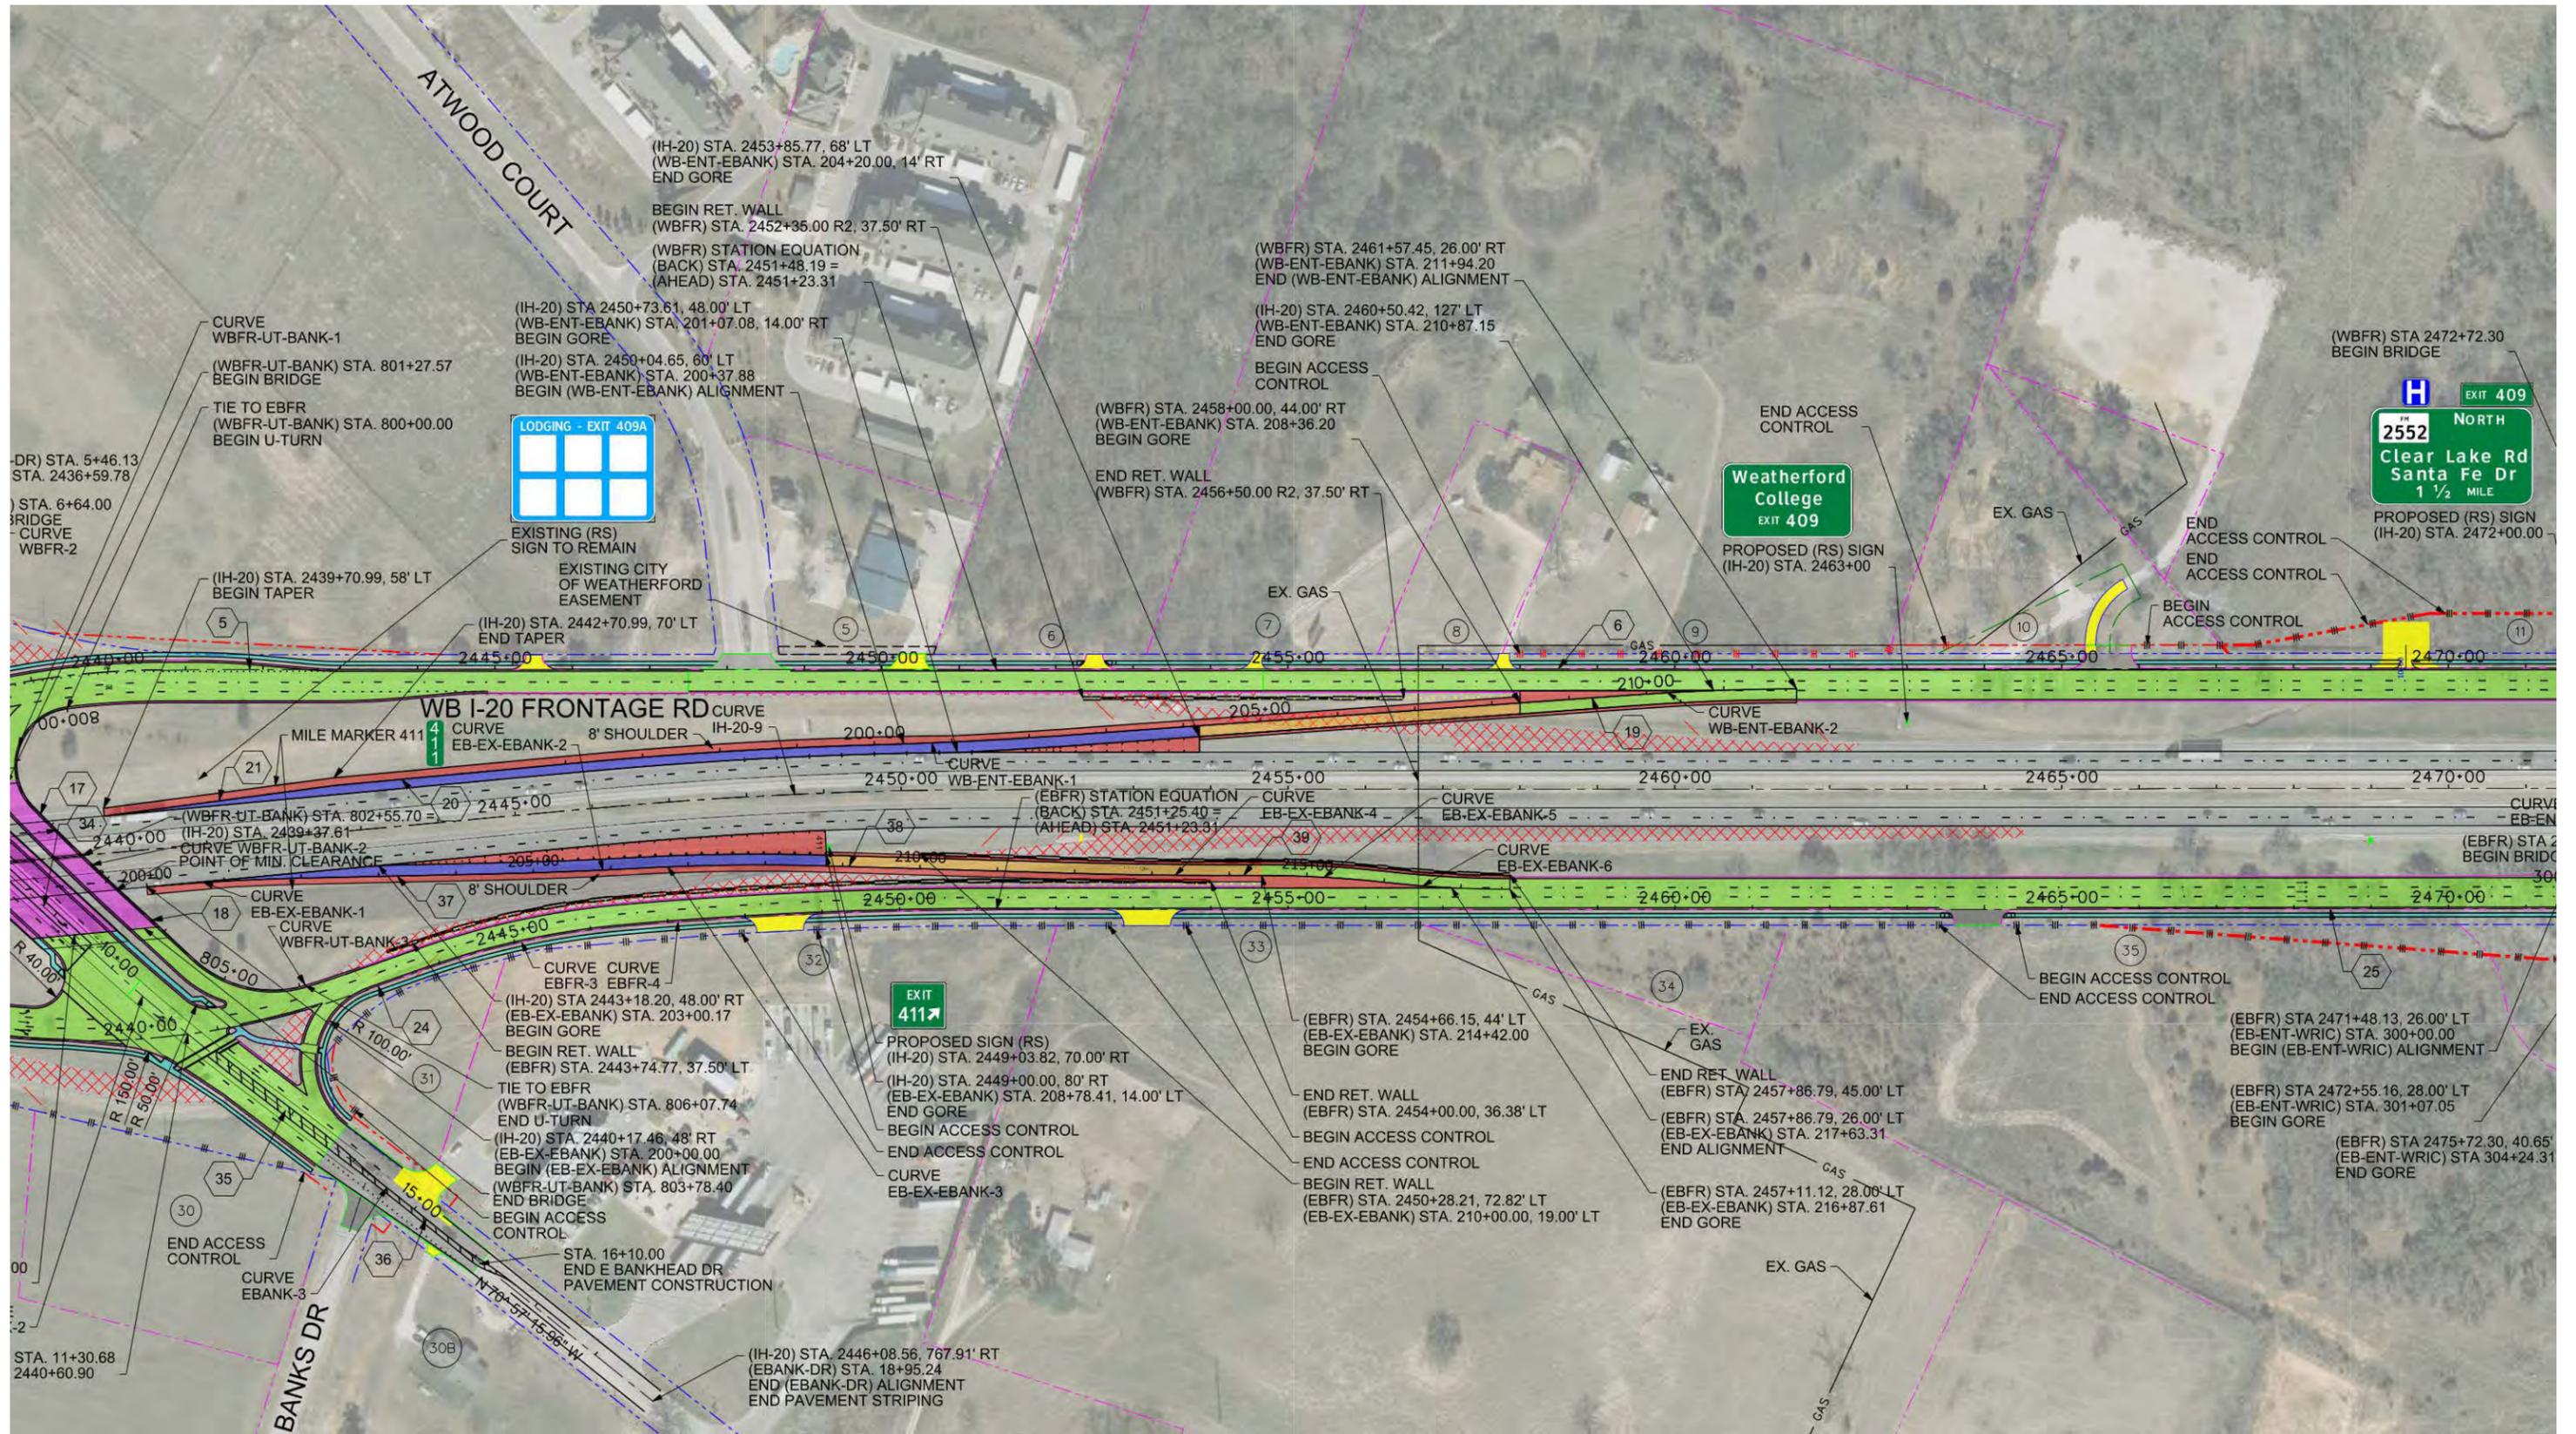


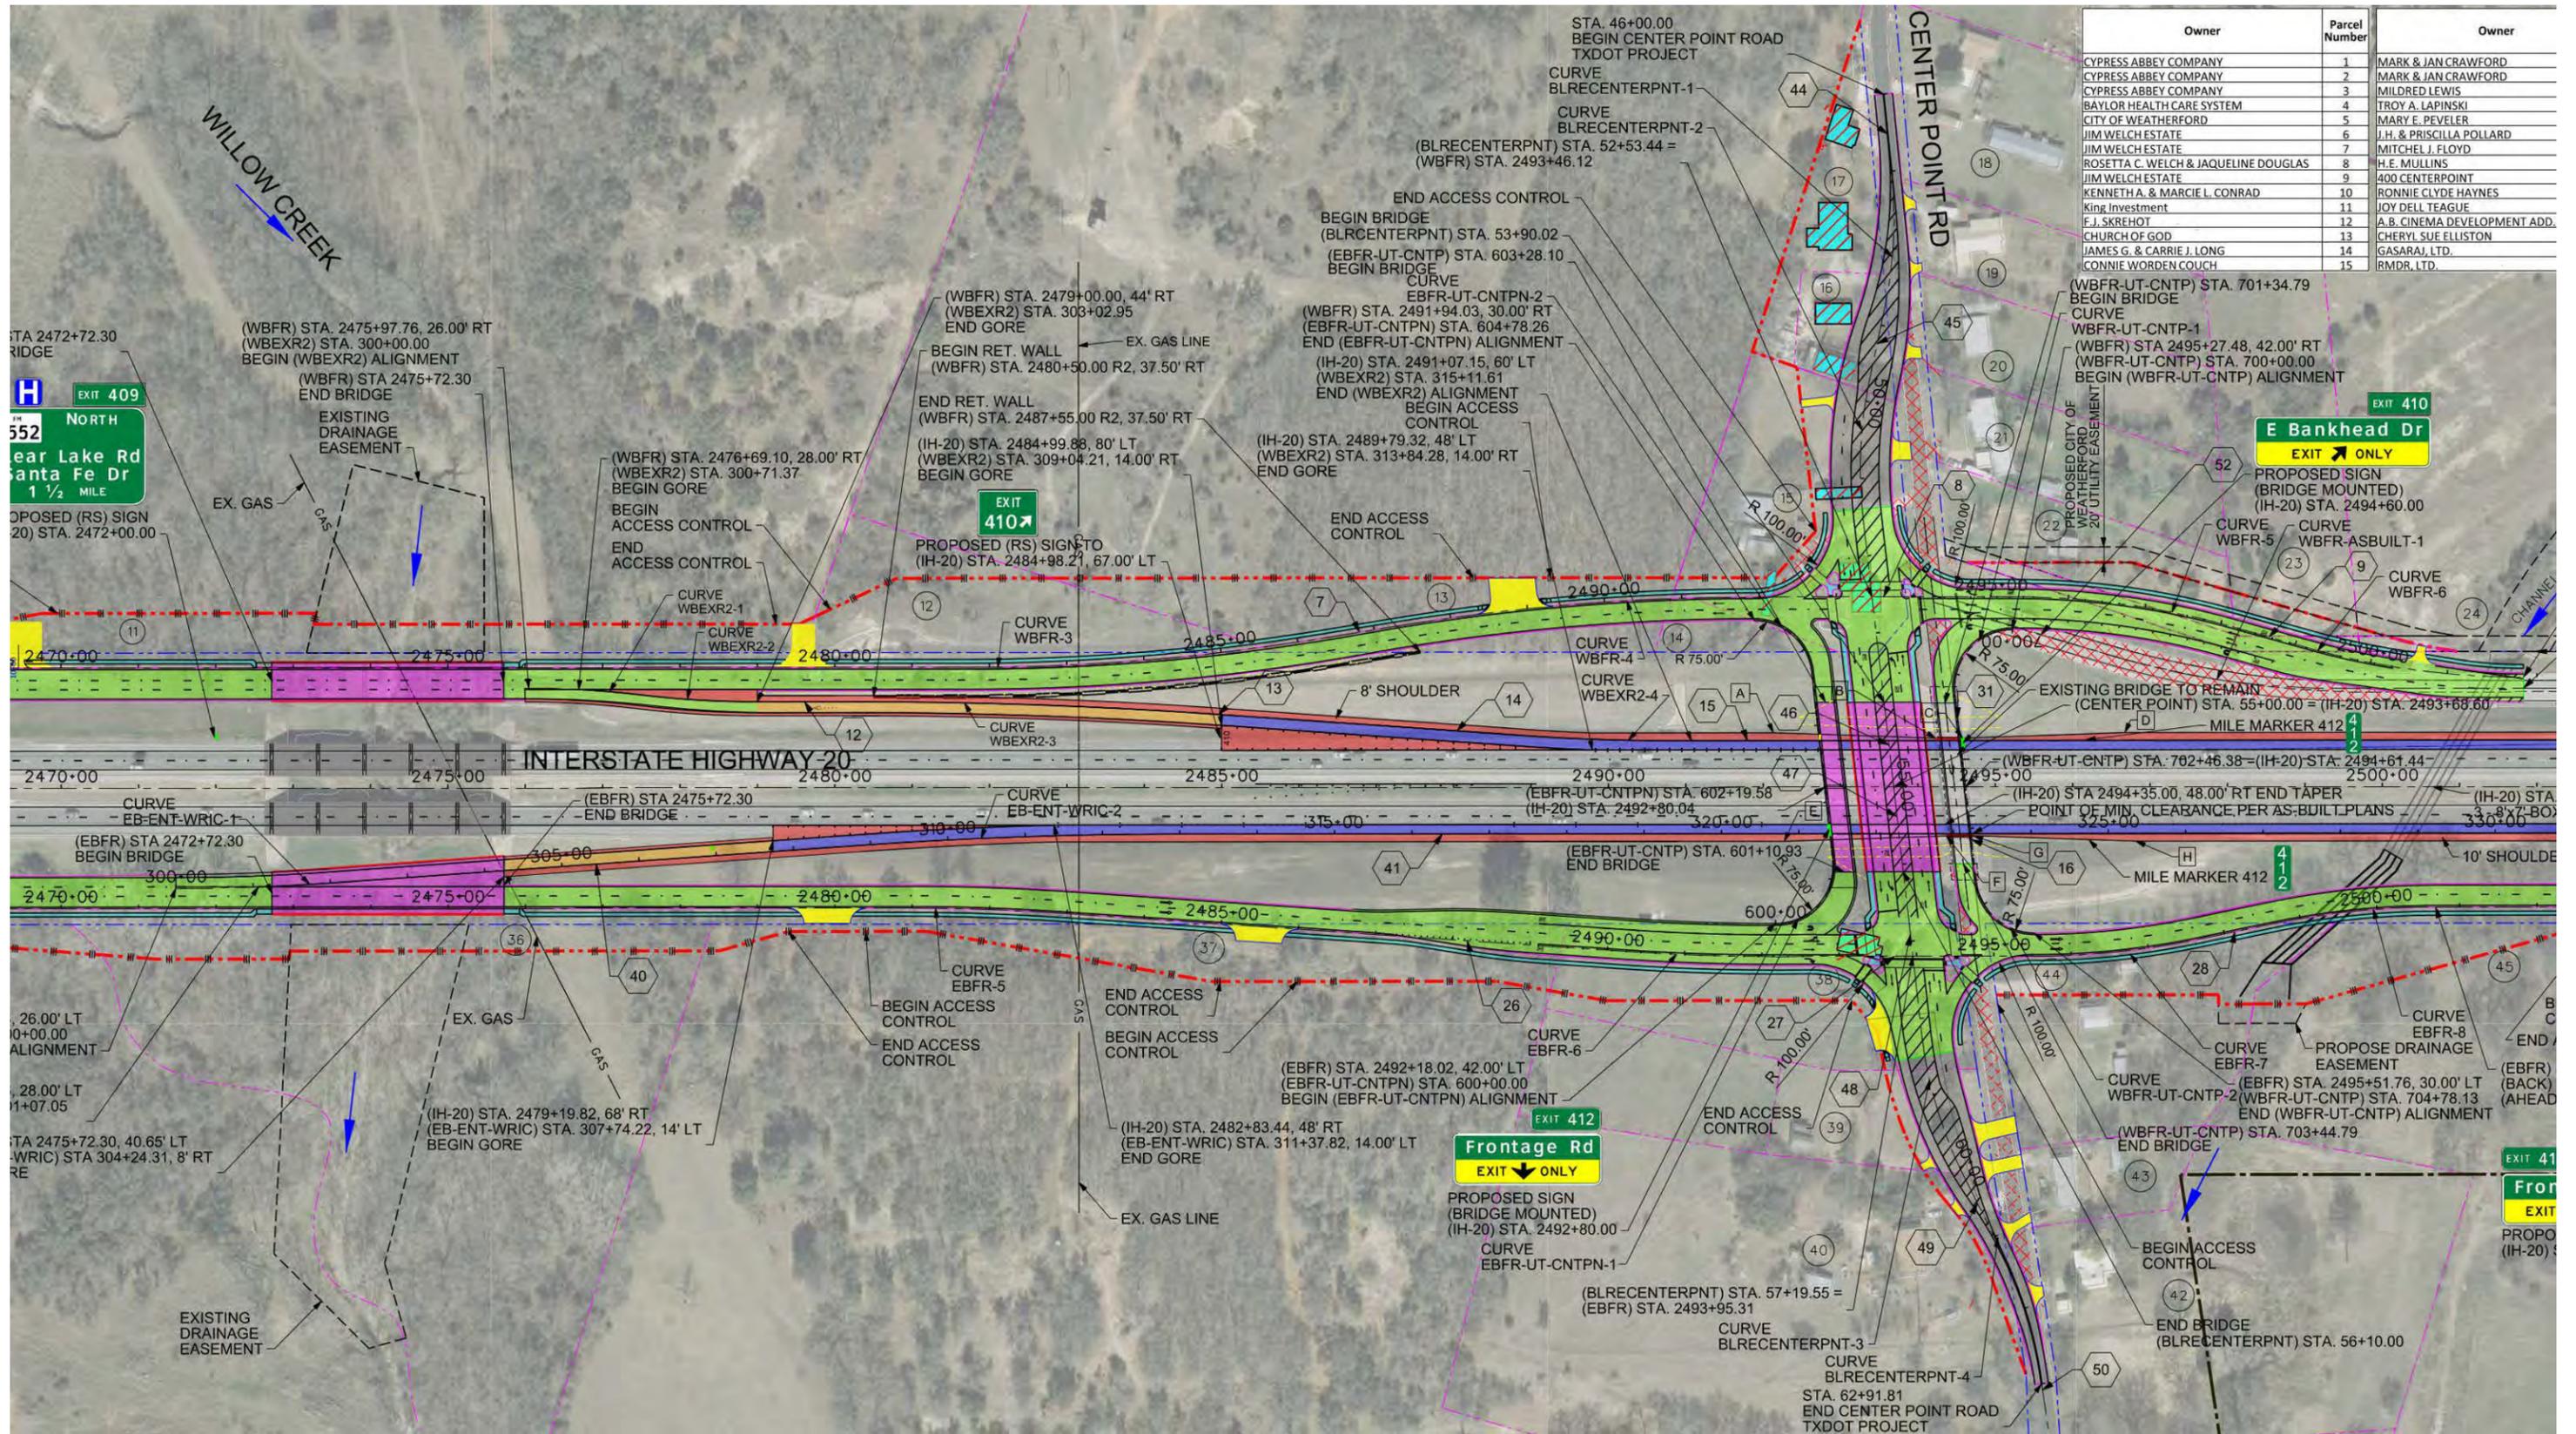

IH 20 at Center Point Road
 Project Layout
 CSJ: 0314-07-051, 0314-07-052, 0314-07-046
 Sheet 3 of 6

| ON | OFFSET |
|------|-----------|
| 2.97 | 70.00' LT |
| 2.97 | 63.00' LT |
| 7.69 | 63.00' LT |
| 7.01 | 70.00' LT |
| 7.01 | 70.00' RT |
| 1.73 | 63.00' RT |
| 1.73 | 70.00' RT |

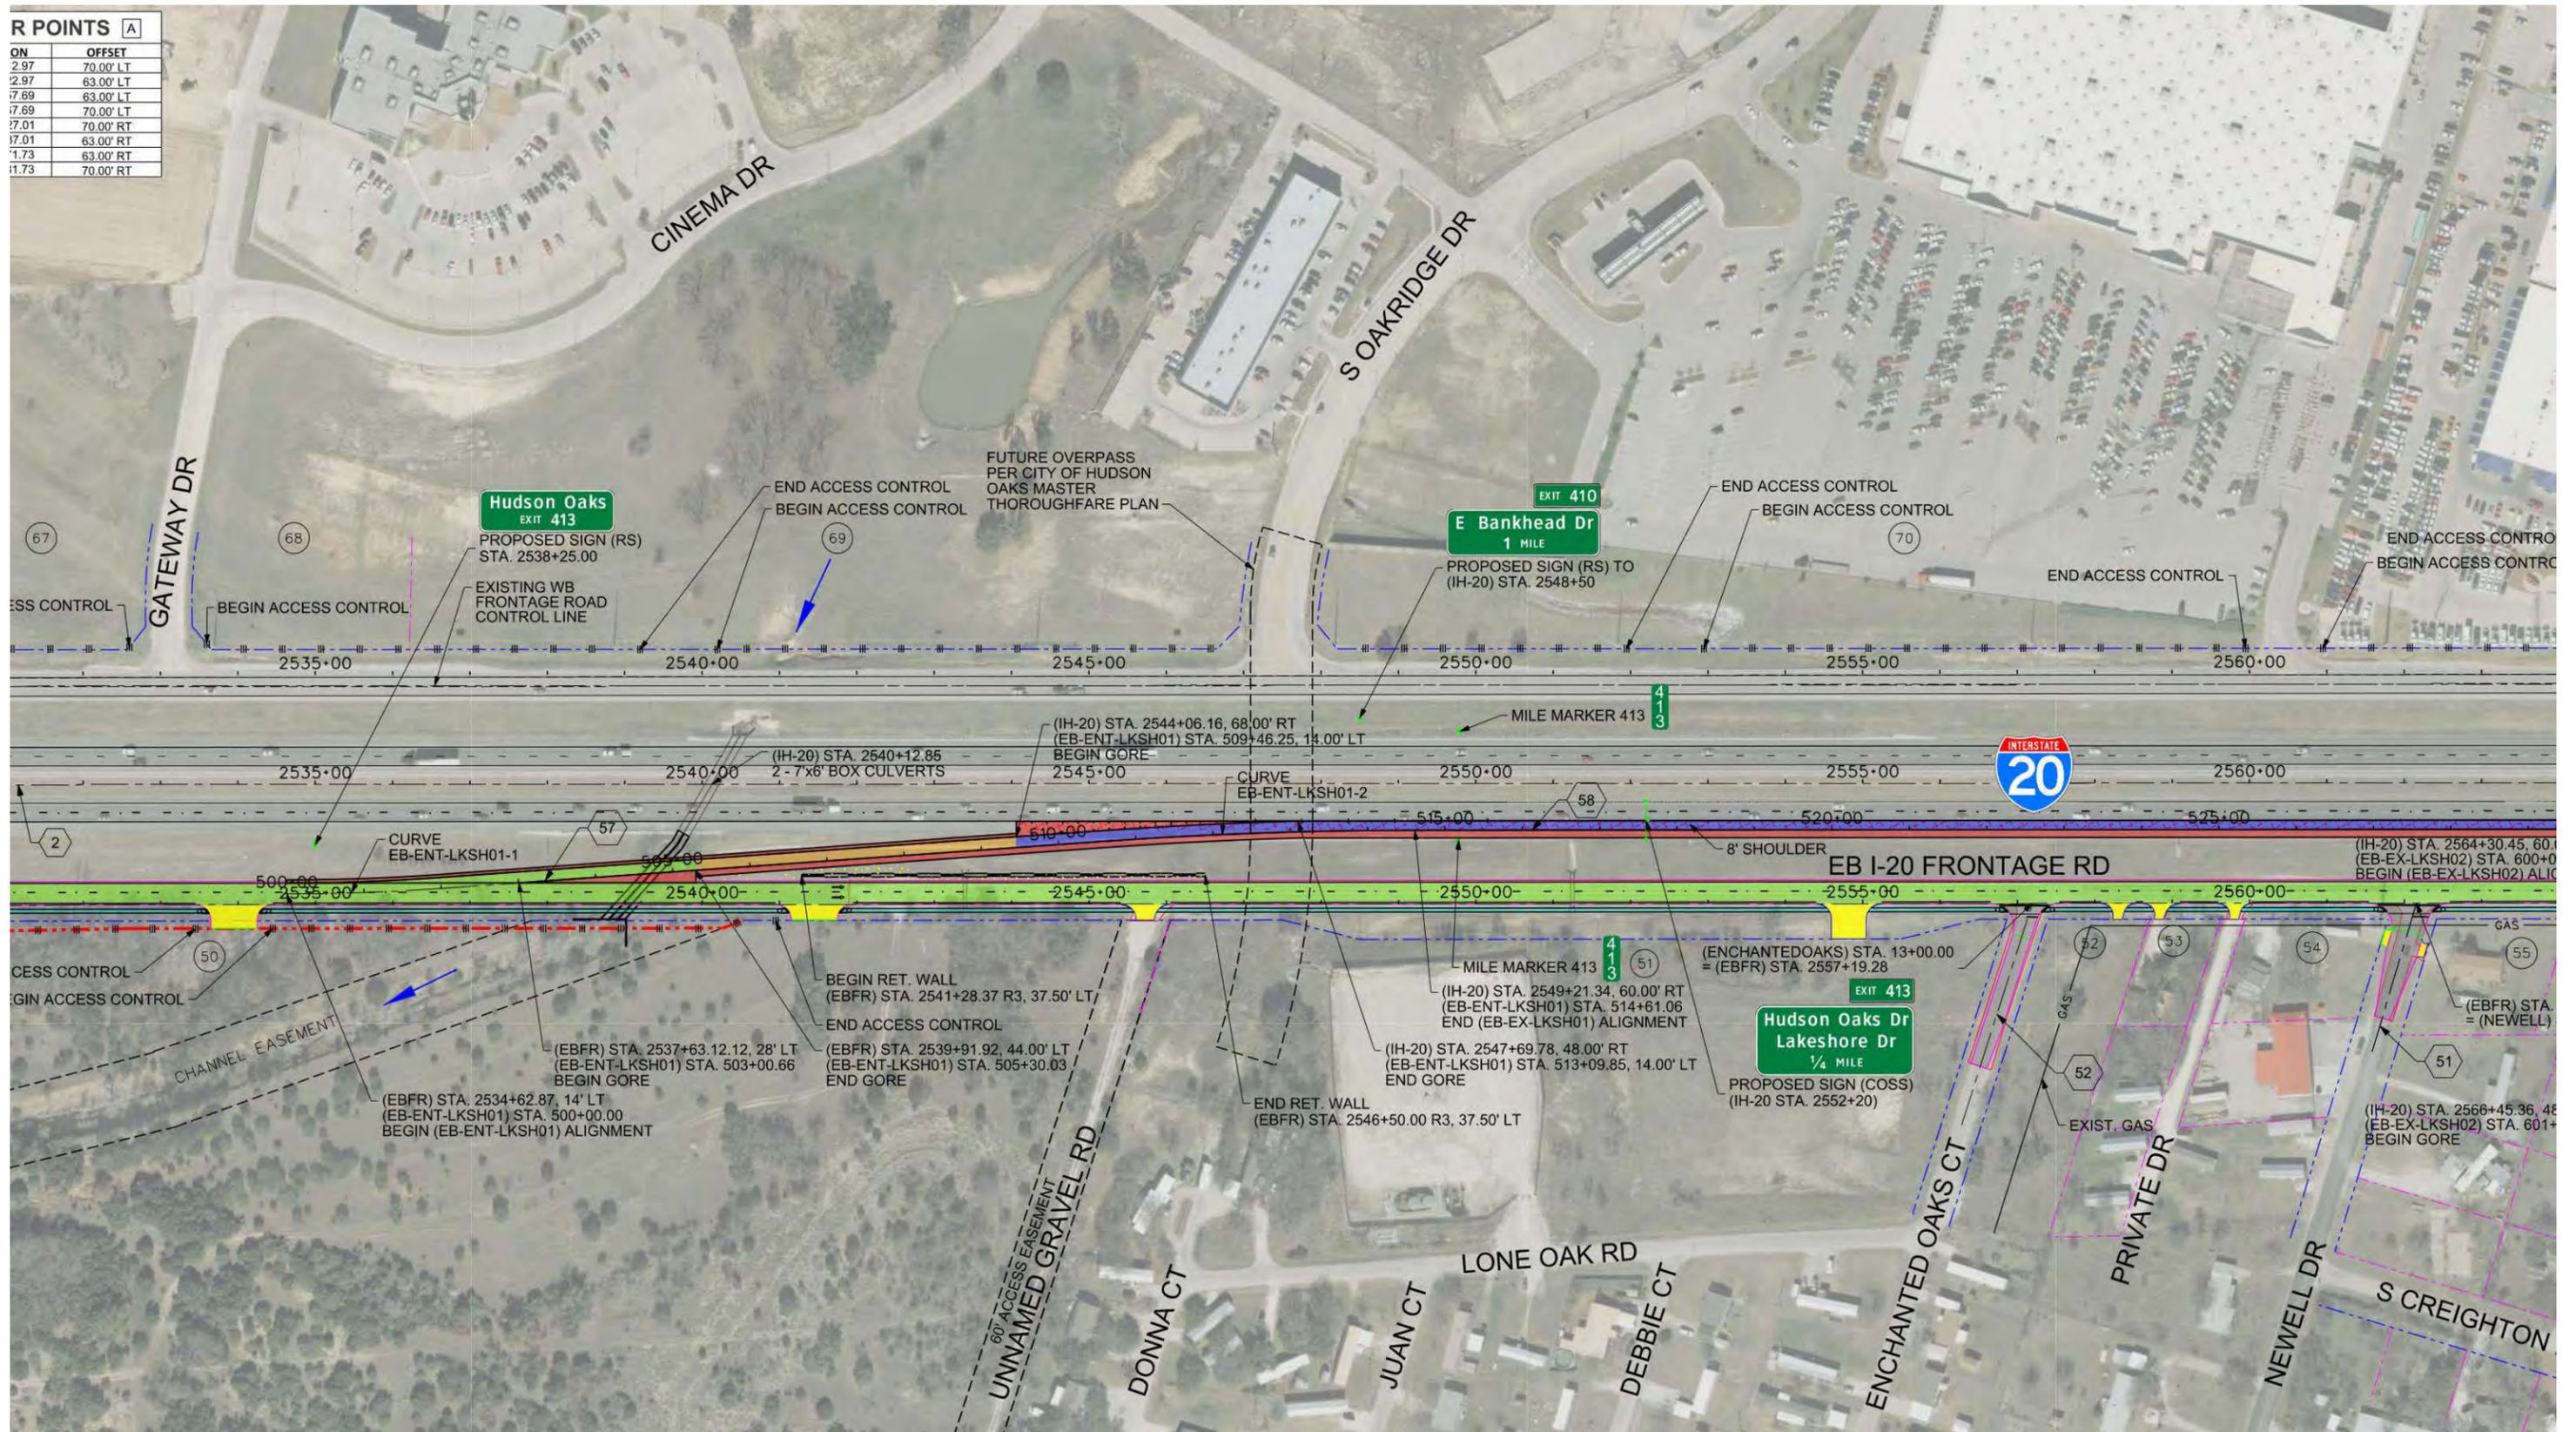








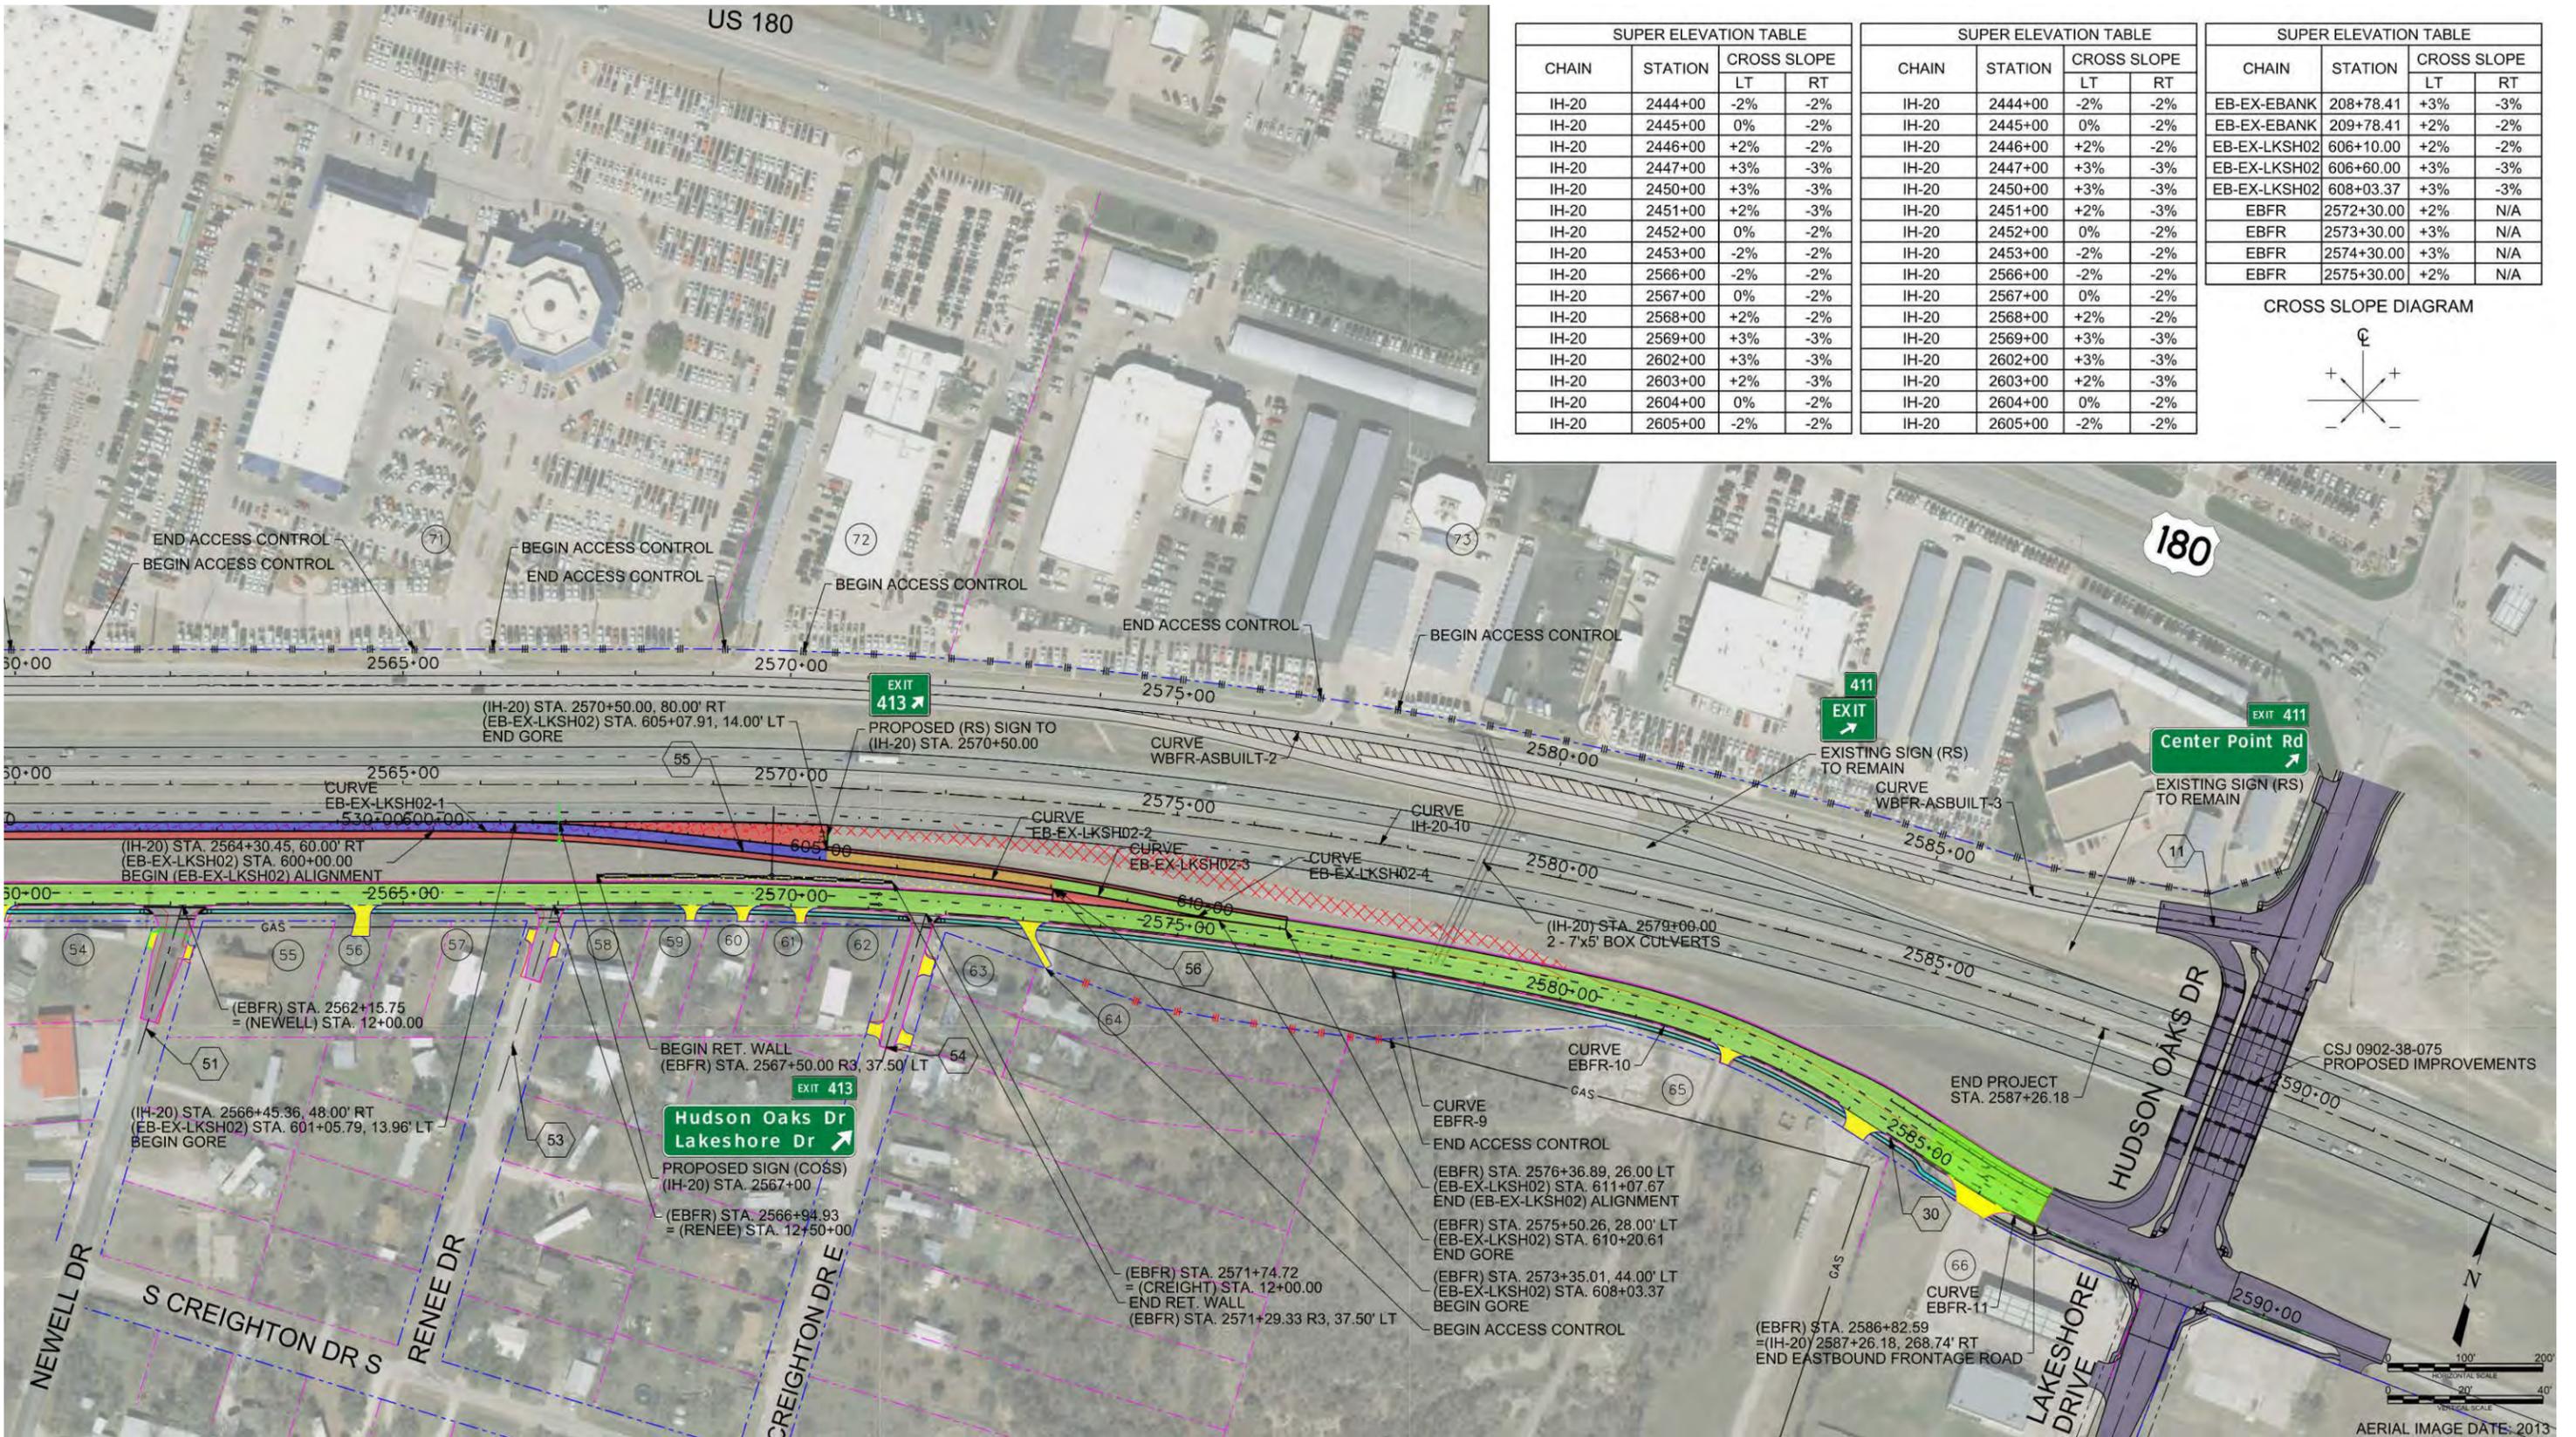


| CHAIN | STATION | CROSS SLOPE | |
|-------|---------|-------------|-----|
| | | LT | RT |
| IH-20 | 2444+00 | -2% | -2% |
| IH-20 | 2445+00 | 0% | -2% |
| IH-20 | 2446+00 | +2% | -2% |
| IH-20 | 2447+00 | +3% | -3% |
| IH-20 | 2450+00 | +3% | -3% |
| IH-20 | 2451+00 | +2% | -3% |
| IH-20 | 2452+00 | 0% | -2% |
| IH-20 | 2453+00 | -2% | -2% |
| IH-20 | 2566+00 | -2% | -2% |
| IH-20 | 2567+00 | 0% | -2% |
| IH-20 | 2568+00 | +2% | -2% |
| IH-20 | 2569+00 | +3% | -3% |
| IH-20 | 2602+00 | +3% | -3% |
| IH-20 | 2603+00 | +2% | -3% |
| IH-20 | 2604+00 | 0% | -2% |
| IH-20 | 2605+00 | -2% | -2% |





| CHAIN | STATION | CROSS SLOPE | |
|-------|---------|-------------|-----|
| | | LT | RT |
| IH-20 | 2444+00 | -2% | -2% |
| IH-20 | 2445+00 | 0% | -2% |
| IH-20 | 2446+00 | +2% | -2% |
| IH-20 | 2447+00 | +3% | -3% |
| IH-20 | 2450+00 | +3% | -3% |
| IH-20 | 2451+00 | +2% | -3% |
| IH-20 | 2452+00 | 0% | -2% |
| IH-20 | 2453+00 | -2% | -2% |
| IH-20 | 2566+00 | -2% | -2% |
| IH-20 | 2567+00 | 0% | -2% |
| IH-20 | 2568+00 | +2% | -2% |
| IH-20 | 2569+00 | +3% | -3% |
| IH-20 | 2602+00 | +3% | -3% |
| IH-20 | 2603+00 | +2% | -3% |
| IH-20 | 2604+00 | 0% | -2% |
| IH-20 | 2605+00 | -2% | -2% |

| CHAIN | STATION | CROSS SLOPE | |
|--------------|------------|-------------|-----|
| | | LT | RT |
| EB-EX-EBANK | 208+78.41 | +3% | -3% |
| EB-EX-EBANK | 209+78.41 | +2% | -2% |
| EB-EX-LKSH02 | 606+10.00 | +2% | -2% |
| EB-EX-LKSH02 | 606+60.00 | +3% | -3% |
| EB-EX-LKSH02 | 608+03.37 | +3% | -3% |
| EBFR | 2572+30.00 | +2% | N/A |
| EBFR | 2573+30.00 | +3% | N/A |
| EBFR | 2574+30.00 | +3% | N/A |
| EBFR | 2575+30.00 | +2% | N/A |

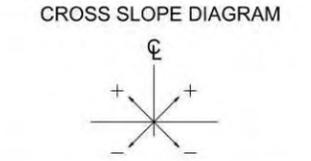

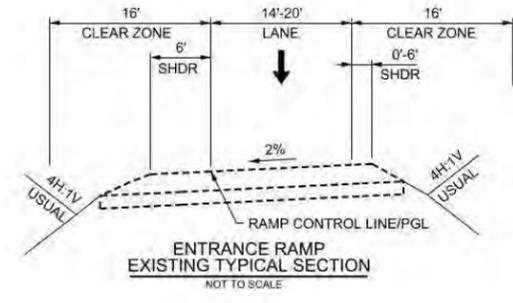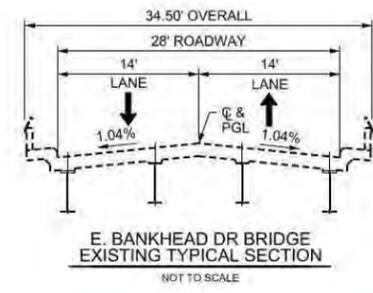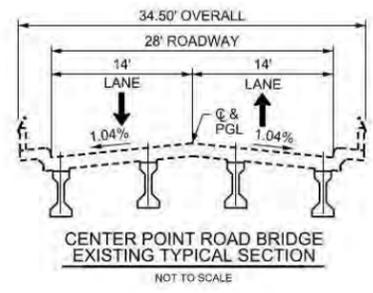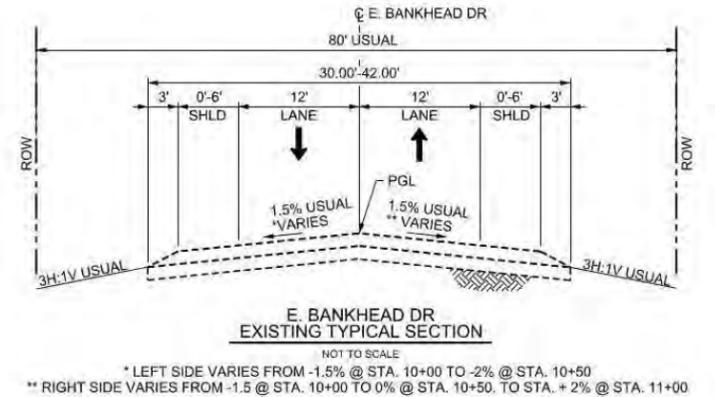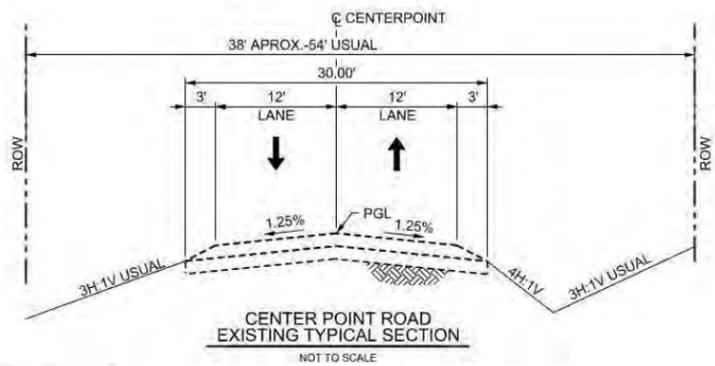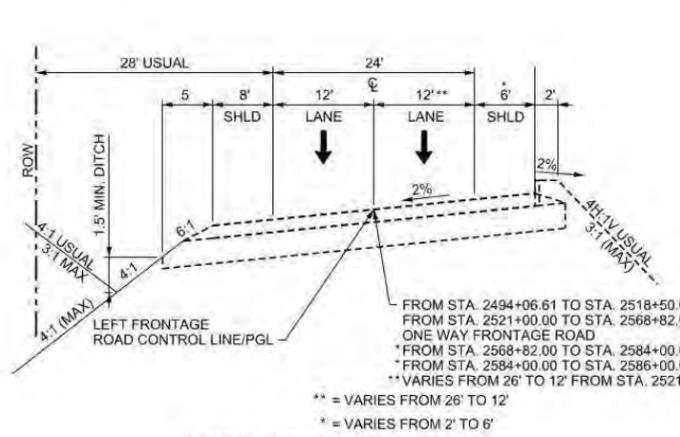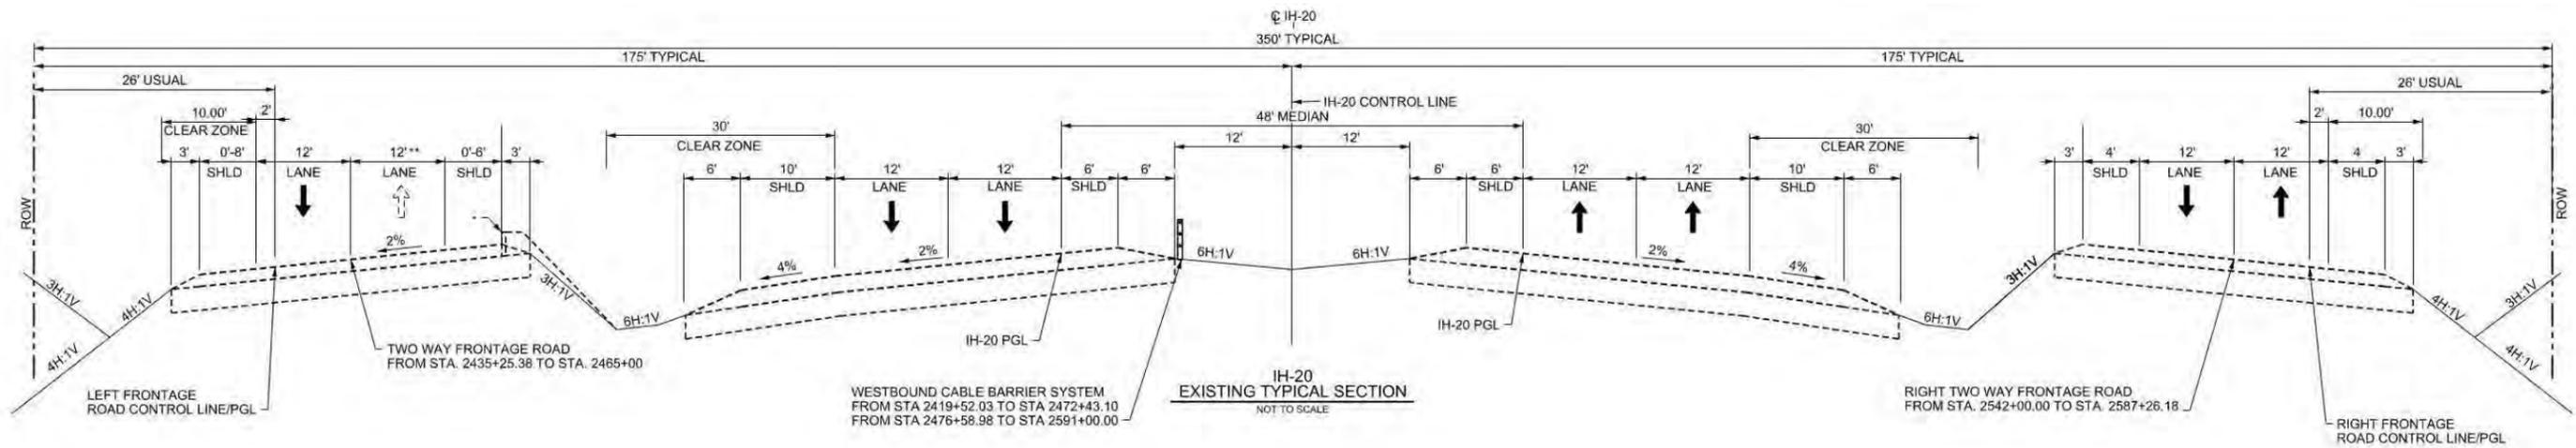

EXISTING SECTIONS

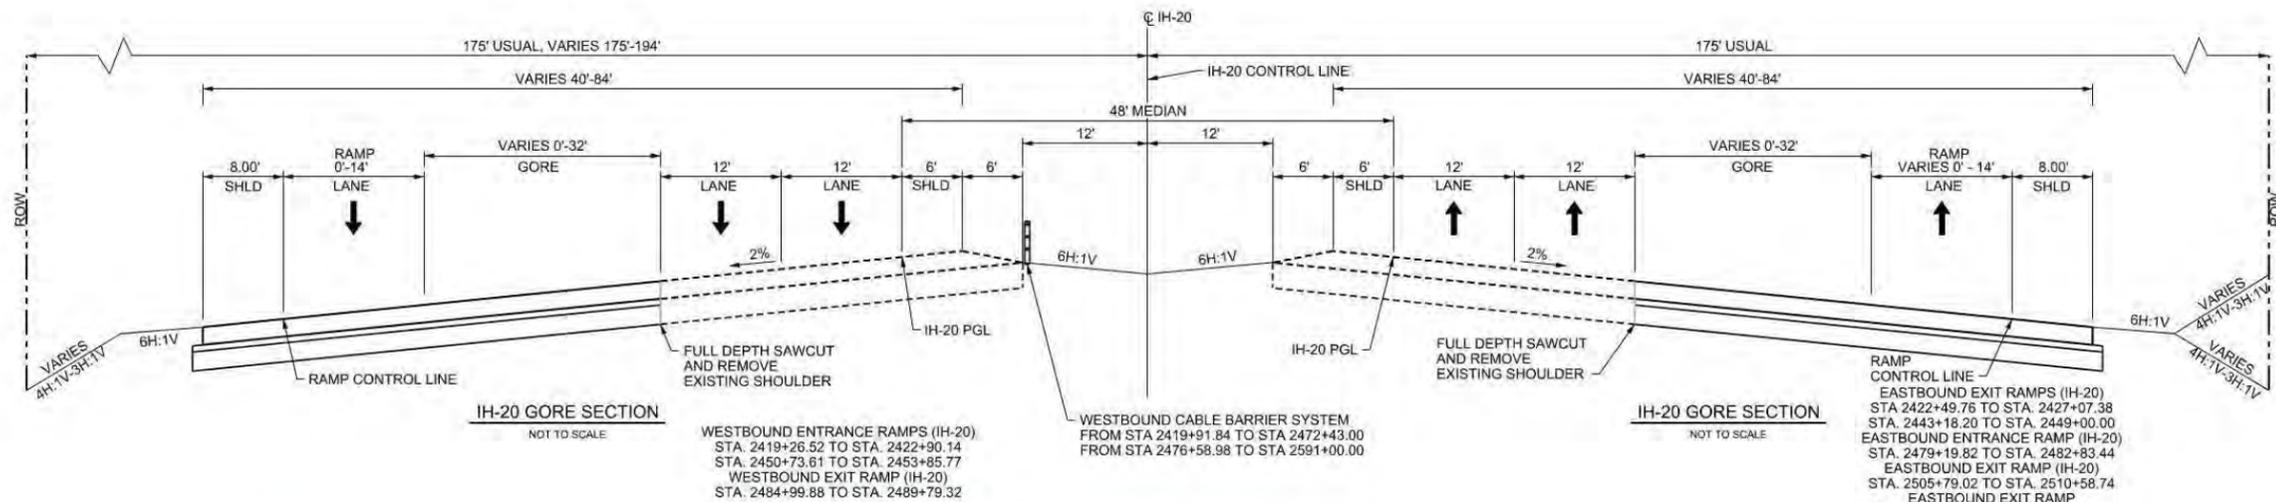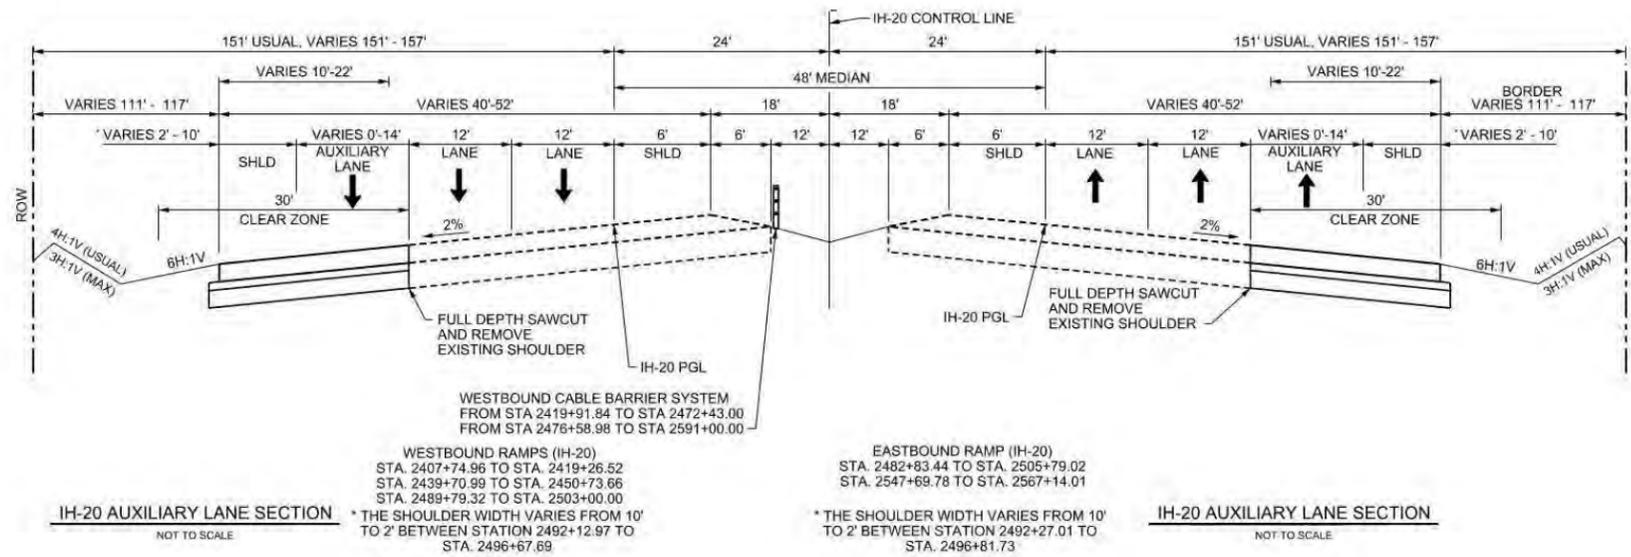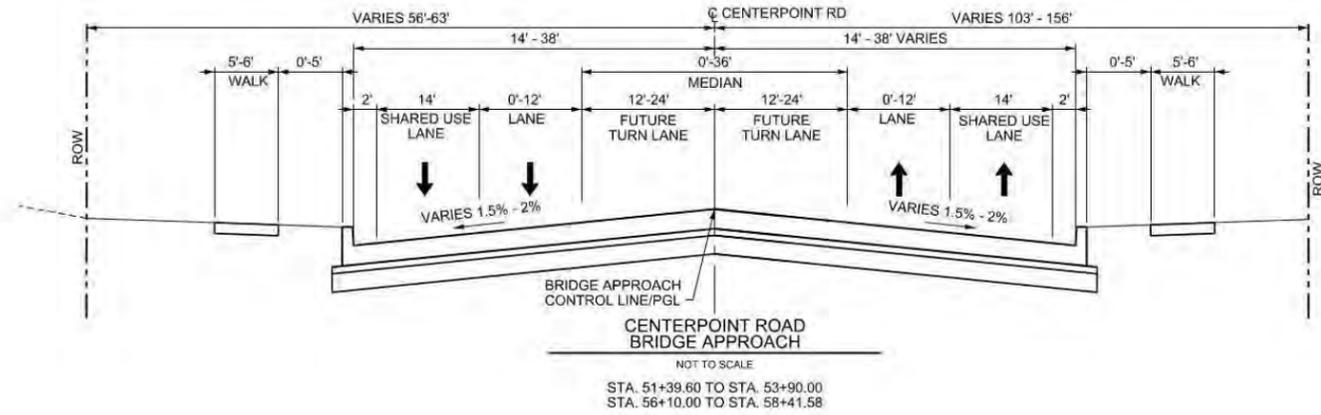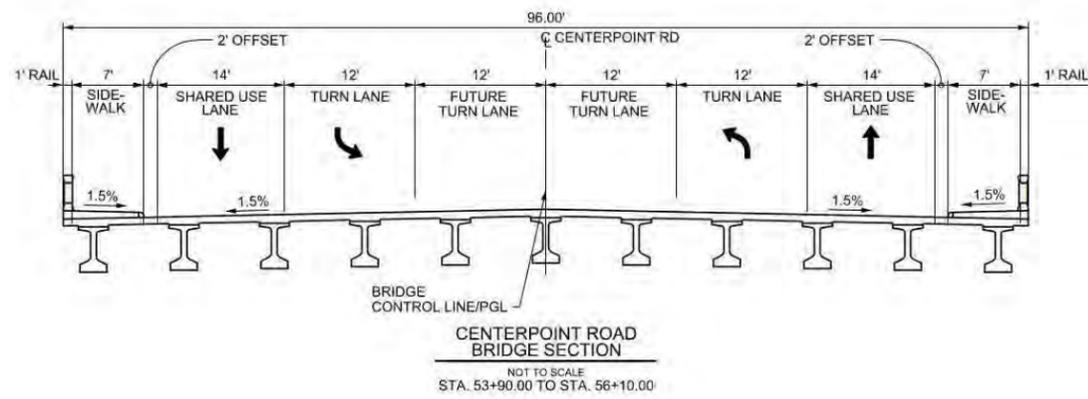




PROPOSED IH-20 / MAIN LANE AND CENTER POINT ROAD SECTIONS

IH 20 at Center Point Road




Typical Sections

CSJ: 0314-07-051, 0314-07-052, 0314-07-046

Sheet 2 of 4

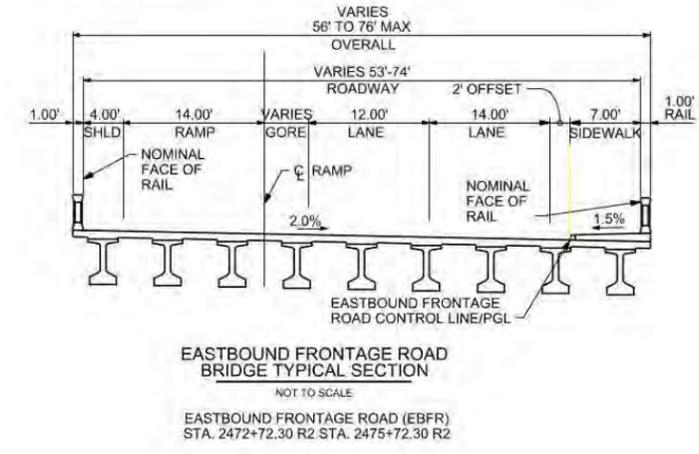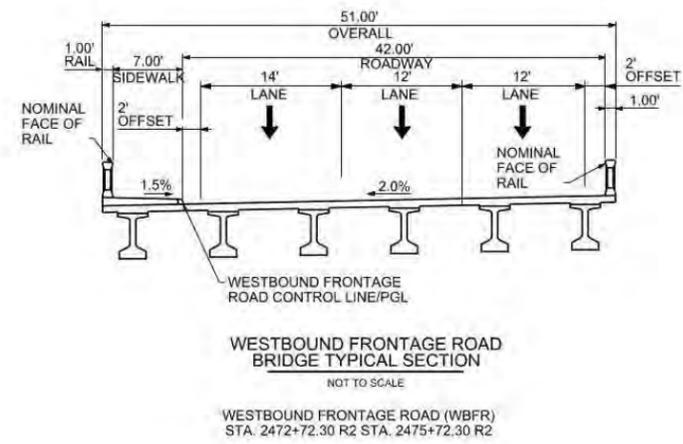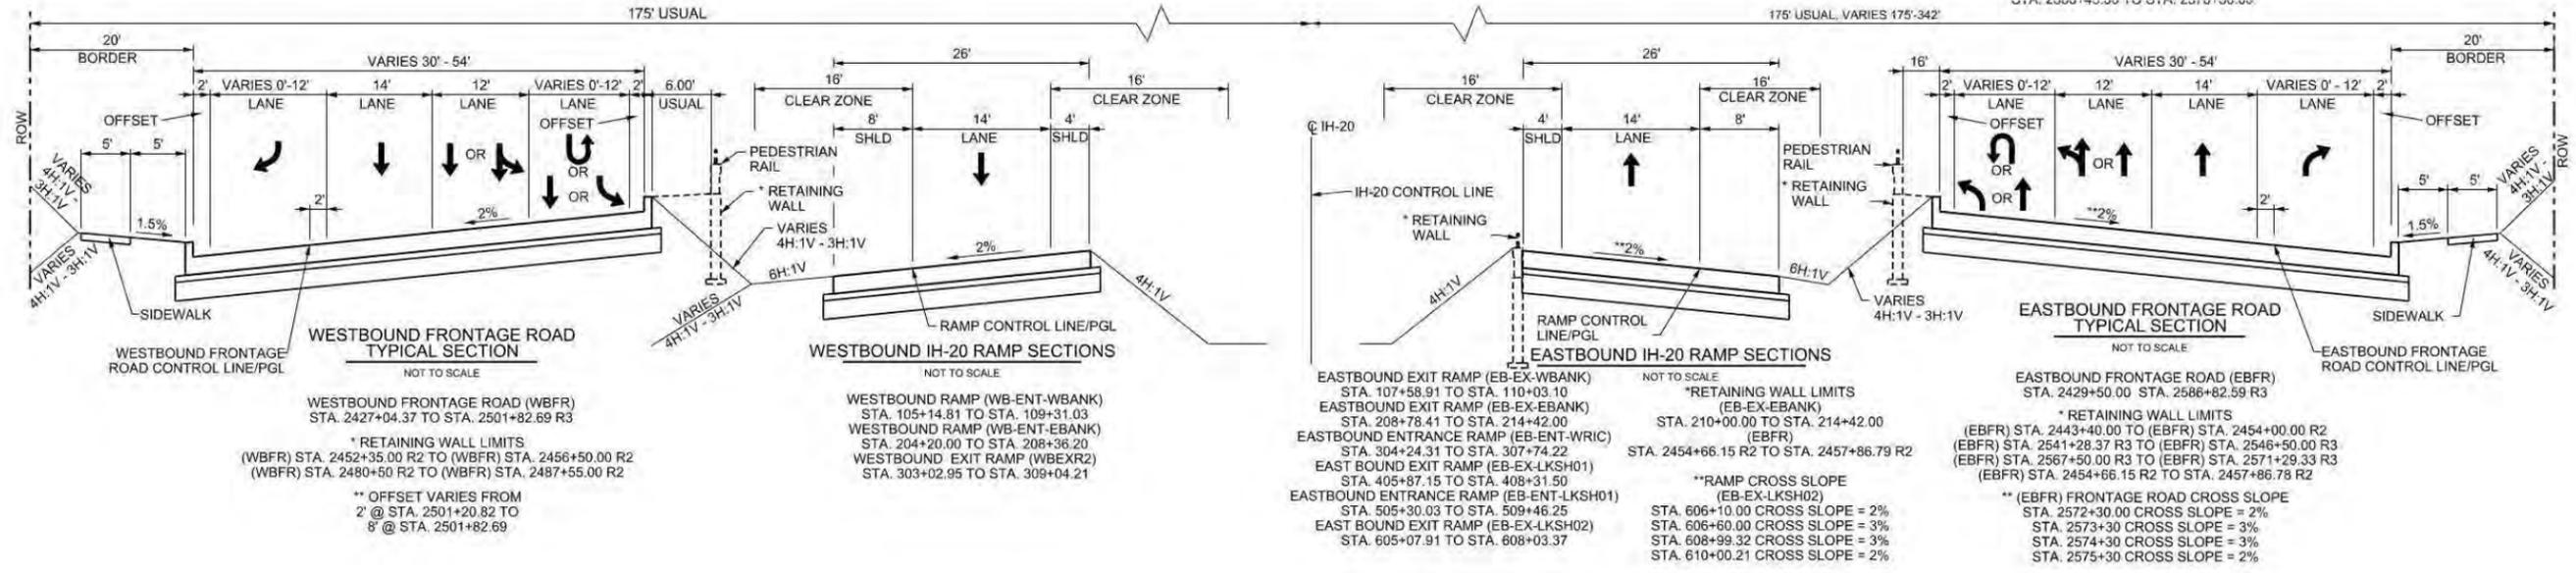

PROPOSED IH-20 / RAMP / FRONTAGE ROAD / BRIDGE TYPICAL SECTIONS

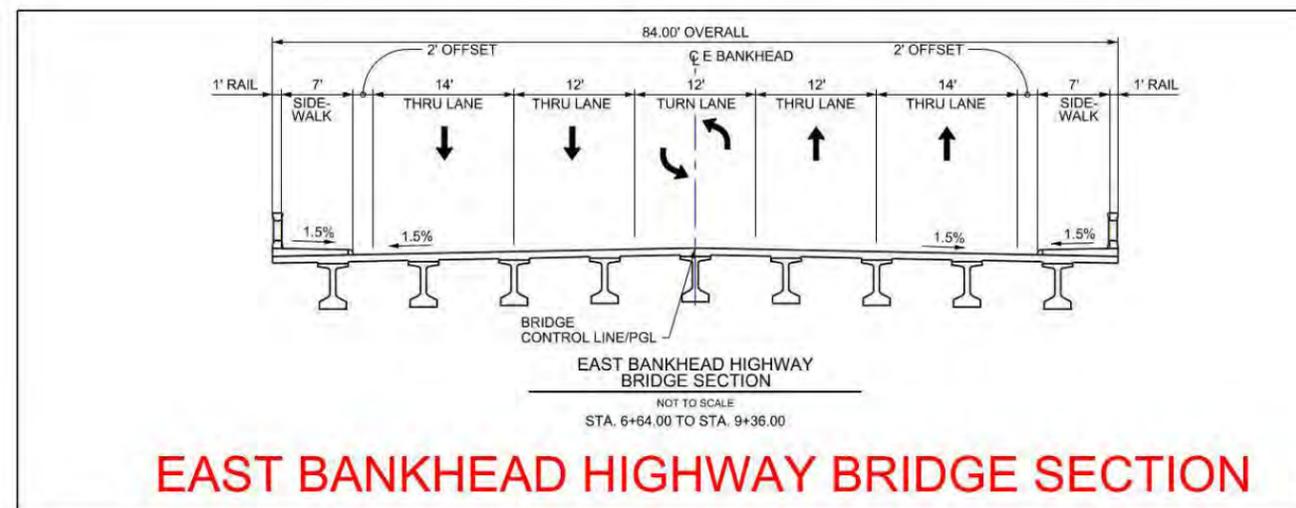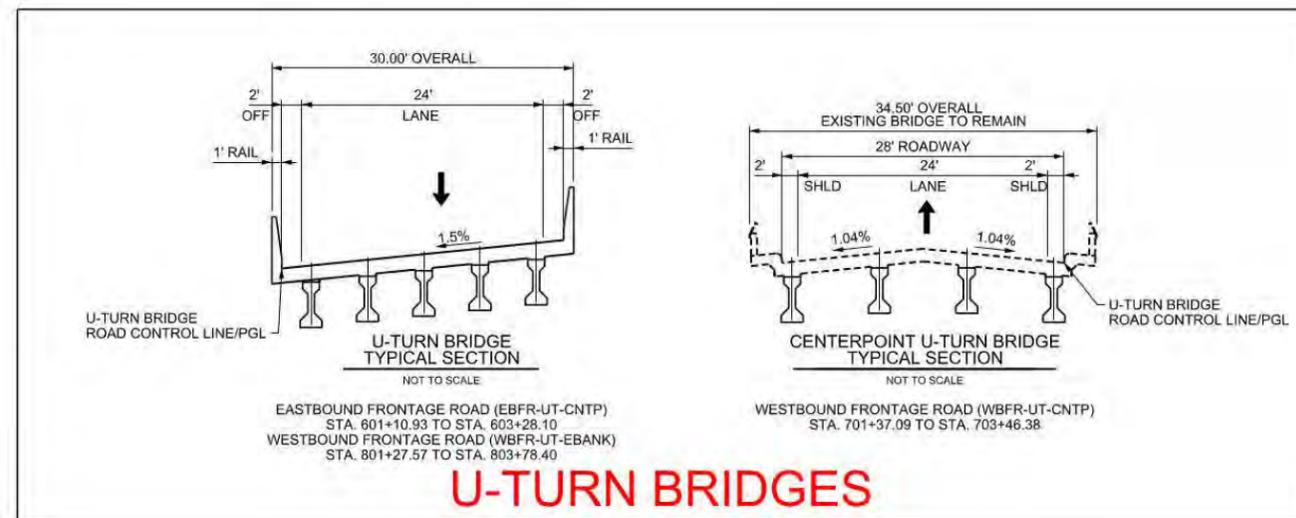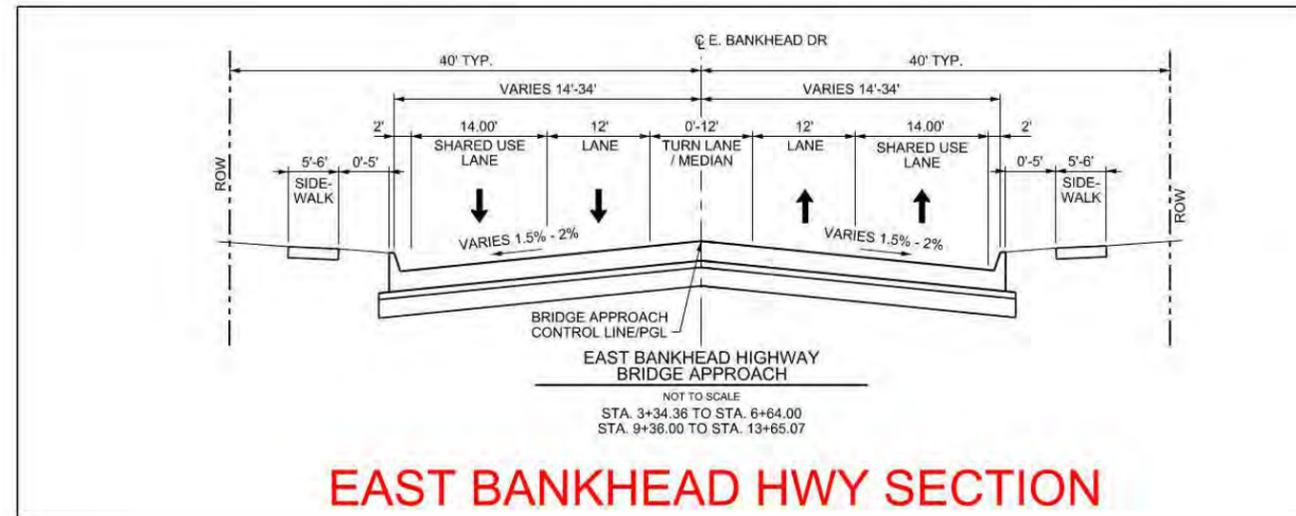

Appendix E
Consulting Party Correspondence

Heather Goodson

From: Dan Gise <drg@freese.com>
Sent: Tuesday, June 07, 2016 8:10 AM
To: Heather Goodson
Cc: Chris Bosco; Dustin Blaylock
Subject: FW: Parker Co. Historical Commission Findings on Center Point Interchange

Heather,

Below is the response from Janice Smith with the Parker County Historic Commission.

Please let me know if you have any questions.

Regards,

Dan

From: Janice Smith [mailto:janicesmith98@gmail.com]
Sent: Wednesday, May 25, 2016 10:21 AM
To: Dan Gise <drg@freese.com>
Cc: 'William Warren' <tmlbraw@att.net>; judge.riley@parkercountytexas.com
Subject: Parker Co. Historical Commission Findings on Center Point Interchange

Mr. Gise-

The PCHC has reviewed the area of the Center Point Interchange project and does not find any sites that would be affected, to our knowledge. We would like to note two cemeteries not shown on the Freese-Nichols map, both closer to the project site than the one shown on the map: the Howell Family Cemetery (TXDot Resource map #94, Texas Atlas PR-C132); and the Dawson-Hackett Cemetery (TXDot Resource map #87, Texas Atlas PR-C129). We have the coordinates for these cemeteries if needed by your staff.

Given that dinosaur bones from the Cretaceous, prehistoric Native American artifacts, and Spanish Conquistador artifacts have been found in Parker County, there is a possibility that something archeologically significant may be discovered during construction.

Thank you for contacting the PCHC. We will be happy to help in any way needed with further Parker County projects.

Janice Smith, Chair
Parker County Historical Commission

This electronic mail message is intended exclusively for the individual or entity to which it is addressed. This message, together with any attachment, may contain the sender's organization's confidential and privileged information. The recipient is hereby notified to treat the information as confidential and privileged and to not disclose or use the information except as authorized by sender's organization. Any unauthorized review, printing, retention, copying, disclosure, distribution, retransmission, dissemination or other use of, or taking of any action in reliance upon, this information by persons or entities other than the intended recipient is prohibited. If you received this message in error, please immediately contact the sender by reply email and delete all copies of the material from any computer. Thank you for your cooperation.